

M E M O R A N D U M
CITY OF CLEARWATER

TO: Distribution A

FROM: Eleanor Breland, Affirmative Action Officer *EB*

SUBJECT: City of Clearwater's ADA Transition Plan

COPIES:

DATE: September 22, 1992

The attached book is your departmental copy of the Americans With Disabilities Act Transition Plan for the City of Clearwater. Please review this information with special attention to any City facilities that you occupy, or that are used by your departmental employees. If there are any questions or concerns as to how the use of the building has been listed, please contact me as soon as possible.

Thank you for your cooperation in this matter.



CITY OF CLEARWATER

POST OFFICE BOX 4748
CLEARWATER, FLORIDA 34618-4748

Affirmative Action Office
462-6712

August 28, 1992

Dear Disabled Rights Advocate:

Attached is a copy of the City of Clearwater's Transition Plan that the 1990 American With Disabilities Act (ADA) requires and the implementing regulations as required.

It is the intent of the City of Clearwater to make every effort to comply with every aspect of this law and its regulations on or before the statutory deadline. The following areas are being reviewed to determine the best methods to be utilized for full ADA compliance:

1. Closed captioning on the cable broadcasts of the City Commission meetings.
2. Braille computer software and printers, or contracting these services out.
3. Special sound systems to enhance city government meetings held in the Commission Chambers and other City facilities for hearing impaired persons in attendance.

Please feel free to review and comment on our Transition Plan. Any comments, suggestions or concerns you have may be addressed to me at the above address and phone number. The physical location of my office is 400 North Myrtle Avenue, Clearwater, FL 34615. A copy of the plan is on file in the City Clerk's office for review by the general public.

The City of Clearwater wishes to serve all of its citizens in the most effective manner possible.

Sincerely,

A handwritten signature in cursive script, appearing to read "Eleanor Breland".

Eleanor Breland
Affirmative Action Officer



**CITY OF CLEARWATER
AMERICAN WITH DISABILITIES ACT TRANSITION PLAN**

RESPONSIBLE AGENT FOR ADA

Eleanor Breland
Affirmative Action Officer
City of Clearwater
400 North Myrtle Avenue
P. O. Box 4748
Clearwater, FL 34618
(813) 462-6712

TRANSITION PLAN COMPLIED BY

Steven Kelly
Building & Maintenance Superintendent
City Hall Annex

Eleanor Breland
Affirmative Action Officer
Community Relations Office
First Floor - Gas Building

BUILDINGS & FACILITIES SURVEY PERFORMED BY

Tom Condon
Independent Contractor

SPECIAL THANKS TO -

Sylvia Hall, Staff Assistant II
General Services Department
Building & Maintenance Division

SELF-EVALUATION AND TRANSITION PLAN


TABLE OF CONTENTS

TRANSITION PLAN

SELF-EVALUATION COMMITTEE

SELF-EVALUATION OF PROGRAMS AND ACTIVITIES

SURVEY OF CITY BUILDINGS AND FACILITIES

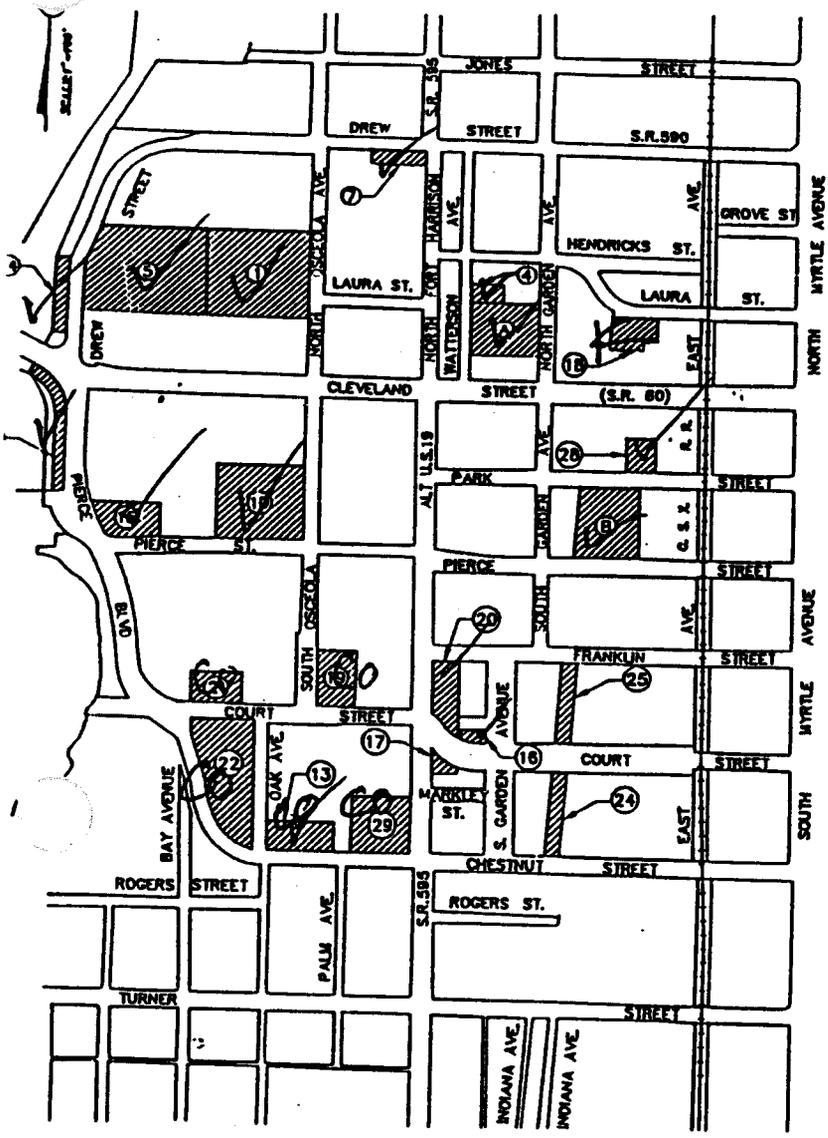

CITY GARAGES

NO. SPACES


 
- A. GARDEN AVENUE GARAGE 270
- B. PARK STREET GARAGE 409

CITY PARKING LOTS

- 1. OSCEOLA SOUTH OF LIBRARY 175
- 4. WATERSON AVENUE 9
- 5. COACHMAN 240
- 7. DREW STREET & N. FT. HARRISON 17
- 10. CITY HALL 59
- 11. PIERCE BLVD. SOUTH OF CLEVELAND STREET 60
- 13. LARGE COURTHOUSE LOT 59
- 14. DREW STREET EXTENSION 22
- 15. OLD AUDITORIUM 62
- 16. COURT STREET & GARDEN AVENUE 7
- 17. COURT STREET & FT. HARRISON 22
- 18. KRAVAS 49
- 19. COURT STREET & OSCEOLA AVENUE 41
- 20. COURT STREET & FT. HARRISON 6
- 21. COURT STREET WEST OF OSCEOLA AVENUE 10
- 22. OAK STREET BETWEEN OSCEOLA & CHESTNUT 99
- 24. CHESTNUT STREET (PERMIT PARKING ONLY) 99
- 25. COURT STREET 16
- 28. PARK STREET 25
- 29. FT. HARRISON AVENUE 32

CITY PARKING LOTS

10/2/91
MAHONY

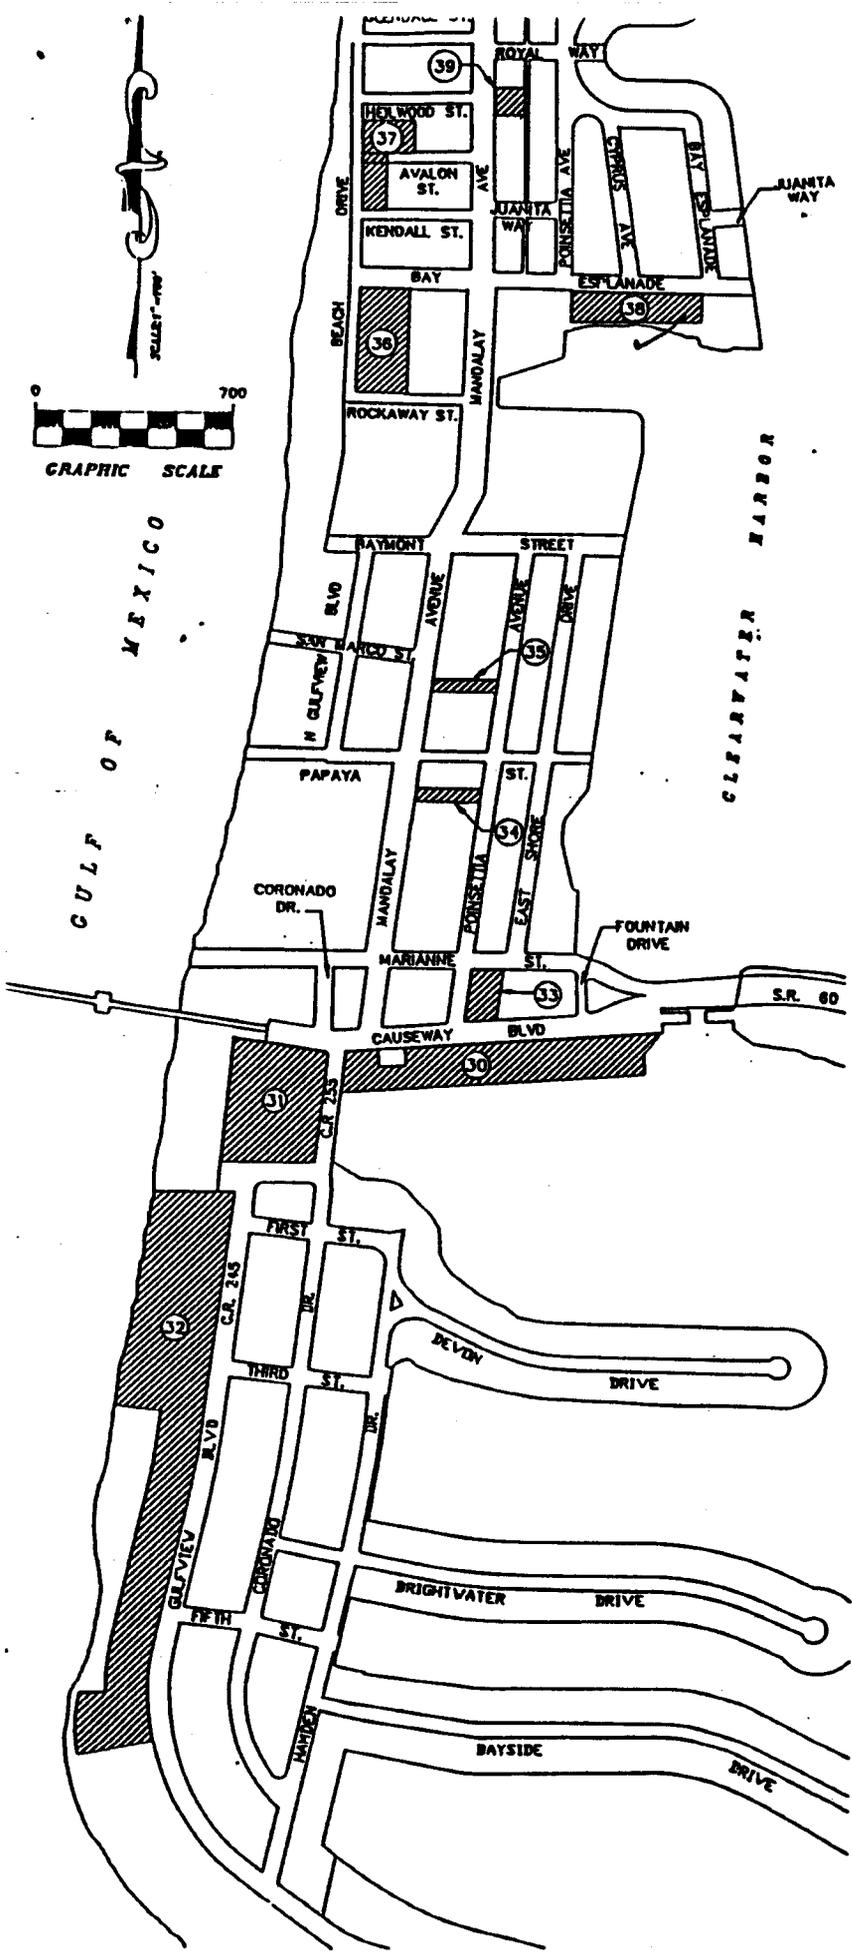

CITY PARKING LOTS

NO. SPACES


30. MARINA	280
31. PIER 60	250
32. GULFVIEW BLVD.	540
33. BEACH CIVIC CENTER	63
34. MANDALAY AVENUE SOUTH OF PAPAYA STREET	28
35. MANDALAY AVENUE NORTH OF PAPAYA STREET	30
36. ROCKAWAY STREET	152
37. AVALON / KENDALL	56
38. BAY ESPLANADE	82
39. McKAY FIELD	18
40. SAND KEY	662

ADDRESSES

- LOT 30 - 45 Memorial Causeway
- LOT 31 -100 S. Gulfview Blvd.
- LOT 32 -332 S. Gulfview Blvd.
- LOT 33 - 50-60 Memorial Causeway
- LOT 34 -423 Mandalay Blvd.
- LOT 35 -457 Mandalay Blvd.
- LOT 36 - 4 Rockaway St.
- LOT 37 -605 Kendall St.
- LOT 38 - 51 Bay Esplanade
- LOT 39 -
- LOT 40 -

CITY PARKING LOTS

10/2/91
MAHONY

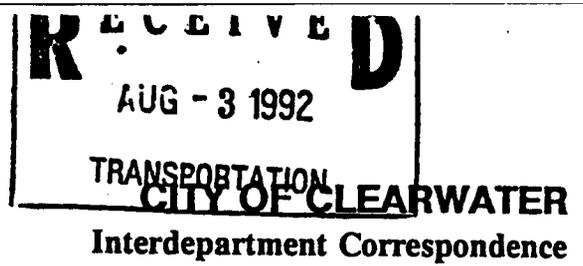

TO: Peter J. Yauch, Asst. Dir./PW, Traffic Engineer
FROM:  Steven S. Kelly, Superintendent, Bldg. & Maint.
COPIES: ADA File
SUBJECT: Americans with Disabilities/Parking Lots
DATE: August 3, 1992

Attached are the survey reports recently completed on all City Parking Lots. These point out areas that do not comply with the Americans with Disabilities Act. Please review and prepare cost estimates for bringing these into compliance.

Since we are working with a limited time frame, I am requesting this be completed as soon as possible, hopefully by Wednesday or Thursday of this week.

Thank you for your assistance on this project.

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #1
Osceola Ave., S. of Library

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(175 Spaces) Six accessible spaces exist, but signage is too low.	(4.6.4) Signage shall be located so they cannot be obscured by a vehicle parked in the space.

Lot # 1 & Lot # 5 ARE TOGETHER

Lot # 1 (175) Spaces

Lot # 5 (240) Spaces

415 Spaces

Reg. H/C (95) Spaces

Disabled (12) Spaces

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #4
Waterson Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(10 Spaces) One accessible space exists, but signage is too low.	(4.6.4) Signage shall be located so that they cannot be obscured by a vehicle parked in the space.

No Problem

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #5
Coachman Road PARK

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(240 Spaces) Five ^{Six} accessible spaces exist, but signage is too low. With two hundred forty spaces, seven accessible spaces should exist.	(4.6.4) Signage shall be located so that they cannot be obscured by a vehicle parked in the space. (4.1.2) Seven accessible spaces should exist.

See Parking Lot # 1

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #7
Drew St. & N. Ft. Harrison

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

No renovation needed.

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #10
City Hall - S. Osceola

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(59 Spaces) Two accessible spaces exist, but signage is too low. With fifty-nine spaces, three accessible spaces should exist.	(4.6.4) Signage shall be located so they cannot be obscured by a vehicle parked in the space. (4.1.2) Three accessible spaces should exist.

No action until a decision on City Hall location is made.

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #11
Pierce Blvd., S. of Cleveland

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Parking

(23 Spaces) One accessible space exists, but signage is too low.

(4.6.4) Signage shall be located so they cannot be obscured by a vehicle parked in the space.

No Problem

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #13
Large Courthouse Lot

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

No renovation needed.

*Phillips County Parking Lot
we maintain parking meters only*

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #14
Drew Street Extension

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

No renovation needed.

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #15
Old Auditorium

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(62 Spaces) One accessible space exists, but signage is too low. With sixty-two spaces, three accessible spaces should exist.	(4.6.4) Signage shall be located so that they cannot be obscured by a vehicle parked in the space. (4.1.2) Three accessible spaces should exist.

*It is noted that a person in
city hall location is made.*

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #16
Court St. & Garden Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(7 Spaces) An accessible parking space designated by a sign showing the symbol of accessibility does not exist.	(4.6.2) One accessible space should exist. See also (4.1.2).

See 4.1.2 (5)(a)

lots 16, 17 & 20 are all together

LOT 16 (7) Spaces

LOT 17 (22) Spaces

LOT 20 (6) Spaces

35 Spaces

Req: (2) 1/2 Spaces

Can be placed on S. Garden St.

as per 4.1.2 (5)(a)

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #17
Court St. & Ft. Harrison

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(22 Spaces) An accessible parking space designated by a sign showing the symbol of accessibility does not exist.	(4.6.2) One accessible space should exist. See also (4.1.2).

See Lot # 16

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #18
Kravas

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(49 Spaces) Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist.	(4.6.2) Two accessible spaces should exist. See also (4.1.2).

was a private lot leased to the city.

City has purchased property.

No action until a decision for property use is determined.

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #19
Court St. & Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(42 Spaces) One accessible space exists, but signage is too low. With forty-two spaces, two accessible spaces should exist.	(4.6.4) Signage shall be located so they cannot be obscured by a vehicle parked in the space. (4.1.2) Two accessible spaces should exist.

Amelia Co. Parking Lot

We maintain Parking Meter Company

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #20
Court St. & Ft. Harrison

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(6 Spaces) An accessible parking space designated by a sign showing the symbol of accessibility does not exist.	(4.6.2) One accessible space should exist. See also (4.1.2).

See lot # 16

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #21
Court St., West of Osceola

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(10 Spaces) Accessible parking space designated by a sign showing the symbol of accessibility, does not exist.	(4.6.2) One accessible space should exist. See also (4.1.2).

Pinellas County Parking lot

We maintain Parking Meters

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #22
Oak St./Osceola & Chestnut

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(100 Spaces) One accessible space exists, but signage is too low. With one hundred spaces, four accessible spaces should exist.	(4.6.4) Signage shall be located so they cannot be obscured by a vehicle parked in the space. (4.1.2) Four accessible spaces should exist.

*Puella County Parking Lot
we maintain parking meters only.*

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #24
Chestnut Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(37 Spaces/Permit Parking Only) One space exists, without a sign showing the symbol of accessibility.	(4.6.2) Two spaces should exist. See also (4.1.2) (4.6.4).

(2) Regular Spaces would have to be removed to provide (1) additional #/c

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #25
Court Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(16 Spaces) Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist.	(4.6.2) One accessible space should exist. See also (4.1.2).

(2) Regular Spaces would have to be removed to allow for (1) additional $\frac{1}{2}$

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #28
Park Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Parking

(25 Spaces) Two accessible spaces exist, but signage is too low.

(4.6.4) Signage shall be located so they cannot be obscured by a vehicle parked in the space.

No Problem

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #29
Ft. Harrison Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(32 Spaces) Three accessible spaces exist, but one has signage too low and one has no signage at all.	(4.6.4) Signage shall be located so they cannot be obscured by a vehicle parked in the space. Accessible parking spaces shall be designated as reserved by a sign showing the symbol of accessibility.

*Pineellas County Parking Lot
we maintain Parking Meters only*

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #30
45 Memorial Causeway

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(280 Spaces) Four accessible spaces exist, but one has signage too low (by the Post Office). With two hundred eighty spaces, seven accessible spaces should exist.	(4.6.4), also (4.1.2).

See 4.1.2 (5)(a)

Lots 20, 21, 23 are together

Lot #0 (280) Spaces

Lot #3 (63) Spaces

343 Spaces

8 #/c req.

6 provided

(2) required Spaces would be required to provide (2) additional #/c Spaces

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #31
100 S. Gulfview Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Parking	(250 Spaces) Five accessible spaces exist, but one has signage too low. With two hundred fifty spaces, seven accessible spaces should exist.	(4.6.4). Also (4.1.2).
---------	--	------------------------

See 4.1.2 (5)(a)

There are (2) additional 1/2 spaces on Coronado next to lot #31 which can be counted as provided by 4.1.2(5)(a).

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #32
332 S. Gulfview Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Parking

(540 Spaces) Six accessible spaces exist, but five have signage too low. All accessible spaces are poorly marked. With five hundred forty spaces, ten accessible spaces should exist.

(4.6.4). Also (4.1.2).

*on the grounds - by changing to
 outdoor parking*

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot 33
50 - 60 Memorial Causeway

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Parking	(63 Spaces) Two accessible spaces exist, but both have signage too low. With sixty-three spaces, three accessible spaces should exist.	(4.6.4). Also (4.1.2).
---------	--	------------------------

See Lot # 30

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #34
423 Mandalay Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(28 Spaces) One accessible space exists, but signage is too low. With twenty-eight spaces, two accessible spaces should exist.	(4.6.4). Also (4.1.2).

As provided in 4.1.2 (5)(a)

We can provide an additional H/C space on Mandalay next to Lot # 34.

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #35
457 Mandalay Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Parking	(30 Spaces) One accessible space exists. With thirty spaces, two accessible spaces should exist.	(4.1.2).
---------	--	----------

as provided in 4.1.2 (5)(a)

We can provide an additional t/c space on Mandalay next to lot # 35

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #36
4 Rockaway Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	<p>A. (152 Spaces) Three accessible spaces exist, but all have signage too low. With one hundred fifty-two spaces, six accessible spaces should exist.</p> <p>B. There is no accessible space adjacent to accessible rest rooms located on the east side of the lot. Island with parking meters does not have a cut, level with the street, allowing access from rest room to beach elements.</p>	<p>A. (4.6.4). Also (4.1.2).</p> <p>B. (4.6.2). Also (4.7.11) Any raised island in crossings shall be cut through level with street or have curb ramps at both sides, and a level area at least 48" long between the curb ramps in the part of the island intersected by the crossings.</p>

we can provide 2 +/- space next to Rest rooms. Rest rooms are +/- accessible, (1) additional +/- space can be provided on the street next to lot #36

If we provide +/- space next to Restrooms I don't think 4.7.11 applies

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #37
Avalon/Kendall

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Parking

(56 Spaces) Two accessible spaces exist, but signage is too low. With 56 spaces, three accessible spaces should exist.

(4.6.4) Signage shall be located so they cannot be obscured by a vehicle parked in the space.
(4.1.2) Three accessible spaces should exist.

(2) Regular Spaces can be converted to one 1/2 Space.

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #38
Bay Esplanade

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(82 Spaces) Two accessible spaces exist, but signage is too low. With eighty-two spaces, four accessible spaces should exist.	(4.6.4) Signage shall be located so they cannot be obscured by a vehicle parked in the space. (4.1.2) Four accessible spaces should exist.

Can add (2) h/c spaces
on the street,

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #39
McKay Field

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

No renovation needed.

BUILDING NUMBER: _____

BUILDING LOCATION: City Parking Lot #40
Sand Key

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Parking

(662 Spaces) Twelve accessible spaces exist, but all have signage too low. With six hundred sixty-two spaces, thirteen accessible spaces should exist.

(4.6.4) Signage shall be located so that they cannot be obscured by a vehicle parked in the space. Also (4.1.2).

Pencello's Courts Parking Lot

We maintain parking meters only.

TRANSITION PLAN

City of Clearwater

AMERICANS WITH DISABILITIES ACT (ADA) TRANSITION PLAN

The Americans with Disabilities Act (ADA) was passed by the United States Congress in 1990 with for the purpose of making all services and facilities accessible to the disabled population of our country.

The City of Clearwater's Transition Plan identifies physical barriers in its facilities that limit accessibility of programs or activities to individuals with disabilities.

In its effort to comply with the ADA, General Telephone and Electronics has stated its company will retrofit all public pay telephones on City of Clearwater property with the proper equipment based on ADA requirements. (In this regard, the City of Clearwater will be responsible for all painting, patching, etc. associated with the change of equipment.) All changes of public telephone equipment will comply with ADA deadline and be complete no later than January 26, 1995. (See Attachment Memo-GTE Pay Phones and ADA Requirements)

The Public Works Department of the City of Clearwater has the responsibility of the Infrastructure-related features of the ADA regarding all sidewalks. The schedule for this part of the ADA is attached and as stated, is planned to be completed prior to the stipulated deadline for all parts of the City's ADA transition, but no later than January 26, 1995. (See Attachment - Program for Adherence to Infrastructure-related Features of the Americans with Disabilities Act.)

This Transition Plan will be available for public inspection for at least three (3) years. Any person or organization representing individuals with disabilities may submit comments on this Transition Plan.

Revisions as necessary will be made to this Transition Plan and all parties listed on the attached mailing list will receive a copy of any revisions in order that they may keep an up to date copy of this document.

**TRANSITION PLAN
CITY OF CLEARWATER
ADA ADMINISTRATIVE ACCOMMODATIONS**

The City of Clearwater intends to operate its services, programs and activities so that all citizens, including the disabled, have ready access to these services, programs, and activities. In addition to physical renovations, the City will make its services, programs and activities readily accessible and usable to disabled persons by either one or a combination of the following:

1. Redesign of equipment
2. Reassignment of programs, services, and activities to an accessible building
3. Home visits
4. Delivery of programs, services, and activities to an alternate accessible location

**CITY BUILDINGS AND FACILITIES SCHEDULED FOR RENOVATIONS
THAT WILL MAKE THEM PHYSICALLY ACCESSIBLE TO
ALL PERSONS INCLUDING THE DISABLED**

This section of the Transition Plan outlines City buildings and facilities that will need changes to provide physical accessibility. These changes are noted in the reports for each building or facility, however, any buildings or portions of buildings that are not accessible to the general public and the City does not intend to make any changes prior to January 26, 1995, are so noted and designated as "Non-Public Accessible" or "Employee Only" accessible areas/buildings. As necessary, public business and contact will be conducted in an accessible area.

The "Employee Only" buildings that are not accessible to the general public have been listed separately and not included in this Transition Plan to be physically renovated or changed. If employees or applicants are found to need access to any of these facilities or buildings, the changes and/or accommodations will be made or considered on a case-by-case basis.

If/when employees or applicants work in areas that are not accessible due to physical barriers, the City will make every reasonable effort to accommodate these individuals and/or make the necessary physical changes according to the ADA.

CITY OF CLEARWATER

SELF EVALUATION AND TRANSITION PLAN FOR PROVIDING
ACCESS TO THE HANDICAPPED

A self-evaluation involves analysis of all programs, activities and building access to determine if each, when viewed in its entirety, is accessible, and if not what the alternatives are.

For at least three (3) years following completion of the self-evaluation, the City of Clearwater must maintain this report on file and make it available for public inspection. The following must be available upon request:

- I. A listing of participants of the self-evaluation program
- II. A description of areas examined and problems identified
- III. A description of modifications and remedial steps taken

Department self-evaluations were completed by Departments and Divisions and the reviewed by the ADA Committee. Major areas investigated were as follows:

1. Nature of Program

A description of the purpose, scope, general activities and participants in the program.

2. Participation in the program

A listing of written materials, tools and equipment used for the program; auxiliary aids provided to ensure accessibility of materials and equipment; individual activities that comprise the program; elements of the program that have the potential to be inaccessible to handicapped persons; steps taken to obtain accessibility; steps to ensure that communications with regard to program schedules and activities will be effectively communicated to all program participants including those with impaired vision and hearing; steps taken to ensure that boards and councils ensure equal opportunities for selection to and participation in such boards by handicapped persons.

3. "Outside" Persons and Organizations involved in Programs and Activities

A listing of all "outside" persons and organizations that assist the City or receive assistance from the City in the provision of any aid, benefit or service related to the program.

4. A listing of all Facilities used for programs and Activities

A list of facilities or portions of used for activities and programs.

+++++
CITY OF CLEARWATER
 +++++

Building Number Assignments:

No.	Building Name:	Address:
+++++		
1000	Armory Bldg.	706 N. Missouri Ave.
1010	Bayfront Tennis Complex	303 Cleveland Street
1030	Beach Showers/Drinking fountains	Clearwater Beach
1040	Beach Bathroom Bldgs.	Clearwater Beach
1042	Beach Attendent/North	Clearwater Beach
1043	Beach Attendent/South	Clearwater Beach
1045	Beach Access Locations	Clearwater Beach
1050	Belmont Park	1535 S. Greenwood Ave.
1060	Bomber's Stadium	651 Old Coachman Road
1070	Bridge Repairs	City Wide
1080	Carpenter Ball Field	951 Old Coachman Road
1090	Cemetery Bldg.	300 So. Myrtle Ave.
1100	Chesapeake Park	3070 Chesapeake Ave.
1200	City Hall	112 Osceola Ave.
1215	City Hall/Commission Chambers	3rd Fl., Center
1220	City Hall/Finance	3rd Fl., North End
1225	City Hall/Affirmative Action	1st Fl., North End
1230	City Hall/Administration	3rd Fl., South End
1235	City Hall/Personnel Department	1st Fl., N. & S. End
1240	City Hall Storage Bldg.	112 S. Osceola Ave.
1245	City Hall/Budget Offices	3rd Fl., North End
1250	City Hall/City Clerks Office	2nd Fl., South End
1255	City Hall/Internal Audit	3rd Fl., North End
1260	City Hall/Legal Department	2nd Fl., North End
1265	City Hall/Public Information Office	3rd Fl., Center
1300	City Hall/Annex	10 So. Missouri Ave.
1305	City Hall Annex/Planning Dept.	1st Floor
1310	City Hall Annex/Environmental	1st Fl., South End
1315	City Hall Annex/Payroll Department	1st Floor
1320	City Hall Annex/Engineering Dept.	1st Floor
1325	City Hall Annex/C.I.S. Division	1st Fl., South End
1330	City Hall Annex/Risk Management	1st Floor
1335	City Hall Annex/Bldg. & Maint. Div.	2nd Floor
1340	City Hall Annex/Community Development	1st Floor
1345	City Hall Annex/Parks Department	1st Floor
1350	City Hall Annex/Engineering Field Office	1st Fl., North End
1355	City Hall Annex/Traffic Engineering	1st Floor
1400	Civic Center	40 Causeway Blvd.
1410	Clearwater Airpark Complex	1000 N. Hercules Ave.
1420	Cliff Stephens Park	801 Fairwood Ave.
1430	Clw. Beach Rec. Center	69 Bay Esplanade
1440	Coachman Park/Bandshell	100 N. Osceola Ave.
1450	Coachman Ridge Park	1400 Old Coachman Road
1460	Community Relations, 1st Floor	400 N. Myrtle Ave.
1470	Country Hollow Park	2724 Brattle Lane
1480	Countryside Community Park	2640 Sabal Springs
1490	Countryside Sports Plex	3060 N McMullen Booth
1500	Crest Lake Park	201 Glenwood Ave.
1510	Cultural Arts Bldg.	1776 Drew Street
1520	David Martin Soccer Field	1345 Court Street
1525	Cypress Point Park	Allard Street

1530	Del Oro Park/Tennis Cts.	401 N. McMullen Booth Rd.
1540	Del Oro Park	401 N. McMullen Booth Rd.
1550	Del Oro Park/Handball Ct.	401 N. McMullen Booth Rd.
1560	East WPC/Control Bldg.	3141 Gulf-to-Bay
1565	East WPC Filter Complex	3141 Gulf-to-Bay
1570	East WPC Sludge Bldg	3141 Gulf-to-Bay
1575	East WPC Generator Bldg.	3141 Gulf-to-Bay
1580	East WPC Chlorine Bldg.	3141 Gulf-to-Bay
1600	Ed Wright Park	1300 So. Greenwood
1610	Eddie Moore Complex	200 N. McMullen Booth
1620	Ervin's Youth Center	1250 Holt Ave.
1700	Fire Station #45/Main (1)	610 Franklin Street
1705	Fire Station #45/Maintenance Bldg.	610 Franklin Street
1710	Fire Station #46 (2)	534 Mandalay Ave.
1715	Fire Station #47 (3)	1460 Lakeview Ave.
1720	Fire Station #48/Training Bldg.	1700 Belcher Road
1725	Fire Station #48/Fire Tower (4)	1700 Belcher Road
1730	Fire Station #48	1700 Belcher Road
1735	Fire Station #49 (5)	520 Sky Harbor Drive
1740	Fire Station #50 (6)	2681 Countryside Blvd.
1800	Flagpoles/repair-paint	City Wide
1810	Fleet Maintenance/Admin	1900 Grand Ave.
1815	Fleet Paint & Body Shop	507 Vine Street
1820	Fleet Radio Transmitter Tower/So.	Lakeview & Missouri
1825	Fleet Radio Repair Shop Tower.	1900 Grand Ave.
1830	Fleet Radio Transmitter Tower/No.	SR 580 & McMullen
1835	Fleet Fuel Site/Fire 6	2681 Countryside Blvd.
1840	Fleet Fuel Site/Annex	10 S. Missouri Ave.
1900	Forest Run Park	3450 Landmark Road
1910	Forestry Field Office (old)	2144 Calumet Street.
1920	Frank Tack Park	1667 N. Hercules Ave.
1930	Fred Cournoyer Bldg.	714 N. Saturn Ave.
1950	Garden Ave. Parking Garage	28 Garden Ave.
2000	Gas Division, 2nd Floor	400 N. Myrtle Ave.
2010	Gas Division/Welding Shop	400 N. Myrtle Ave.
2020	Gas Division/West Bldg.	400 N. Myrtle Ave.
2025	General Services/Admin	1900 Grand Ave.
2030	Glen Oaks Golf Course	1345 Court Street
2035	Guardrail/repair-replace	City Wide
2040	Holt Street Pool	1259 Holt Ave.
2041	Island Estates Playground	Larboard Way
2045	Jack Russell Stadium	801 Phillies Drive
2050	Joe Damagio Field	2465 Drew Street
2055	Kings Highway Rec. Center	1751 Kings Highway
2060	Lawn Bowling Club	1040 Calumet Street
2065	Library/Beach	40 Causeway Blvd.
2070	Library/Main	100 N. Osceola Ave.
2075	Library/East	2250 Drew Street
2080	Library/Countryside	2742 SR-580
2085	Library/Greenwood	1250 Palmetto Street
2090	Lifeguard Bldg./Beach	25 Mandalay Avenue

3000	Lift Station	1371 Gulf Blvd.
3001	Lift Station	501 Parkway Drive
3002	Lift Station	2619 Windingwood Drive
3003	Lift Station	2590 McMullen Booth
3004	Lift Station	2639 McMullen Booth
3005	Lift Station	301-A Eldridge St.
3006	Lift Station	Bay Espla. & Kipling
3007	Lift Station	1575 Belcher
3008	Lift Station	1250 Bell Drive
3009	Lift Station	1818 N. Washington
3010	Lift Station	Imperial Cove
3011	Lift Station	N. End/ Island Way
3012	Lift Station	1719 Overbrook
3013	Lift Station	Rose Road & Arlie St.
3014	Lift Station	3400 Gulf-to-Bay
3015	Lift Station	Harbor Passage
3016	Lift Station	1474 U.S. 19
3017	Lift Station	Belleair Rd. & Keene
3018	Lift Station	1616 Palmetto St.
3019	Lift Station	2019 Charter Oaks
3020	Lift Station	2110 Landmark Drive
3021	Lift Station	3201 U.S. 19 No.
3022	Lift Station	2304 McMullen Booth
3023	Lift Station	212 Hamden Dr.
3024	Lift Station	2150 Beverly Lane
3025	Lift Station	2396 U.S. 19
3026	Lift Station	1190 Russell Street
3027	Lift Station	W. End/ Marshall St.
3028	Lift Station	Woodlawn & Hamlet
3029	Lift Station	995 Bruce Ave.
3030	Lift Station	1180 Russell Street
3031	Lift Station	420 Waters Ave.
3032	Lift Station	830 Lantana Ave.
3033	Lift Station	530 Mandalay Ave.
3034	Lift Station	Eddie Moore Complex
3035	Lift Station	3440 McMullen Booth
3036	Lift Station	1308 McMullen Booth
3037	Lift Station	205 So. Glenwood
3038	Lift Station	2501 Laurelwood
3039	Lift Station	Osceola & Nicholson
3040	Lift Station	1053 Sunset Point
3041	Lift Station	1317 King's Highway
3042	Lift Station	1119 N. Betty Lane
3043	Lift Station	2385 Hazelwood Lane
3044	Lift Station	Pier 60
3045	Lift Station	3242 McMullen Booth
3046	Lift Station	1881 Virginia St.
3047	Lift Station	901 N. Saturn
3048	Lift Station	1650 Arcturas Ave.
3049	Lift Station	Pierce & Prospect
3050	Lift Station	10 Island Way
3051	Lift Station	Marina/ Fuel Dock
3052	Lift Station	105 Pierce Blvd.
3053	Lift Station	2851 McMullen Booth
3054	Lift Station	Coachman Park
3055	Lift Station	1811 Airport Drive
3056	Lift Station	2535 Countryside Blvd.
3057	Lift Station	201 Jeffords
3058	Lift Station	3356 Lake Shore Lane
3059	Lift Station	West End/San Marco
3060	Lift Station	400 N. Myrtle
3061	Lift Station	Norton Pool Area
3062	Lift Station	1060 Calumet St.
3063	Lift Station	550 N. Saturn Ave.

3064	Lift Station	2201 Cypress Point
3065	Lift Station	Fort Harrison & Howard
3066	Lift Station	Island Way & Palm Is.
3067	Lift Station	Countryside/K-Mart
3068	Lift Station	2495 Countryside
3069	Lift Station	1302 N. Betty Lane
3070	Lift Station	1400 Block/Jeffords
3071	Lift Station	714 Saturn Ave.
3072	Lift Station	18501 U.S. 19
3073	Lift Station	1351 Sunset Point
3074	Lift Station	16 Island Way
3075	Lift Station	Del-Oro Park
3076	Lift Station	2225 McMullen Booth
3077	Lift Station	1649 Harbor Drive
3078	Lift Station	3348 S.R. 60
4000	Long Center	1501 N. Belcher
4010	Magnolia Street Dock	W. end of Magnolia St.
4020	Mandalay Pier	West end/Eldorado St.
4030	Mandalay Park	Mandalay Ave.
4040	Marina Bldg.	25 Causeway Blvd.
4050	Marina/Post Office	25 Causeway Blvd.
4070	Marina/Maintenance Bldg.	25 Causeway Blvd.
4080	Marina/Fueldock	25 Causeway Blvd.
4090	Marshall St. Park	1141 Beckett Street
4200	Marshall St. WPC Office Complex Bldg.	1605 Harbor Drive
4210	Marshall Digestor Control Bldg.	1605 Harbor Drive
4220	Marshall Mechanic/Breakroom Bldg.	1605 Harbor Drive
4230	Marshall Belt Press Bldg.	1605 Harbor Drive
4240	Marshall Chemical Storage Bldg.	1605 Harbor Drive
4250	Marshall Filter Complex Bldg.	1605 Harbor Drive
4260	Marshall Influent Bldg.	1605 Harbor Drive
4270	Marshall Heat Exchanger Bldg.	1605 Harbor Drive
4280	Marshall Reactor Bldg.	1605 Harbor Drive
4290	Marshall Pump Station Bldg.	1605 Harbor Drive
4295	Marshall M.C.C. #9 Bldg.	1605 Harbor Drive
4300	Martin L. King Bldg.	1201 Martin L. King Ave.
4305	Marymont Park	1900 Gilbert Street
4310	McKay Field	615 Mandalay Ave.
4315	McMullen Tennis Park	1000 Edenville Ave.
4320	Memorial Park, South	Pierce St. & Cleveland
4325	Mission Hills Pumphouse	Mission Hills Property
4330	Moccasin Lake Park	2750 Park Trail Lane
4335	Montclair Park	1821 Montclair Road
4340	Morningside/Handball Cts.	2400 Harn Blvd.
4345	Morningside Pool	2400 Harn Blvd.
4350	Morningside/Tennis Cts.	2400 Harn Blvd.
4355	Morningside Rec.	2400 Harn Blvd.
4500	N.E. WPC Control Bldg.	3290 SR 580
4505	N.E. WPC Flootation Thickner Bldg.	3290 SR 580
4510	N.E. WPC Sludge Bldg.	3290 SR 580
4515	N.E. WPC Influent Bldg.	3290 SR 580
4520	N.E. WPC Filter Bldg.	3290 SR 580
4525	N.E. WPC Digestor Bldg.	3290 SR 580
4530	N.E. WPC Generator Bldg (3)	3290 SR 580
4535	N.E. WPC Belt Press Bldg.	3290 SR 580
4540	N.E. WPC Irrigation Bldg.	3290 SR 580

4550	N.E. WPC Pump Room Bldg.	3290 SR 580
4555	N.E. WPC Secondary Pump Room Bldg.	3290 SR 580
4556	N.E. WPC 2nd Anoxic Control Bldg.	3290 SR 580
4557	N.E. WPC Mobil Trailer	3290 SR 580
4600	Nursery Bldg.	901 N. Saturn Ave.
4605	Nursery/Chemical Storage	901 N. Saturn Ave.
4610	Old Williams School Lot	10 So. Missouri Ave.
4612	Parks/Electrical Division	406 Madison Avenue
4615	Park St. Parking Garage	613 Park Street
4620	Parks Field Office	507 Vine Street
4625	Phillip Jones Complex	1190 Russell Street
4630	Pier 60	100 Gulfview Blvd.
4635	Pinellas Arts Council	402 Pierce Blvd.
4640	Police Dept/Main	644 Pierce Street
4645	Police Dept/Pistol Range	2851 McMullen Booth
4650	Police Dept/Condon Gardens	2930 Sandlewood Dr.
4655	Police Dept/Countryside	2851 McMullen Booth
4660	Police Dept/East	105 East Ave.
4665	Police Dept/K-9 Training Ctr.	2851 McMullen Booth
4670	Police Dept/Beach	700 Bayway
4675	Police Dept/Greenwood	1310 N. Greenwood Ave.
4800	Public Service/Admin. Bldg.B	1650 N. Arcturas Ave.
4810	Public Service/Storage-Pump Shop E	1650 N. Arcturas Ave.
4820	Public Service/Supervisors Bldg.A	1650 N. Arcturas Ave.
4830	Public Service/Meter Shop/Water C	1650 N. Arcturas Ave.
4840	Public Service Machine Shop	1650 N. Arcturas Ave.
4850	Public Service/Motor Shop D	1650 N. Arcturas Ave.
4900	Purchasing Bldg.	711 Maple Street
4910	Purchasing/Storage	711 Maple Street
5000	Ray Green Complex	801 N. Greenwood Ave.
5005	Recreation Facilities Office	509 Pennsylvania
5010	Ross Norton Pool	1440 So. Greenwood
5015	Ross Norton Park	1440 So. Greenwood
5017	Ross Norton/Pal Bldg.	1440 S. Greenwood
5020	Safety Village	1150 Lakeview
5025	Sailing Center	1001 Gulf Blvd.
5030	Sand Key/Bathroom Bldg.	Gulf Blvd.
5035	Sand Key Bridge Tender	Clearwater Pass
5040	Sand Key Toll Booth	950 Gulf Blvd.
5045	Seminole Docks	End of Seminole Street
5050	Seminole Boat Ramp	W. end of Seminole St.
5055	Shuffleboard Club	1020 Calumet Street
5060	Sid Lickton Field	714 N. Saturn Ave.
5065	Sign Shop/Traffic Eng.	410 N. Myrtle
5070	Solid Waste/Recycle	1180 Russell Street
5075	Solid Waste Dept.	1180 Russell Street
5080	South Pavillion Garage	Clearwater Beach
5090	Station Square Park	620 Cleveland Street
6005	Tennis Complex/Beach	Mandalay & Eldorado

7000 Transfer Sta/Trailers
7010 Transfer Sta/Scalehouse
7020 Transfer Station

7200 Turner Street Dock
7210 U.S. 19 Soccer Field

7220 Utilities Bldg.
7230 Utilities Annex Bldg.

7240 Valencia Park

7250 Water Well #23
7260 Water Well #16
7270 Water Well #18
7280 Water Reservoir #1
7290 Water Reservoir #2
7295 Water Reservoir #3

7500 Wood Valley Park
7510 Woodgate Park

South Beach Pavillon
Pier Pavillon
Clw. Seafood Restuarant
Beach Diner Restuarant
Pinellas Arts Council Bldg.

1005 Coachman Road
1005 Coachman Road
1005 Coachman Road

W. end of Turner St.
U.S. 19 & Drew Street

900 Chestnut Street
401 S. Prospect Street

2100 N Hercules Ave.

Frank Tack Park
Crest Lake Park
Crest Lake Park
900 N. Saturn Ave.
201 US 19 South
2775 E. SR 580

2816 Park Trail Lane
2495 Countryside Blvd.

Leased Property

332 Gulfview Blvd.
10 Bay Esplanade
37 Causeway Blvd.
56 Causeway Blvd.
940 Court St.



GTE Telephone Operations
South Area
P. O. Box 110 MC 1909
Tampa, FL 33601-0110

August 4, 1992

Ms. Tuni Hensler
City of Clearwater
P. O. Box 4748
Clearwater, FL 34618

RECEIVED AUG 6 1992

Dear Tuni:

The Americans with Disabilities Act (ADA-HR101-388), developed by the National Council on Disability, was recently passed by Congress. The following is GTE's interpretation of the requirements as it pertains to pay telephones.

EXISTING FACILITIES

The ADA Requires the removal of physical barriers if it is, readily achievable. Readily achievable is defined as "easily accomplished and able to be carried out without much difficulty or expense". Compliance to the regulation, requiring provision of the accessible route, is the responsibility of the operator of the facility.

Examples of barrier removal include:

- Installing ramps
- Making curb cuts at sidewalks and entrances
- Rearranging tables, chairs, vending machines, display racks and furniture
- Widening doorways
- Repositioning telephones

NEW CONSTRUCTION AND ALTERATIONS

After January 26th, 1993, at least one accessible route within the boundary of the site shall be provided from public transportation stops, accessible parking, and accessible passenger loading zones, and public streets or sidewalks to the accessible building they serve. The route to the maximum extent feasible, will coincide with the route for the general public. Any alterations made to the site after January 26th, 1992, will be required to meet new construction guidelines. A new installation at an existing location does not constitute "new or modified" construction. Therefore, the new construction requirements would not apply to move, change or install activity. In addition, GTE is not required by law to provide TDD's to site owners.

Ms. Juni Hensler
August 4, 1992
Page Two

Presently, GTE Florida has approximately 15,000 pay telephones serving the Tampa Bay area. Our Service Department will be scheduling the pay telephones for ADA compliance to meet the required federal legislature mandated time frames. These time frames for GTE are as followed:

- Any pay telephone installed prior to January 1987 is considered "grandfathered" and must be in compliance by January 1995.
- Any pay telephone installed after January 1987 must be in compliance by January 1993.

I have shared with you all the information I have been given regarding ADA compliance for pay telephones. If you need additional information regarding ADA guidelines, you can call the Department of Justice at 202/514-0301. However, if I can be of further assistance please don't hesitate to call me in Tampa, 813/621-1622.

Sincerely,



Sunny Raml
Account Executive - Public Communications

SLR:br

AUG 10 1992

AAO

CITY OF CLEARWATER
Interdepartment Correspondence Sheet

TO: Steve Kelly, Superintendent, Building & Maintenance
General Services Department

FROM: Tuni Hensler, Administrative Support Manager *JK*
General Services Department

COPIES: ✓ Eleanor Breland, Affirmative Action Officer
Affirmative Action Office

SUBJECT: GTE Pay Phones and ADA Requirements

DATE: August 7, 1992

Attached is a copy of a letter I received from Sunny Raml, GTE Account Executive - Public Communications, advising us of what GTE proposes to do to meet ADA requirements for pay phones.

One issue that is not specifically mentioned in her letter is volume control for hearing impaired. She did state in a telephone conversation on August 4, 1992, that GTE is in the process of replacing handsets to provide for volume control. She also stated that if a phone needs to be lowered to meet ADA requirements, that GTE would be responsible for the move. Any minor repairs, such as filling screw/bolt holes in the wall, or painting the surface to match existing would be the responsibility of the operator of the facility.

If you think the attached letter will not suffice, I can request that GTE do an onsite visit for specific pay phones and provide details of the proposed actions to get in compliance.

**CITY OF CLEARWATER
PUBLIC WORKS DEPARTMENT**

Amendment to

**Program for Adherence to
Infrastructure-related Features
of the
Americans with Disabilities Act**

If granted the authority to manage certain capital improvement funds of the City of Clearwater which were identified in an August 6, 1992, memorandum to Michael J. Wright, City Manager, the following time schedule will be applied to the document entitled "City of Clearwater Public Works Department Program for Adherence to Infrastructure-related Features of the Americans with Disabilities Act".

1. Complete a reconnaissance survey which identifies sidewalk construction, and sidewalk removal and replacement at the public buildings by February 1, 1993.
2. Award a contract for the work identified in the reconnaissance survey described above by May 1, 1993 - contract to call for completion by October 31, 1993.
3. After dividing the city into nine separate districts, award three separate contracts to three separate contractors who will be working simultaneously to remove and replace all barrier curbs within the boundaries of their districts - these three contracts to be awarded by May 1, 1993, with completion dates of October 31, 1993.
4. Award another three contracts to three separate contractors who will work simultaneously in their assigned districts, starting by July 1, 1993, with a completion date of December 31, 1993.
5. Award the final three contracts to three separate contractors, who will work simultaneously in their districts, by March 1, 1994, with a time of completion August 1, 1994.
6. On July 1, 1994, award a final contract, which will accomplish any work not done by previous efforts, and any needs discovered during this program, with a time of completion of December 31, 1994.

CITY OF CLEARWATER
PUBLIC WORKS DEPARTMENT

Program for Adherence to
Infrastructure-related Features
of the
Americans with Disabilities Act

EXISTING

The City of Clearwater first began incorporating handicapped-related considerations into its infrastructure management in the early 1970's. Since that time, the City has, through its Engineering, Traffic, Street Construction and Maintenance, Sidewalk Construction and Maintenance, Land-Development regulation, and utility functions, practiced the following policies:

- a. All new sidewalks include wheelchair ramps (1:12 slope) at their intersections with barrier curbs.
- b. All sidewalk replacements include wheelchair ramps at their intersections with barrier curbs.
- c. All builders/developers are required to include wheelchair ramps at sidewalk and curb intersections where sidewalks are constructed.

PROPOSED

While the past activities have primarily dealt with new construction and replacements, it is now proposed that where existing sidewalks intersect with barrier curbs and the sidewalks are in excellent repair and not in need of replacement, that, in the areas of most need, wheelchair ramps be installed as a pro-active improvement notwithstanding the state of repair of the sidewalk. This will be accomplished upon the completion of a reconnaissance survey and the compilation of a list of needs at and around libraries, post offices, municipal buildings, county and federal buildings, and any other appropriate site where pro-active wheelchair ramps installations can benefit the disabled. We will then accomplish the listed improvements by the assignment of a portion of sidewalk funds budgeted for construction and maintenance. The percentage of the sidewalk funds necessary to accomplish the improvements and the time frame required to do so is not now known. It is proposed to assign enough of the sidewalk funds to accomplish the listed improvements in no more than three years.

It is further proposed that, in addition to the specific sites mentioned above, a systematic wheelchair ramp construction program be instigated wherein the most pedestrian-active major streets (under Clearwater's jurisdiction) such as Druid Road, Highland Avenue, Greenwood Avenue, Myrtle Avenue, and all streets downtown, are equipped with sidewalks meeting ADA standards. This program would also involve the devotion of a portion of the sidewalk funds. It is believed that a \$20,000 annual effort toward this program would result in a meaningful improvement each year - albeit that many years would be required to complete the ultimate goal of total coverage city-wide.

The facilities will be designed and constructed in accordance with ADA requirements.

MAILING LIST

City of Clearwater
ADA TRANSITION PLAN

Abilities Inc. of Florida
2735 Whitney Road
Clearwater, FL 34620

Family Resources, Inc.
P.O. Box 13087
St. Petersburg, FL 33733

Deaf Service Center, Inc.
P.O. Box 2730
St. Petersburg, FL 34664-2730

Easter Seal Rehabilitation
Center
7671 U.S. Hwy. 19 N.
Pinellas Park, FL 34664

Goodwill Industries, Suncoast
P.O. Box 14456
St. Petersburg, FL 34664

Mental Health Services of Upper
Pinellas
1437 S. Belcher Rd., Suite 200
Clearwater, FL 34624

Pinellas Center for the
Visually Impaired, Inc.
1220 Fourth Street N.
St. Petersburg, FL
and
1610 N. Myrtle Avenue
Clearwater, FL 34615

UPARC Foundation
1502 N. Belcher Road, #244
Clearwater, FL 34625

Suncoast Epilepsy Assoc., Inc.
8800 49th Street N., Suite 331
Pinellas Park, FL 34666

Pinellas Assoc. for Retarded
Children (PARC)
3100 75th Street N.
St. Petersburg, FL 33710

National Organization on
Disability
910 16th Street NW
Washington, DC 20006

Florida Gulf Coast Paralyzed
Veterans Assoc.
121 W. 122nd Avenue
Tampa, FL 33612

ADA Advisory Committee
City of Clearwater

Operation PAR
2100 - 4th Street South
St. Petersburg, FL

CITY OF CLEARWATER NO PUBLIC ACCESS FACILITIES

The following list of facilities are used by City of Clearwater Staff and are not accessed by the general public.

Beach Lifeguard Building	Sid Lickton Maintenance Building
Beach Parking Attendants Booth	Transportation Sign Shop
East Water Pollution Control Plant	Solid Waste Recycle Area
Fire Station #45	Solid Waste Division Complex
Fire Station #46	Transfer Station Complex
Fire Station #47	Utility Building Second Floor
Fire Station #48	Water Reservoirs (3)
Fire Station #49	S. Pavillion/Garage
Fire Station #50	Police Pistol Range
Fleet Maintenance Complex	Sand Key Toll Booth
Radio Transmitter Sites (2)	
Radio Repair Shop	
Fueling Sites (2)	
Gas Division Second Floor	
Gas Division Welding Shop	
Gas Division Second Floor, West Building	
General Services Administration	
Public Works Lift Stations and Water Wells	
Marina Maintenance Building	
Marshall Street Water Pollution Control Plant	
Northeast Water Pollution Control Plant	
Nursery Building	
Nursery Chemical Storage Building	
Parks Field Office	
Public Service Complex	
Purchasing Storage Building	
Recreation Facilities office	
Ross Norton Police Athletic league Storage Building	
Sand Key Bridge Tenders Building	

COMMITTEE

SELF-EVALUATION PARTICIPANTS

Tom Condon, Acting Consultant
Eleanor Breland, Affirmative Action Officer
Althea Anderson, Library
Vic Chodora, Building Official
Lt. Mike Egger, Police Department
Dee Jones, Infrastructure-Water
Miles Lance, Assistant City Attorney
Michael Laursen, Personnel Director
Tom Mudano, Recreation Supervisor II
Jone Papinchock, Human Resources
Joe Pidala, Assistant Fire Chief
Sally Ruby, Community Relations/EO Manager
Sharon Walton, Insurance Technician
Steven Kelly, Superintendent, Bldg. & Maint.

Individual or office to contact concerning the City of Clearwater's effort to comply with Handicapped Discrimination requirements:

Eleanor Breland, Affirmative Action Officer
400 N. Myrtle Avenue, 1st floor
Clearwater, FL 34616
Phone: (813) 462-6712
Office Hours: Monday - Friday, 9:00 A.M. - 5:00 P.M.

Facility Evaluation by: Mr. Tom Condon

Cost analysis by: Francis Wilson, Jim Pyatt and Pete Hegedus

Computer input by: Sylvia Hall and Jim Wood

PROGRAMS & ACTIVITIES

CITY OF CLEARWATER
Interdepartmental Correspondence Sheet

TO: Steve Kelly, Building & Maintenance Superintendent
FROM: Peter J. Yauch, Assist. PW Director & City Traffic Engineer *PJY*
COPIES: Eleanor Breland, Affirmative Action Officer
SUBJECT: Americans with Disabilities Standards/Parking Lots
DATE: August 7, 1992

Attached are the completed Parking Lot Survey reports you requested.

The new A.D.A. Parking Standards are fairly compatible with the existing state and city standards. Although, there are some differences which will have to be addressed eventually.

The attached A.D.A. Regulation 4.1.2(5)(b) states that if all required handicap spaces are 11' wide with a 5' aisle then no "van assessable" spaces or signs are required. The State requires 12' wide spaces and a 4' aisle. Both total 16'.

Regulation 4.1.2(5)(a) states the required handicap spaces need not be provided in any particular parking lot. Therefore, handicap spaces provided in adjacent lots, on the street or in a general parking area can be combined to satisfy the standard.

The cost of adjusting sign heights, adding a few handicap spaces or altering widths will be negligible, but, any actual changes should not occur until there is some continuity in the standards of the various governmental agencies.

PJY/DM/sn
Attachment





of public facilities must be in compliance with the ADA regulations or the Uniform Federal Accessibility Standards (UFAS). In addition, public facilities may depart from the particular requirements of either standard by the use of other methods when it is clearly evident that equivalent access to the facility or part of the facility is thereby provided.

NUMBER OF SPACES—As a general rule, the following number of accessible spaces must be provided for self-parking under the ATBCB rules are shown in Figure 1.

The required spaces (as shown in Figure 1) need not be provided in any particular lot. Rather, they may be placed in different locations if equivalent or greater accessibility in terms of distance from an accessible entrance, cost and convenience is ensured [ATBCB Regulation 4.1.2(5)(a)].

One in every eight of accessible spaces, but not less than one must be designated as "van accessible". However, "van accessible" designation is not required if all accessible spaces are 132 inches wide with a 60 inch access aisle [ATBCB Regulation 4.1.2(5)(b)].

Special rules apply for certain categories of facilities. Outpatient units and facilities providing medical care must have ten per cent of the total number of parking spaces at each unit or facility be disabled accessible. Units and facilities providing services for persons with mobility impairments must have 20 percent of the total number of parking spaces at each unit or facility be disabled accessible [ATBCB Regulation 4.1.2(5)(d)].

For valet parking, the facility's primary obligation is to provide a passenger loading zone with an access aisle at least 60 inches wide and 20 feet long adjacent and parallel to the vehicle pull-up space [ATBCB Regulation 4.1.2(5)(e)]. Vertical clearance must be 114 inches (9 1/2 feet) [ATBCB Regulation 4.6.5]. Vehicle standing spaces and access aisles must be level with surface slopes not exceeding 1:50 (2 percent) in all

directions. Curb ramps must be provided if there are curbs between the pull-up space and the access aisle [ATBCB Regulation 4.6.6].

LOCATION OF SPACES—Accessible parking spaces serving a particular location shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. If the parking lot does not serve a particular building, then accessible parking shall be located on the shortest possible route of travel to an accessible pedestrian entrance of the parking facility. In buildings with multiple accessible entrances with adjacent parking, accessible parking spaces shall be dispersed and located closest to the accessible entrances [ATBCB Regulation 4.6.2].

DESCRIPTION OF SPACES—Accessible parking spaces must be at least 96 inches wide. Parking spaces and access aisles must be level with surface slopes not exceeding 1:50 (2 percent) in all directions.

Except for van accessible spaces, access aisles adjacent to accessible spaces shall be a minimum of 60 inches (5 feet) wide as a minimum. Van accessible spaces must have an access aisle of at least 96 inches (8 feet). Access aisles must be part of an accessible route to the building or facility entrances and must comply with detail rules set forth in ATBCB Regulation 4.3.

VERTICAL CLEARANCE—There must be vertical clearance of 114 inches (9 1/2 feet) along at least one vehicle access route to accessible passenger loading zones from site entrances and exits. For van accessible parking, there must be a vertical clearance of 98 inches at the parking space and along at least one vehicle accessible route to such spaces from site entrances and exits.

SIGNAGE—Accessible parking spaces shall be designated as reserved by a sign showing the symbol of accessibility. Van accessible spaces shall have an additional sign mounted below

the symbol of accessibility. Such signs shall be located so they cannot be obscured by a vehicle parked in the space. Van accessible spaces need not be restricted only to vans.

TICKET BOOTHS—The ATBCB Regulations primarily apply to those areas accessible to the public. The Regulations state as follows regarding work areas:

Areas that are used only as work areas shall be designed and constructed so that individuals with disabilities can approach, enter and exit the areas. The guidelines do not require that any areas used only as work areas be constructed to permit maneuvering within the work areas or be constructed or equipped (i.e. with racks or shelves) to be accessible [ATBCB Regulation 4.1.1(3)].

The foregoing raises the question of the need to design ticket booths to be disabled accessible. In most instances, if not designed in advanced to be accessible, an island cannot easily be changed to accommodate an accessible booth. The Comments to the ATBCB recommends as follows:

Where there are a series of built-in or fixed individual work stations of the same type (e.g. laboratories, service counters, ticket booths), in order to facilitate reasonable accommodation at a future date, it is recommended that five percent or at least one of each type of work station be constructed so that an individual with disabilities can maneuver within the work station. Consideration should be given to placing shelves in an employee work area at a convenient height for accessibility or installing commercially available shelving that is adjustable so that reasonable accommodation can be made in the future [56 Fed. Reg. 35415 (July 26, 1991); Appendix A4.1.1(3)].

VALET PARKING—Valet parking is not always usable by individuals with disabilities. For example, an individual may use a type of vehicle controls that render the regular controls inoperable or the driver's seat in a van may be removed. In these situations,

BUILDINGS & FACILITIES

BUILDING NUMBER: 1000
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Armory Building
706 N. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space designated by a sign showing the symbol of accessibility does not exist.	NOTE: Military exclusion; 4.1.4, Para. B. (4.6.2), (4.6.3), (4.6.4).
Accessible Route	Steps at entrance do not have an accessible ramp.	(4.3.8). Also (4.7.1), (4.5.2).
Counters	A. Ticket Booth in Lobby has a counter 42" high.	A. (4.32.4).
	B. Counter at Kitchen is 36" above the floor.	B. (4.32.4).
Lavatories and Mirrors	A. Mirrors in both Men's (47-1/2) and Women's (48-1/2") Rest Rooms are too high.	A. (4.19.6).
	B. Sinks in both Men's and Women's Rest Rooms have exposed water pipes.	B. (4.24.6).
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are accessible with proper floor space.	A. (4.17.3). Also (4.22.4).
	B. Toilet stall doors in both Men's and Women's Rest Rooms do not provide a clear opening of 32".	B. (4.17.5). Also (4.13.5).
Water Closets	A. Grab bars do not exist in Men's or Women's Rest Rooms.	A. (4.17.6).
	B. Toilet height is too low in all toilets in Men's and Women's Rest Rooms.	B. (4.16.3).
Urinal	Urinal is not accessible due to height of rim.	(4.18.2).
Water Fountain	Proper knee clearance is not provided, thus clear floor space must be provided.	(4.15.5)(2).

BUILDING NUMBER: 1000
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Armory Building
706 N. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Assembly (Bleachers)	Wheelchair location does not exist.	(4.33.3). Also (A4.33), (A4.33.3).
Telephone	A. Public telephone is not hearing aid compatible, nor does it have volume control.	A. (4.31.5).
	B. Clear floor space is not provided due to a vending machine and Ping Pong table too close to telephone.	B. (4.31.2).
Doors	Threshold at kitchen doorway exceeds 1/2".	(4.13.8).
Sinks	A. Kitchen sink has rim 35-1/4" from floor.	A. (4.24.2).
	B. Proper knee clearance is not provided at kitchen sink.	B. (4.24.3).
	C. Utility sink in Kitchen has exposed water pipes.	C. (4.24.6).

BUILDING NUMBER: 1010
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Bayfront Tennis Complex
303 Cleveland Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist in Tennis parking lot.	NOTE: Designate McMullen Park as Handicapped accessible. (4.6.2). Also (4.6.3), (4.6.4), (4.30).
Accessible Route	Level change is greater than 1/2" at entrance to North courts.	(4.3.8).
Counters	Counters are 46" from ground surface.	(4.32.4). Also (5.2).
Doors	A. Threshold of door into office has 4" step.	A. (4.13.8). Also (4.3.8).
	B. Thresholds on Men's and Women's Rest Rooms are 1".	B. (4.13.8).
Drinking Fountains	Spout is 43" from ground surface.	(4.15.2).
Rest Room Entrances	Both Men's and Women's Rest Room entrances have 4" step.	(4.3.8). Also (4.7).
Shower Stalls	Stalls are 31" x 46". There is a 6" step into stalls. There are no seats in any stalls. There are no grab bars in any stalls. Controls are too high. A shower unit with hose is not provided.	(4.21.2), (4.21.3), (4.21.4), (4.21.5), 4.21.6), (4.21.7), (4.21.8).
Sinks	A. Sinks in both Men's and Women's Rest Rooms have exposed water pipes.	A. (4.24.6).
	B. Knee clearance under sink is not sufficient.	B. (4.24.3).

BUILDING NUMBER: 1010
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Bayfront Tennis Complex
303 Cleveland Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Dressing Rooms	Not accessible due to 29" passageway, lack of clear floor space allowing a person using a wheelchair to make a 180-degree turn, lack of proper bench in stalls, and doors on stalls not wide enough for wheelchairs (Men's).	(4.35.2), (4.35.3), (4.35.4).
Water Closet	A. Height of toilets in Men's and Women's Rest Room is 16" from floor. B. Toilet paper dispensers are too high in Men's Rest Room.	A. (4.16.3). B. (4.16.6).
Toilet Stalls	A. There is no stall in Men's or Women's Rest Room that is accessible. B. Grab bars do not exist in any stall.	A. (4.17.3). Also (4.22.4). B. (4.17.6).
Mirrors	Mirror in Women's Rest Room is 48-1/2" high and 50" high in Men's Rest Room.	(4.19.6).

BUILDING NUMBER: 1030
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Beach Showers/Fountains
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountains	A. Fountains at Units 1,2,3,4,5,6,7,8,9,&10, do not provide the proper clear floor space.	A. (4.15.5)(2) Fountain replacement in progress.
	B. Water flow is less than 4" high on fountains at Units 1 and 2.	B. (4.15.3). See A.
	C. Spout is located at rear on fountains at Units 8 and 9.	C. See A.
	D. Spout is 37" from ground on fountain at Unit 3.	D. See A.
Showers	A. Shower controls are too high on showers at Units 1,2,3,4,5,6,8,9,&10.	A. (4.2.5) Shower replacement in progress.
	B. Shower heads are too high on showers at Units 1,2,3,4,5,6,7,8,9,&10.	B. (4.2.5). Also (4.21.6, see Exception). See A.
	C. No clear floor space exists at shower at Units 1,2,3,4,5,6,8,9,&10.	C. (4.2.4.1) See A.
Accessible Route	A. Does not exist from sidewalk to shower/fountain unit, due to 4-1/2" step at Units 1,2,&10.	A. (4.3.8). Also (4.5.2). Provide access to designated handicapped units.
	B. Does not exist from sidewalk to shower/fountain unit, due to walkway being less than 36" wide at Unit 3.	B. (4.2.1). See A.
	C. Does not exist from sidewalk to shower/fountain unit, due to curb at Unit 4.	C. (4.3.8). Also (4.5.2). See A.

BUILDING NUMBER: 1030
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Beach Showers/Fountains
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

D. Does not exist from sidewalk to shower/fountain unit, due to the lack of a walkway at Units 5 & 7.

D. (4.3.2)(2). See A.

E. Does not exist from sidewalk to shower/fountain unit, due to 5" step at Units 5, 6, & 8.

E. (4.3.8). Also (4.5.2). See A.

BUILDING NUMBER: 1040
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Beach Bathroom Buildings
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	A. Two sinks at Bathroom Building (by Lifeguard Bldg.), two sinks at Bathroom Building (north of Pier 60), and two sinks at Bathroom Building (by Adam's Mark), do not provide proper knee clearance underneath sink.	A. (4.24.3) Modify as required.
	B. Proper floor space is not provided at Bathroom Building (by Adam's Mark) sinks.	B. (4.24.5). See A.
Water Closets	A. Grab bars do not exist behind toilets at accessible stalls of Bathroom Building (north of Pier 60), Bathroom Building (by Lifeguard Building), or Bathroom Building (by Adam's Mark).	A. (4.16.4). Install grab bars.
	B. Toilet seat at Bathroom Building (by Lifeguard Bldg.) is 20" high.	B. (4.16.3) Replace toilets.
	C. Grab bars do not exist at accessible stall of Bathroom Building (by Adam's Mark).	C. (4.16.4). Install grab bars.
Toilet Stalls	Toe clearance of at least 9" above the floor is not provided at Bathroom Building (by Lifeguard Bldg.) or at Bathroom Building (north of Pier Pavilion), at toilet stalls.	(4.17.4). 9" toe clearance would alter original intent and not provide privacy.
	Signage	Signage does not exist on accessible stall doors at Bathroom Building (north of Pier Pavilion).

BUILDING NUMBER: 1040
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Beach Bathroom Buildings
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Does not exist from walkway or parking to Bathroom Building (north of Pier Pavilion).	(4.3.2)(2). Also (4.3.2)(1). Not designated handicapped.
Toilet Stalls	Toilet stalls that are said to be accessible by signage and accessible features, are not the proper size to actually be totally accessible at Bathroom Building (by Lifeguard Bldg.), and at Bathroom Building (north of Pier Pavilion).	(4.17.3). See figure 28 and 30. Modify as required.

BUILDING NUMBER: 1042
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Beach Attendant/North
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

NOTE: No Public Access;
Employees only.

BUILDING NUMBER: 1043
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Beach Attendant/South
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

NOTE: No Public Access;
Employees only.

BUILDING NUMBER: 1045
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Beach Public Access Locations
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist near any Beach public access locations.	(4.6.2). Street parking only no designated lots.
Accessible Route	None of the following Beach public access locations provide an accessible route to the water's edge.	(4.3.2)(1)(2). N/A, E.P.A. standards prohibit construction.
Showers	Where showers are provided at some of the following Beach public access locations, they are not the proper unit with proper clear floor space.	(4.21.6). Showers are being replaced.
Drinking Fountains	Where drinking fountains are provided at some of the following Beach public access locations, they do not provide spouts at proper heights, proper clear floor space, or proper knee clearance.	(4.15.2). Also (4.15.3) & (4.15.5)(2). Fountains are being replaced.

BEACH PUBLIC ACCESS LOCATIONS ARE FOUND AT:

West End of Juniper Street
 West End of Aurel St. (at Eldorado)
 West End of Gardenia St. (at Eldorado)
 West End of Bohemia Circle (at Eldorado)
 West End of Mango St. (at Eldorado)
 By 730 Eldorado
 West End of Somerset St.
 West End of Cambria St.
 West End of Idlewild St.
 West End of Glendale St.
 West End of Heilwood St.
 West End of Avalon St.
 West End of Kendall St.
 West End of Ambler St.
 N. Gulfview & West End of Baymont St.
 N. Gulfview & San Marco St.
 N. Gulfview & Papaya St.

BUILDING NUMBER: 1050
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Belmont Park
1535 S. Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist.	(4 . 6 . 2) . A l s o (4.6.3)(4.6.4)(4.30). Modify as required.
Accessible Route	A. Does not exist from an accessible walkway to bleachers.	A. (4.3.2)(2). Install sidewalk.
	B. Walkway (23-1/2" wide) does not give accessible route to Rest Rooms.	B. (4.2.1). See: "Structural Impracticality", below.
Drinking Fountain	A. Fountain does not provide proper knee clearance.	A. (4.15.5). Install Handicapped fountain.
	B. Spout is 5" from the front edge of the fountain.	B. (4.15.3). See A.
	C. Water flow is less than 4" high.	C. (4.15.3). See A.
Toilet Stalls	A. There is no stall in Men's or Women's Rest Rooms that is accessible.	A. (4.17.3). Also (4.22.4). N/A. Structural Impracticality; UFAS, 4.1.6, (Exception 5F).
	B. Grab bars do not exist in any stalls.	B. (4.17.6).
Water Closet	A. Toilet height in Men's Rest Room is 16".	A. (4.16.3).
	B. Toilet paper dispensers are 33" from floor in both Men's and Women's Rest Rooms.	B. (4.16.6).

BUILDING NUMBER: 1050
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Belmont Park
1535 S. Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Doorways into both Rest Rooms do not allow proper wheelchair passage width. (Now women's is 27"; men's is 26-1/2".	A. (4.2.1). Also (4.13.6).
	B. Clearance for wheelchair passage into stall area is not adequate.	B. (4.2.1). Also (4.13.6).
Sinks	A. Sinks in both Men's and Women's Rest Rooms have exposed water pipes.	A. (4.24.6).
	B. Clear floor space is not adequate in front of sinks in both Men's and Women's Rest Rooms.	B. (4.24).

BUILDING NUMBER: 1060
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Bomber's Stadium
651 Old Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(66 spaces) Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist.	(4.6.2). Also (4.1.2). Modify as required.
Accessible Route	A. Does not exist from transportation (Bus Stop) to Main Entrance.	A. (4.3.2)(1). Install sidewalk.
	B. Does not exist from walkway to an accessible Picnic Table (by Bleachers), with proper floor space.	B. (4.3.2)(2). Install sidewalk and modify table.
	C. Does not exist from walkway to Dugouts.	C. (4.3.2)(2). Staff and players only.
	D. Does not exist from walkway to stairway leading to upstairs Press Box.	D. (4.3.2)(2). Staff only.
	E. Does not exist for persons in wheelchair to Second Floor Press Box.	E. (4.3.2)(2). Staff only.
	F. Does not exist from walkway to Supply Room and outside sink located at rear of Press Box Building.	F. (4.3.2)(2). Staff only.
Assembly Area (Bleachers)	Wheelchair locations do not exist by Beachers.	(4.33.3). Also (A4.33), (A4.33.3). Designate area.
Counters	Counters at Concession Stand are 38" high.	(4.32.4). Modify as required.
Stairs	There is a handrail on only one side of the stairway leading to Second Floor Press Box.	(4.9.4). Staff only.

BUILDING NUMBER: 1060
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Bomber's Stadium
651 Old Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountains	<p>A. On the "Hi-Lo" fountains by both Men's and Women's Rest Rooms, the "Lo" fountains do not provide proper knee clearance in height or depth.</p> <p>B. Fountains in both Dugouts have spouts 44" from the ground.</p> <p>C. Fountains in both Dugouts do not provide proper clear floor space.</p>	<p>A. (4.15.5)(1). Re-evaluation; meets ADA Standards.</p> <p>B. (4.15.2). Staff and players only.</p> <p>C. (4.15.5)(1). Staff and players only.</p>
Toilet Stalls	<p>A. There are no stalls in Men's or Women's Rest Rooms that are accessible with proper clear floor space.</p> <p>B. Doors to toilet stalls in both Men's and Women's Rest Rooms are not a minimum of 32" wide.</p>	<p>A. (4.17.3). Also (4.22.4). Modify as required.</p> <p>B. (4.17.5). See A.</p>
Water Closets	<p>Grab bars do not exist behind toilet in both Men's and Women's Rest Rooms.</p>	<p>(4.17.6). Install grab bars.</p>
Lavatories and Mirrors	<p>A. All sinks in Men's and Women's Rest Rooms have the rim surface higher than 34" from the floor.</p> <p>B. Sinks in Men's and Women's Rest Rooms have exposed water pipes underneath.</p> <p>C. Mirrors in both Men's and Women's Rest Rooms have bottom edge 48" from floor.</p>	<p>A. (4.19.2). Modify as required.</p> <p>B. (4.19.4). Also (4.24.6). See A.</p> <p>C. (4.19.6). Lower mirrors.</p>

BUILDING NUMBER: 1080
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Carpenter Ball Field
951 Old Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist.	(4.6.2). Also (4.1.2). Modify as required.
Accessible Route	A. Does not exist from transportation (Bus Stop) to Main Entrance.	A. (4.3.2)(1). Install sidewalk.
	B. Does not exist from walkway to Batting Cage in Red Building on East side of the Complex.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist from walkway to Field #5.	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist from walkway to Batting Cage on West side of Complex (off driveway).	D. (4.3.2)(2). Install sidewalk.
Telephone	A. Public telephone (by Field #2 and #3) does not provide volume control, nor is it Hearing Aid compatible.	A. (4.31.5). Also (A 4.31 See Cover Sheet.
	B. Highest operable part of telephone is 67".	B. (4.31.3). See A.
Assembly Area (Bleachers)	Wheelchair locations do not exist by Bleachers at any Field.	(4.33.3). Also (A 4.33), (A 4.33.3). Designate Handicapped area.
Counters	Counters at Concession Stand are 43" high.	(4.32.4). Facility has been removed.
Stairway	Stairs to Observation Deck have open risers.	(4.9.2). Staff only.
Doors	A. Threshold at doorway to Umpire's Room is greater than 1/2".	A. (4.13.8). Staff only.
	B. Doorway to Men's Public Rest Room has an opening less than 32", and has a slope at threshold greater than 1:2.	B. (4/13/8). Also (4.13.5). Modify as required.

BUILDING NUMBER: 1080
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Carpenter Ball Field
951 Old Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountains	<p>C. Doorway to Women's Public Rest Room has an opening less than 32", and has a slope at threshold greater than 1:2.</p>	<p>C. (4.13.8). Also (4.13.5). Modify as required.</p>
	<p>A. Free standing fountain by Fields has a spout 43".</p>	<p>A. (4.15.2). Install Handicapped fountain.</p>
	<p>B. Water flow on fountain is toward the rear.</p>	<p>B. (4.15.3). See A.</p>
	<p>C. Proper clear floor space is not provided at fountain.</p>	<p>C. (4.15.5)(2). See A.</p>
	<p>D. Fountains (2) in Locker Rooms have spouts 42" high.</p>	<p>D. (4.15.2). Staff only.</p>
	<p>E. Fountains (2) in Locker Rooms do not provide proper knee clearance.</p>	<p>E. (4.15.5)(1). Staff only.</p>
Toilet Stalls	<p>A. There are no stalls in Men's or Women's Public Rest Rooms that are accessible with proper clear floor space.</p>	<p>A. (4.17.3). Also (4.22.4). Modify as required.</p>
	<p>B. There are no stalls in Umpire's Room or Team Locker Rooms that are accessible with proper clear floor space.</p>	<p>B. (4.17.3). Also (4.22.4). Staff only.</p>
	<p>C. Stall doors in Men's and Women's Public Rest Rooms, Team Locker Rooms, and Umpire's Room, do not provide 32" opening.</p>	<p>C. (4.17.5). Modify public area as required.</p>
	<p>D. Grab bars do not exist at toilet stalls in Men's or Women's Public Rest Rooms, Team Locker Rooms, or in Umpire's Room.</p>	<p>D. (4.17.6). Install grab bars in public area.</p>

BUILDING NUMBER: 1080
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Carpenter Ball Field
951 Old Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	Toilets are not between 17" and 19" in height at Men's and Women's Public Rest Room, or at Umpire's Room.	(4.16.3). Modify public area as required.
Urinals	Urinals in Locker Rooms are 24-1/2" high.	(4.18.2). Staff only.
Lavatories and Mirrors	A. Mirrors in Men's and Women's Public Rest Room, Team Locker Rooms, and Umpire's Room, are too high from floor.	A. (4.19.6). Lower mirrors in public area only.
	B. Sinks in Men's and Women's Public Rest Rooms, Locker Rooms, and in Umpire's Room, have exposed water pipes underneath.	B. (4.19.4). Modify public area as required.
Counters	Counters at Concession area in Locker Room, in Equipment Room, and in sink area of Locker Room, are not between 28" and 34" above finish floor.	(4.32.4). Concession building been removed.
Shower Stalls	A. Seat is not provided in Umpire's stall or in Locker Room shower area.	A. (4.21.3). Staff only.
	B. Shower spray unit with hose 60" long, used both as a fixed head and a hand-held shower, is not provided in Umpire's stall or in Locker Room shower area.	B. (4.21.6). Staff only.
	C. Shower stall door in Umpire's Room does not provide 32" opening.	C. (4.13.5). Staff only.
	D. Curb at Shower Room in Locker Room is greater than 1/2". (Shower areas larger than 30" by 60" shall not have curbs).	D. (4.21.7). Staff only.

BUILDING NUMBER: 1090
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Cemetery Building
300 S. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space designated by a sign showing the symbol of accessibility, does not exist.	(4 . 6 . 2) . (4.6.3), (4.6.4), (4.30). Also Modify as required.
Doors	A. Threshold on door at entrance exceeds 1/2".	A. (4.13.8). Modify as required.
	B. Doorway at entrance is 30" wide.	B. (4.13.5). Replace door.

BUILDING NUMBER: 1100
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Chesapeake Park
3070 Chesapeake Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist.	(4.6.2). Modify as required.
Accessible Route	A. Does not exist from parking to accessible walkway connecting elements; (i.e., Rest Rooms).	A. (4.3.2). Install sidewalk.
	B. Does not exist from street (Condon Gardens), to an accessible walkway.	B. (4.3.2). Install sidewalk.
	C. Does not exist from walkway to Bleachers.	C. (4.3.2)(2). Install sidewalk.
Assembly Area (Bleachers)	Wheelchair locations do not exist by Bleachers.	(4.33.3). Designate area.
Drinking Fountain	A. Fountain does not connect to an accessible walkway.	A. (4.3.2)(2). Install Handicap fountain.
	B. Fountain has spout located at rear.	B. (4.15.3). See A.
	C. Spout height is 39" from ground to spout outlet.	C. (4.15.2). See A.
	D. Fountain does not provide clear floor space to allow a person in a wheelchair to make a parallel approach to unit.	D. (4.15.5)(2). See A.
	E. Fountain has water flow less than 4" high.	E. (4.15.3). See A.
	F. Fountain has water flow more than 3" from the front edge of fountain.	F. (4.15.3). See A.
Doors	A. Thresholds at main doors at Men's and Women's Rest Rooms are 2".	A. (4.13.8) Install ramp.
	B. Thresholds at doorway to Utility Room is 3-1/2".	B. (4.13.8). Employees only.

BUILDING NUMBER: 1100
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Chesapeake Park
3070 Chesapeake Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	Sinks in both Men's and Women's Rest Rooms have exposed water pipes.	(4.24.6). Modify as required.
Toilet Stalls	A. There is no stall in Men's or Women's Rest Rooms that is accessible. (Doors to stall, 29"; stalls 36-1/2" x 108" and 36" x 59"). B. Grab bars do not exist behind toilet in Men's or Women's Rest Rooms.	A. (4.17.3). Also (4.22.4). Re-evaluation: Meets A.D.A. standards. B. (4.17.6). Install grab bars.
Water Closet	A. Height of toilet in Men's Room is 20-1/2", and the same in the Women's Rest Room. B. Toilet paper dispensers are 40" high in Men's Rest Room and 22" high in Women's Rest Room.	A. (4.16.3) Replace toilets. B. (4.16.6). Lower dispenser.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	<p>A. Due to lack of proper curb ramps, an accessible route does not exist to rear Handicapped Entrance from public transportation stops, and all public streets and sidewalks.</p>	<p>A. (4.3.2)(1). Also (4.7.1) Install as required.</p>
	<p>B. Does not exist to fountain (parking lot) due to the lack of proper curb ramps.</p>	<p>B. (4.3.2)(2). Also (4.7.1) Install as required.</p>
Ramps (Rear Handicapped Ramp)	<p>A. Slope of ramp exceeds 1:12. Maximum rise for run exceeds 30".</p>	<p>A. (4.8.2). Buzzer has been provided for assistance.</p>
	<p>B. Handrails on ramp are lower than 34".</p>	<p>B. (4.8.5)(5).</p>
	<p>C. Surface of ramp is slippery when wet; slip-resistant strips should be provided.</p>	<p>C. (4.5.1) Paint with slip-resistant substance.</p>
Dining Areas	<p>Outdoor Picnic Tables (rear of Building) have no accessible seating for people in wheelchairs, due to lack of proper knee clearance.</p>	<p>(5.4). Also (4.32.3). Provide table with Handicap access.</p>
Reflecting Pools	<p>Reflecting Pool by rear door is not properly protected by railing or wall.</p>	<p>(4.29.6). Install railing.</p>
Stairs	<p>Stairway at front Main Entrance does not have handrails at both sides of stairs.</p>	<p>(4.9.4). Install handrails.</p>
Alarms	<p>Visual Alarm System does not exist throughout Building.</p>	<p>(4.28.1). Also (4.28.2)(4.28.3). Provide for as required.</p>

BUILDING NUMBER: 1st FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	Counter at Human Resources is too high.	(7.2)(2). Remodel section of counter.
Drinking Fountains	Fountains throughout Building do not provide proper knee clearance, have spouts too high, and direct water flow toward rear (6 fountains).	(4.15.5). Also (4.15.2)(4.15.3). Install Handicapped water.
Space Allowance and Reach Ranges	<p>A. Wheelchair turning space is not provided in room where Applications are completed.</p> <p>B. Bulletin Board in Human Resources, listing Job Vacancies, is too high.</p>	<p>A. (4.2.3). Remove one section of desk area.</p> <p>B. (4.2.5). Also (4.2.6). Make accommodations by using brochure type holders.</p>
Sinks	Knee clearance is not provided under sink in Testing Room of Human Resources.	(4.24.3). Employee access only.
Telephones	Public Telephone (1st floor stairwell) does not have volume control, nor is it Hearing Aid compatible.	(4.31.5). Also (A 4.31.9). See Cover Sheet.
Ramp (N. Outside)	Slope of ramp exceeds 1:12. Maximum rise for run exceeds 30".	(4.8.2). Other accommodation in rear of building.
Stairs	Outside stairs on South side have no handrails.	(4.9.4). Install handrail as required.
Toilet Stalls	<p>A. There are no toilet stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.</p> <p>B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.</p> <p>C. Grab bars are not provided in Men's or Women's Rest Rooms.</p>	<p>A. (4.17.3). Handicapped bathrooms located on 2nd floor.</p> <p>B. (4.17.5). Handicapped bathrooms located on 2nd floor.</p> <p>C. (4.17.6). Handicapped bathrooms located on 2nd floor.</p>

BUILDING NUMBER: 1st FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Urinals	Urinal in Men's Rest Room has a rim higher than 17" from floor.	(4.18.2). Handicapped bathrooms located on 2nd floor.
Lavatories and Mirrors	A. Mirrors over sinks in Men's and Women's Rest Rooms are too high above floor. B. Exposed water pipes underneath sinks exist in Men's and Women's Rest Rooms.	A. (4.19.6). Handicapped bathrooms located on 2nd floor. B. (4.19.4). Handicapped bathrooms located on 2nd floor.
Sinks	Proper knee clearance is not provided underneath sinks in Men's or Women's Rest Rooms.	(4.24.3). Handicapped bathrooms located on 2nd floor.
Dispensers	Paper towel dispensers in Men's and Women's Rest Rooms are too high off floor.	(4.23.7). Handicapped bathrooms located on 2nd floor.
Doors	A. Rear Handicapped Entrance Doorway has a slope greater than 1:2. B. Front and rear double doors in Lobby have door opening force greater than 5 lbs. C. Front double doors in Lobby do not provide at least one leaf with a 32" wide opening. D. Rear double doors in Lobby do not provide at least one leaf with a 32" wide opening. E. Double doors to Human Resources do not provide at least one leaf with a 32" wide opening. F. Double doors to Personnel do not provide at least one leaf with a 32" wide opening.	A. (4.13.8). Remodel entrance B. (4.13.11). Replace rear door with automatic door. C. (4.13.4). West doors will be Handicapped entrance. D. (4.13.4). Replace rear door with automatic door. E. (4.13.4). Replace doors. F. (4.13.4). Replace doors.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	G. Door to old Affirmative Action Office does not provide a 32" wide opening.	G. (4.13.5). Re-evaluation; meets ADA Guidelines.
	H. Door to Intern's Office does not provide a 32" wide opening.	H. (4.13.5). Employees only.
	I. Door to stairway (by telephone) does not provide 32" wide opening.	I. (4.13.5). Relocate public phone.
	J. Door by counter in Human Resources does not provide 32" wide opening.	J. (4.13.5). Employee area only.
	K. Thresholds at double doors to Personnel and Human Resources are greater than 1/2".	K. (4.13.8). Re-evaluation; meets ADA Guidelines.
Elevators (2)	A. Hall Call Buttons are not the proper type.	A. (4.10.3). Elevator Contract.
	B. Hall Lanterns do not exist, with proper visual and audible signals.	B. (4.10.4). Elevator Contract.
	C. Raised and Braille characters do not exist on Hoistway Entrances.	C. (4.10.5). Install as required.
	D. Car Control Panel does not have all the proper features and highest operable part is too high, at 58" above floor.	D. (4.10.12). Elevator Contract.
Counters	Counter in Personnel does not provide a 36" x 36" section for wheelchair accessibility.	(7.2). Modify section of counter.

BUILDING NUMBER: 2nd FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Double doors to Legal Department do not provide at least one leaf with a 32" wide opening.	A. (4.13.4). Install Call-Buzzer for assistance.
	B. Door leading to room with sink in Legal Department does not provide a 32" wide opening.	B. (4.13.5). Employee only.
	C. Door on right side of Hallway (Secretary's) does not provide a 32" wide opening.	C. (4.13.5). Employee only.
	D. Doorway leading to Women's Rest Room does not provide a 32" wide opening.	D. (4.13.5). Modify as required.
	E. Double doors to City Clerk's Office do not provide at least one leaf with a 32" wide opening.	E. (4.13.4). Install Call-Buz. for assistance.
	F. Doorway to Asst. City Clerk's Office does not provide a 32" wide opening.	F. (4.13.5). Employee only.
	G. Door to Administrative Support Office has a threshold greater than 1/2".	G. (4.13.8). Employee only.
	H. Door to Administrative Support Office has a door opening force greater than 5 lbs.	H. (4.13.11). Employee only.
Drinking Fountains	A. Both fountains on Second Floor have spouts too high from floor.	A. (4.15.2). Install one Handicapped fountain.

BUILDING NUMBER: 2nd FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD	
	B. Both fountains on Second Floor have water flow toward rear.	B. (4.15.3). Install Handicapped fountain.	one
	C. Neither fountain on Second Floor provides the proper knee clearance.	C. (4.15.1). Install Handicapped fountain.	one
Counter	Counter at City Clerk's Office does not provide a 36" x 36" section for wheelchair accessibility.	(7.2). Modify as required.	
Sinks	A. Sink in Legal Department does not provide proper knee clearance.	A. (4.24.3). Employee only.	
	B. Sink in Legal Department does not provide proper clear floor space.	B. (4.24.5). Employee only.	
Tables	Conference Room table in Legal Department does not provide proper knee clearance.	(4.32.3). Employee only.	
Toilet Stalls	A. There are no toilet stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3). Modify as required.	
	B. Stall door in Women's Rest Room does not provide 32" wide opening.	B. (4.17.5). Modify as required.	
	C. Grab bars are on a slant and do not exist behind toilet in Men's and Women's Rest Rooms.	C. (4.17.6). Modify as required.	
Urinals	Urinal in Men's Rest Room has a rim higher than 17" above floor.	(4.18.2). Modify as required.	
Water Closets	Toilet in Men's Rest Room is too low from floor.	(4.16.3). Modify as required.	

BUILDING NUMBER: 2nd FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	A. Mirrors over sinks in Men's and Women's Rest Rooms are too high above floor.	A. (4.19.6). Modify as required.
	B. Exposed water pipes underneath sinks exist in Women's Rest Room.	B. (4.19.4). Modify as required.
Sinks	Proper knee clearance is not provided underneath sinks in Men's Rest Room.	(4.24.3). Modify as required.
Dispensers	Paper towel dispensers in Men's and Women's Rest Rooms are too high off floor.	(4.23.7). Modify as required.
Space Allowance	Passage leading to stalls in Women's Rest Room does not provide proper wheelchair passage width.	(4.2.1). Remove divider wall between entrance and lounge.

BUILDING NUMBER: 3rd FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Doorway to Economic Development Office does not provide 32" wide opening.	A. (4.13.5). Re-evaluation; meets ADA Standards.
	B. Doorway to Lounge does not provide 32" wide opening.	B. (4.13.5). Remove existing door.
	C. Swinging door in Commission Chambers leading to Commissioner Seating does not provide 32" opening.	C. (4.13.5). Employee only.
	D. Doorway to Administrative Services does not provide 32" wide opening.	D. (4.13.5). Re-evaluation; meets ADA Standards.
	E. Doorway to Deputy City Manager's Office does not provide 32" wide opening.	E. (4.13.5). Employee only.
	F. Door to Kitchen in City Manager's Office does not provide 32" wide opening.	F. (4.13.5). Employee only.
	G. Door to Commissioners' Office in City Manager's Office does not provide 32" wide opening.	G. (4.13.5). Employee only.
Assembly Area	Designated wheelchair location does not exist in Commission Chamber.	(4.33.3). Remove existing seating as needed; designate Handicapped.
Fixed Seating	A. Proper knee clearance is not provided underneath Commissioner's desk in Chamber.	A. (4.32.3). Employee only.
	B. Proper knee clearance is not provided underneath computer keyboards throughout City Manager's Office and Mayor's Office.	B. (4.32.3). Employee only.
	C. Proper knee clearance is not provided underneath Secretaries' desks in City Manager's Office and Mayor's Office.	C. (4.32.3). Employee only.

BUILDING NUMBER: 3rd FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	D. Conference table in City Manager's Office and in Mayor's Office does not provide proper knee clearance.	D. (4.32.3). Construct new tables to meet ADA Guidelines.
	E. Proper knee clearance is not provided for employee at Main Counter in City Manager's and Mayor's reception areas.	E. (4.32.3). Employee only.
	A. Counters throughout City Manager's and Mayor's Offices are too high and do not provide a 36" x 36" section for wheelchair accessibility.	A. (7.2)(1)&(2). Employee only.
	B. Counters throughout City Manager's and Mayor's Offices do not provide proper knee clearance for employees in wheelchairs.	B. (4.32.3). Employee only.
	Speaker Lectern	Lectern is too high to allow a person in a wheelchair accessibility to microphone.
Accessible Route	A. Does not exist to Commissioner Seating due to 6" step at raised platform.	A. (4.3.8). Employee only.
	B. Does not exist to Commission Meeting Room behind Commissioner platform (seating), due to step.	B. (4.3.8). Employee only.
	C. Does not exist to sink and vending machines in City Manager's and Mayor's Office kitchen, due to present location of refrigerator.	C. (4.3.2)(2). Employee only.
	D. In Mayor's Conference Room, present location of chairs does not allow wheelchair passage around conference table.	D. (4.2.1). Construct new table to meet ADA Guidelines.

BUILDING NUMBER: 3rd FL
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: City Hall
112 Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	<p>A. Sink in Lounge does not provide proper knee clearance.</p> <p>B. Sink in City Manager's Office and in Mayor's Office does not provide proper knee clearance.</p>	<p>A. (4.24.3). Modify as required.</p> <p>B. (4.24.3). Employee only.</p>
Drinking Fountains (2)	Drinking fountains do not provide proper knee clearance.	(4.15.5)(1). Install one Handicapped fountain.
Toilet Stalls	<p>A. There are no toilet stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.</p> <p>B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.</p>	<p>A. (4.17.3). Designated bathrooms on 2nd floor.</p> <p>B. (4.17.5). Designated bathrooms on 2nd floor.</p>
Space Allowance	Passage to stalls in Men's Rest Room does not provide proper wheelchair passage width.	(4.2.1). Designated bathrooms on 2nd floor.
Urinals	Urinal in Men's Rest Room has a rim higher than 17" above floor.	(4.18.2). Designated bathrooms on 2nd floor.
Water Closets	<p>A. Grab bars do not exist in any stalls in Men's and Women's Rest Rooms.</p> <p>B. Toilets in Men's and Women's Rest Rooms are not the proper height.</p>	<p>A. (4.17.6). Designated bathrooms on 2nd floor.</p> <p>B. (4.16.3). Designated bathrooms on 2nd floor.</p>
Lavatories and Mirrors	Mirrors over sinks in Men's and Women's Rest Rooms are too high above floor.	(4.19.6). Designated bathrooms on 2nd floor.
Dispensers	Paper towel dispensers in Men's and Women's Rest Rooms are too high off floor.	(4.23.7). Designated bathrooms on 2nd floor.
Sinks	Proper knee clearance is not provided underneath sinks in Women's Rest Room.	(4.24.3). Designated bathrooms on 2nd floor.

BUILDING NUMBER: ¹³³⁵ 2nd FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	A. Stairway to Second Floor, Building & Maintenance Offices, has handrails that are not continuous proper height.	A. (4.9.4)(1-7). Employees only.
	B. Stairway from Second Floor Shop Room to ground floor, has handrails that are not continuous proper height.	B. (4.9.4)(1-7). Employees only.
Doors	A. Swinging door at Building & Maintenance Counter does not provide 32" wide opening.	A. (4.13.5). Employees only.
	B. Door to right of Main Counter (Pete's Office) does not provide 32" wide opening.	B. (4.13.5). Employees only.
	C. Door between Lobby (Building & Maintenance), and room with Time Clock, does not provide 32" wide opening.	C. (4.13.5). Employees only.
	D. Door to Jim Pyatt's Office does not provide 32" wide opening.	D. (4.13.5). Employees only.
	E. Doors to Men's and Women's Rest Rooms do not provide 32" wide opening.	E. (4.13.5). Employees only.
	F. Door to office next to Steve Kelly's Office, leading hallway, does not provide 32" wide opening.	F. (4.13.5). Employees only.

BUILDING NUMBER: 2nd FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	G. Doorway off of hall into Secretary's Office does not provide 32" wide opening.	G. (4.13.5). Employees only.
	H. Door to Secretary's Lounge does not provide 32" wide opening.	H. (4.13.5). Employees only.
	I. File Room door does not provide 32" wide opening.	I. (4.13.5). Employees only.
	J. Office door off hall by Break Room does not provide 32" wide opening.	J. (4.13.5). Employees only.
	K. Door from Men's Rest Room Lockers into Rest Room does not provide 32" wide opening.	K. (4.13.5). Employees only.
	L. Door to shower stall in Men's Rest Room does not provide 32" wide opening.	L. (4.13.5). Employees only.
Counters/Desks	A. Counter in Building & Maintenance Lobby does not provide 36" x 36" area.	A. (7.2). Employees only.
	B. Counter on door to rear of Secretary's Office is too high from the floor.	B. (4.32.4). Employees only.
	C. Desks throughout Building & Maintenance offices do not provide proper knee clearance.	C. (4.32.3). Employees only.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(393 Spaces) Proper number of spaces with signage exist, but eleven of thirteen spaces have signage too low.	(4.6.4). Modify as required.
Signage	Ramp sign on South side of building is not the proper height or location.	(4.30). Alter sign location.
Curb Ramps	<p>A. Ramp is not provided to Credit Union entrance and adjoining entrance.</p> <p>B. Curb ramps at entrance to Community Center, and from parking to front walkway at Southeast side of building, are not proper.</p>	<p>A. (4.7.1). Install curb ramp.</p> <p>B. (4.7). Modify as required.</p>
Telephone	Public telephone at Main Entrance is not Hearing Aid compatible with volume controls.	(4.31.5)(1)&(2). See Cover Sheet.
Ramps	<p>A. Ramp to parking lot (front) from sidewalk and transportation, has slope too great.</p> <p>B. Ramp leading to Computer Room in C.I.S. has slope too great, without level landings.</p> <p>C. Ramp does not exist at side entrance to Computer Room in C.I.S., where 8" step exists.</p> <p>D. Step down at Generator Room does not have a proper ramp.</p>	<p>A. (4.7.2). Modify as required.</p> <p>B. (4.7.2). Also (4.8.4)(1-4). Employees only.</p> <p>C. (4.8). Employees only.</p> <p>D. (4.8). Employees only.</p>

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramps	E. Ramp by outside employee Picnic Tables (North side) does not provide proper handrails.	E. (4.8.5). Install handrails.
	F. Ramp to Computer Room in Traffic Engineering has slope too great and does not have level landing at top of ramp by door.	F. (4.7.2). Also (4.8.4)(1-4). Employees only.
	G. Ramp from Computer Room to Signal Shop in Traffic Engineering has slope too great.	G. (4.7.2). Employees only.
	H. Door (Cadwell) with two steps in C.I.S. does not have proper ramp.	H. (4.8). Employees only.
	A. Curb ramps do not exist at the bottom landings to the four stairways at the rear of building on Alexander Street where curb exists.	A. (4.7.1). Install curb ramps.
	B. Curb ramp does not exist from main walkway in front of building to doorway of C.I.S. Training.	B. (4.7.1). Install curb ramp.
	C. Walkway by outside employee Picnic Tables (North side), has a step-down that does not provide a proper curb ramp.	C. (4.7.1). Install curb ramp.
	D. Threshold at rear Dock door leading to stairs has step that needs curb ramp.	D. (4.7.1). Employees only.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramps	E. Four doors at top of the four stairways at the rear of building on Alexander Street have steps that need curb ramps.	E. (4.7.1). Install curb ramps.
Alarms	Visual Alarm System is not an integrated part of Building's Alarm System.	(4.28.1). Install as required.
Doors	A. Door opening force is greater than 5 IBF on Main Entrance double doors.	A. (4.13.11). Adjust door closer.
	B. Threshold at double doors to Signal Shop exceeds 1/2".	B. (4.13.8). Employees only.
	C. Door between C.I.S. Computer Room and Break Room does not provide 32" wide opening.	C. (4.13.5). Employees only.
	D. Threshold at two sets of double doors to C.I.S. offices exceeds 1/2".	D. (4.13.8). Employees only.
	E. Entrance door to Parks and Recreation does not provide 32" wide opening.	E. (4.13.5). Re-evaluation; meets ADA Standards.
	F. Rear Exit Door leading to hall in P u b l i c Works/Engineering does not provide 32" opening.	F. (4.13.5). Employees only.
	G. Doorway to C.I.S. Training (outside door) has threshold greater than 1/2", and does not provide 32" wide opening.	G. (4.13.8)&(4.13.5). Re-evaluation; meets ADA Standards.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	H. Threshold at outside Credit Union door exceeds 1/2".	H. (4.13.8). Services will be offered at alternate location.
	I. Doorway into offices (off hallway) does not provide 32" wide opening.	I. (4.13.5). Re-evaluation; meets ADA Standards.
	J. Threshold at double doors leading to outside employee Picnic Tables exceeds 1/2".	J. (4.13.8). Re-evaluation; meets ADA Standards.
	K. Exit door from Engineering Offices to hall by Rest Rooms does not provide 32" wide opening.	K. (4.13.5). Employees only.
	L. Double inside doors to Community Center has threshold greater than 1/2" and do not provide 32" wide opening.	L. (4.13.8)&(4.13.5). Modify as required.
	M. Two sets of double outside doors at Main Entrance to Community Center do not provide 32" wide opening.	M. (4.13.5). Re-evaluation; meets ADA Standards.
	N. South outside double doors of Community Center have threshold greater than 1/2", and do not provide 32" wide opening.	N. (4.13.8)&(4.13.5). Re-evaluation; meets ADA Standards.
	O. Women's Rest Room, left side door in Community Center, does not provide 32" wide opening.	O. (4.13.5). Not designated Handicapped Rest Room.
	P. Door between Women's Rest Room hallway in Community Center and stall area, does not provide 32" opening.	P. (4.13.5). Not designated Handicapped Rest Room.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Assembly Areas	Designated wheelchair accessible route onto stage does not exist.	(4.33.5). Install ramp.
Stairs	A. Stairs at Dock have handrails on only one side.	A. (4.9.4)(1). Install handrails.
	B. Stairs to right of Dock (South side), have handrails on only one side.	B. (4.9.4)(1). Install handrails.
	C. Four stairways at rear of building (Alexander St.), have handrails that are not the proper height.	C. (4.9.4)(5). Raise handrails.
	D. Stairway from Break Room to Second Floor storage in Parks and Recreation, has open risers.	D. (4.9.2). Employees only.
	E. Stairway from Break Room to Second Floor storage in Parks and Recreation has handrails that are not continuous proper height, nor along both sides of stairs.	E. (4.9.4)(1-6). Employees only.
	F. Stairway to Second Floor storage in Traffic Engineering has open risers.	F. (4.9.2). Employees only.
	G. Handrails on stairs at Traffic Engineering are only on one side.	G. (4.9.4)(1). Install handrails.
Sinks	A. Kitchen sink in C.I.S. does not provide proper knee clearance.	A. (4.24.3). Employees only.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	B. Sink in Break Room of Parks and Recreation does not provide proper knee clearance (width).	B. (4.24.3). Employees only.
	C. Sink in Public Works does not provide proper knee clearance.	C. (4.24.3). Employees only.
	D. Sink in Engineering does not provide proper knee clearance.	D. (4.24.3). Employees only.
	E. Sink in Break Room of Traffic Engineering does not provide proper knee clearance.	E. (4.24.3). Employees only.
	F. Sink in Coffee Room of Traffic Engineering does not provide proper knee clearance, or proper clear floor space.	F. (4.24.3). Also (4.24.5). Employees only.
	G. Sinks in Employee Break Room (by Community Center) do not provide proper knee clearance or proper clear floor space.	G. (4.24.3). Also (4.24.5). N/A; changes original function of device.
	H. Sink in Nurse's Office does not provide proper knee clearance.	H. (4.24.3). Employees only.
	Counters	A. Main Counter of Parks and Recreation is too high and does not provide a 36" x 36" area.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	B. Reception Counter at P u b l i c Works/Engineering is too high and does not provide a 36" x 36" area.	B. (4.32.4). Also (7.2). Modify as required.
	C. Microfilm Counter in P u b l i c Works/Engineering is too high and does not provide proper knee clearance.	C. (4.32.4). Also (4.32.3). Employees only.
	D. Counters with Atlas are too high in P u b l i c Works/Engineering.	D. (4.32.4). Modify as required.
	E. Counters in Drafting Room of Public Works/Engineering are too high.	E. (4.32.4). Employees only.
	F. Counters in Credit Union are too high and do not provide a 36"x 36" area.	F. (4.32.4). Also (7.2). Services will be offered at alternate locations as needed.
	G. Office Counters inside Credit Union are too high.	G. (4.32.4). Employees only.
	H. Counter on door to Payroll is too high.	H. (4.32.4). Modify as required.
	I. Main Counter in Payroll is too high and does not provide a 36" x 36" area.	I. (4.32.4). Also (7.2). Employees only.
	J. Counter on door to Risk Management is too high.	J. (4.32.4). Employees only.
	K. Counter on door to Nurse's Office is too high.	K. (4.32.4). Employees only.
	L. Counter in Men's Rest Room (North side) is too high.	L. (4.32.4). Employees only.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	M. Counters in Public Works are too high and do not provide 36" x 36" area.	M. (4.32.4). Also (7.2). Employees only.
	N. Main Counter of Engineering does not provide 36" x 36" area and is too high.	N. (7.2). Also (4.32.4). Employees only.
	O. Counters throughout Engineering are too high.	O. (4.32.4). Employees only.
	P. Counter in Code Enforcement does not provide 36" x 36", section and is too high.	P. (7.2). Also (4.32.4). Assistance provided at Central Counter as needed.
	Q. Counter is too high at Plan Review (Engineering).	Q. (4.32.4). Employees only.
	R. At Staff Assistant II Office (Enforcement), counter is too high.	R. (4.32.4). Employees only.
	S. Counters in Kitchen (Enforcement) are too high.	S. (4.32.4). Employees only.
	T. Counter at office of Director of Planning is too high and does not provide 36" x 36" area.	T. (4.32.4). Employees only.
	U. Counters in Planning mail room are too high.	U. (4.32.4). Employees only.
	V. Counter at Planning Manager's Office is too high and does not provide 36" x 36" area.	V. (4.32.4). Also (7.2). Employees only.
	W. Counter in Community Development is too high and does not provide 36" x 36" area.	W. (4.32.4). Also (7.2). Employees only.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	X. Counter in Break Room (by Community Center) is too high.	X. (4.32.4). Lower section of counter.
	Y. Sink counter in Nurse's Office is too high.	Y. (4.32.4). Employees only.
Seating	A. Desks and computer tables throughout C.I.S. do not provide proper knee clearance.	A. (4.32.3). Employees only.
	B. Desks and computer tables throughout C.I.S. Training do not provide proper knee clearance.	B. (4.32.3). Employees only.
	C. Posting Machine in Credit Union does not provide proper knee clearance.	C. (4.32.3). Employees only.
	D. Picnic Tables in employees' outside Break Area (North side), do not provide proper knee clearance.	D. (4.32.3). Employees only.
	E. Computer desks in Engineering do not provide proper knee clearance.	E. (4.32.3). Employees only.
	F. Computer desks behind counters of Building Permit office area do not provide proper knee clearance.	F. (4.32.3). Employees only.
	G. Drafting tables in Engineering do not provide proper knee clearance.	G. (4.32.3). Employees only.
	H. Computer desks in Plan Review do not provide proper knee clearance.	H. (4.32.3). Employees only.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountains	A. Spout of fountain in Parks and Recreation Break Room is too high and clear floor space is not provided.	A. (4.15.2) & (4.15.5) (2). Employees only.
	B. Fountain in Public Works/Engineering has spout too high and clear floor space is not provided.	B. (4.15.2) & (4.15.5) (2). Employees only.
	C. Drinking fountain in hallway storage area of Traffic Engineering has spout too high and clear floor space is not provided.	C. (4.15.2) & (4.15.5) (2). Employees only.
	D. Fountain in Signal Shop has spout too high and clear floor space is not provided.	D. (4.15.2) & (4.15.5) (2). Employees only.
	E. Fountain by Community Center Rest Rooms has water flow toward rear.	E. (4.15.3). Install Handicapped fountain.
Accessible Route	A. Minimum clear width of 36" is not provided around back of Counter (main) of Parks and Recreation.	A. (4.3.3). Employees only.
	B. Barrier walls in Parks and Recreation offices do not allow minimum clear width to some desks.	B. (4.3.3). Employees only.
	C. Proper minimum clear width is not provided in Public Works/Engineering rear hallway.	C. (4.3.3). Employees only.
	D. Hallway by counters in Credit Union does not provide minimum clear width.	D. (4.3.3). Staff to provide assistance at alternate location as needed.

BUILDING NUMBER: 1st FL
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	E. Space between desk and files behind Counter of Credit Union does not provide proper minimum clear width.	E. (4.3.3). Employees only.
	F. Copy machine at present location in Payroll does not provide minimum clear width between desk.	F. (4.3.3). Employees only.
	G. With barrier wall in Men's Rest Room (North side), proper minimum clear width is not provided at stalls.	G. (4.3.3). Not designated Handicapped Rest Room.
	H. Passage by stalls in Women's Rest Room (North side), does not provide minimum clear width.	H. (4.3.3). Not designated Handicapped Rest Room.
	I. Community Development Office has barrier walls that make two offices unaccessible because of a lack of minimum clear width.	I. (4.3.3). Employees only.
	J. Hallway between Annex hallway and Data Information Services does not provide minimum clear width.	J. (4.3.3). Employees only.
Reach Ranges	Height of Applications and Forms Counter is beyond proper Reach Ranges.	(4.2.5) or (4.2.6). Modify as required.
Water Closets	Toilets in Men's and Women's Public Rest Rooms at North side of Annex, and at the Community Center, are not the proper height.	(4.16.3). Modify toilet in Public Rest Rooms as required.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. There are no stalls in Men's or Women's North side Rest Rooms, or in the Community Center Rest Rooms, that are the proper size and arrangement.	A. (4.17.3). Modify stalls in Public Rest Rooms as required.
	B. Stall doors in Men's and Women's North side Rest Rooms, and two of three stalls in Men's and Women's Community Center Rest Rooms, do not provide 32" wide opening.	B. (4.17.5). See A.
	C. Grab bars do not exist in any stalls in Men's and Women's North side Rest Rooms, or Men's and Women's Community Center Rest Rooms.	C. (4.17.6). Install grab bars.
Urinals	Urinals in Men's North side Rest Room and Community Center Rest Room, have rims too high from floor.	(4.18.2). Lower urinals in Public Rest Rooms.
Lavatories and Mirrors	A. Mirrors are too high from floor in Men's and Women's North side Rest Rooms and in Community Center Rest Rooms (over sinks).	A. (4.19.6). Lower mirrors in Public Rest Rooms.
	B. Exposed water pipes exist underneath sinks in Men's and Women's Community Center Rest Rooms.	B. (4.19.4). Modify as required.
	C. Mirror in Parks and Recreation Break Room is too high above floor.	C. (4.19.6). Employees only.

BUILDING NUMBER: 1st FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	Sinks in Men's and Women's North side, and Community Center Rest Rooms, do not provide proper knee clearance.	(4.24.3). Modify in Public Rest Rooms.
Dispensers	<p>A. Towel dispenser in Nurse's Office is too high above ground.</p> <p>B. Women's Rest Room in Community Center has towel dispenser too high above ground.</p>	<p>A. (4.23.7). Employees only.</p> <p>B. (4.23.7). Lower dispenser.</p>

BUILDING NUMBER: 2nd FL
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: City Hall/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sink	Utility sink in Men's Rest Room does not provide proper knee clearance.	(4.24.3). Employees only.
Shower Stalls	A. Shower stall in Men's Rest Room does not provide proper size and clearances.	A. (4.21.2). Employees only.
	B. Curb at entrance to shower stall exists.	B. (4.21.7). Employees only.
	C. Seat is not provided in shower stall in Men's Rest Room.	C. (4.21.3). Employees only.
	D. A proper shower spray unit at shower in Men's Rest Room does not exist.	D. (4.21.6). Employees only.
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3). Employees only.
	B. Stall doors do not provide 32" wide opening in Men's or Women's Rest Rooms.	B. (4.17.5). Employees only.
	C. Grab bars do not exist in Men's or Women's Rest Room stalls.	C. (4.17.6). Employees only.
Lavatories and Mirrors	A. Mirrors over sinks in Men's and Women's Rest Rooms are too high from the floor.	A. (4.19.6). Employees only.
	B. Exposed water pipes exist underneath sinks in Men's and Women's Rest Rooms.	B. (4.19.4). Employees only.
Accessible Route	Minimum clear width of 36" is not provided at passage in front of stalls in Men's Rest Room.	(4.3.3). Employees only.

BUILDING NUMBER: 1400
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Civic Center
40 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Double doors at Main Entrance (2 sets) to Auditorium, do not provide at least one leaf with a 32" wide opening.	A. (4.13.4). Replace doors.
	B. Inside doors between Main Entrance Lobby and Auditorium do not provide at least one leaf with a 32" wide opening.	B. (4.13.4). Replace doors.
	C. Double doors at Main Entrance (2 sets) to Auditorium exceed proper door opening force.	C. (4.13.11) 5 IBF of force. See A.
	D. Double doors at Main Entrance to Lobby do not provide at least one leaf with a 32" opening.	D. (4.13.4). Replace doors.
	E. Rear double doors at Lobby do not provide at least one leaf with a 32" opening.	E. (4.13.4). East entrance to be designated Handicapped Entrance.
	F. Rear double doors at Lobby have step at threshold which exceeds 1/2" height.	F. (4.13.8). See E.
	G. Double doors from Lobby to Auditorium do not provide 32" opening.	G. (4.13.4). Replace doors.
	H. Doorway to Men's Rest Room does not provide 32" wide opening.	H. (4.13.4). Modify as required.
	I. Thresholds at doors leading outside from Auditorium (rear and South side) exceed 1/2" height.	I. (4.13.8). Employees only.
	J. Double doors leading outside from left side of Stage have 3" step at threshold.	J. (4.13.8). Replace doors.

BUILDING NUMBER: 1400
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Civic Center
40 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
K. Double doors between Auditorium and Kitchen do not provide at least one leaf with a 32" opening.	K. (4.13.4). Both doors to remain open while building is occupied.	
L. Double doors to Storage Room do not provide at least one leaf with a 32" opening.	L. (4.13.4) Employees only.	
M. Threshold at doorway (South) leading outside from Storage Room has threshold greater than 1/2".	M. (4.13.8). Employees only.	
N. Double doors leading outside from right side of Stage (North), do not provide at least one leaf with a 32" opening.	N. (4.13.4). Not designated Handicapped accessible.	
O. Two sets of double doors between Lobby (by Library), and Meeting Room, do not provide at least one leaf with a 32" opening.	O. (4.13.4). Replace doors.	
P. Rear double doors behind Stage leading outside, do not provide at least one leaf with a 32" opening.	P. (4.13.4). Employees only.	
Q. Threshold at rear door from Lobby to Meeting Room (by Library), exceeds 1/2".	Q. (4.13.8). Modify as required.	
Accessible Route:	Does not exist from double doors leading outside from Auditorium on right side of Stage, to an accessible walkway.	(4.3.2)(2). Not designated Handicapped accessible.
Alarms	Visual Alarm System is not an integrated part of Building's Alarm System.	(4.28.1). Install as required.

BUILDING NUMBER: 1400
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Civic Center
40 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Telephone	<p>A. Public Phone Booth (by Rest Rooms) has doorway which does not provide 32" wide opening.</p> <p>B. Public Phone Booth (by Rest Rooms) is not Hearing Aid compatible with volume controls.</p> <p>C. Public Phone Booth (by Rest Rooms) has highest operable part 63" from floor.</p>	<p>A. (4.13.4). See Cover Sheet.</p> <p>B. (4.31.5)(1)&(2). See A.</p> <p>C. (4.31.3). Also (4.2.5) and (4.2.6). See A.</p>
Drinking Fountain	<p>A. Fountain in Auditorium Lobby has water flow directed toward rear.</p> <p>B. Fountain in Auditorium Lobby does not provide proper knee clearance.</p> <p>C. Fountain in Auditorium Lobby has a spout higher than 36" from floor (43").</p>	<p>A. (4.15.3). Install paper cup dispenser.</p> <p>B. (4.15.5). See A.</p> <p>C. (4.15.2). See A.</p>
Sinks	<p>Sink in Kitchen does not provide proper knee clearance.</p>	<p>(4.24.3). Install additional hand sink.</p>
Stairs	<p>Two sets of stairs on either side of Stage do not have proper handrails.</p>	<p>(4.9.4)(1-7). Install handrails.</p>
Accessible Route	<p>Does not exist to Stage from Auditorium.</p>	<p>(4.3.2)(2). Install ramp.</p>
Toilet Stalls	<p>A. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.</p> <p>B. Grab bars do not exist behind toilets in Men's and Women's Rest Room stalls.</p> <p>C. Grab bars that do exist on side of accessible stall in Men's Rest Room are not proper height.</p>	<p>A. (4.17.5). Modify as required.</p> <p>B. (4.17.6). Install grab bars.</p> <p>C. (4.17.6). Adjust height.</p>

BUILDING NUMBER: 1400
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Civic Center
40 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	A. Mirrors in Men's Rest Room are too high.	A. (4.19.2). Lower mirrors.
	B. Exposed water pipes exist underneath sinks in Men's and Women's Rest Rooms.	B. (4.19.4). Modify as required.
	C. Counter surface at sink in Women's Rest Room does not provide proper knee clearance.	C. (4.19.2). Modify as required.

BUILDING NUMBER: 1410
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Airpark Complex
1000 N. Hercules Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist.	NOTE: Lessee responsible for ADA compliance. (4.1.2). Also (4.6.2).
Emergency Telephone	Highest operable part is 58" from ground on Emergency Phone at Main Building.	(4.2.6) 54" maximum height for side reach.
Accessible Route	A. Hallway at Main Entrance does not provide 36" opening with glass counters in present location.	A. (4.3.3).
	B. When pilots park in grass, there is no accessible walkway to Main Building.	B. (4.3.2)(2).
	C. Walkway does not exist from Main Building to Maintenance Building.	C. (4.3.2)(2).
	D. Walkway from Main Building to Fuel Station does not have a turnaround area.	D. (4.3.4).
	E. Does not exist to Picnic Table in back of Main Building.	E. (4.3.2)(2).
Doors	A. Threshold at Main Entrance Door is greater than 1/2".	A. (4.13.8).
	B. Area in front of Main Entrance Door is sloped, not level.	B. (4.13.6).
	C. Main Entrance doorway does not provide 32" opening.	C. (4.13.5).
	D. Doorways throughout Main Building (Office, Rest Room, etc.) do not provide 32" opening.	D. (4.13.5).

BUILDING NUMBER: 1410
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Airpark Complex
1000 N. Hercules Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	E. Doorway leading outside to Fuel Station does not provide 32" opening.	E. (4.13.5).
	F. Doorway leading outside to Patio does not provide 32" opening.	F. (4.13.5).
	G. Threshold at door leading outside to Fuel Station, and threshold at door leading outside to Patio, have 5" steps.	G. (4.13.8).
Toilet Stalls (Main Building)	A. There are no stalls in Men's or Women's Rest Rooms that are proper size and arrangement.	A. (4.17.3). Also (4.22.4).
	B. Doorways to stalls in Men's and Women's Rest Rooms do not provide 32" opening.	B. (4.17.5).
Water Closets (Main Building)	A. Toilets in Men's and Women's Rest Rooms are not the proper height.	A. (4.16.3).
	B. Grab bars do not exist in Men's or Women's Rest Room stalls.	B. (4.17.6).
Urinals (Main Building)	Urinal in Men's Rest Room has rim 25" from floor.	(4.18.2).
Lavatories and Mirrors (Main Building)	A. Mirrors over sinks in Men's and Women's Rest Rooms are too high.	A. (4.19.6).
	B. Paper towel dispenser in Men's Rest Room is too high.	B. (4.23.7). Also (4.2.5), (4.2.6).
	C. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	C. (4.24.3).
	D. Sinks in Men's and Women's Rest Rooms have exposed water pipes.	D. (4.19.4). Also (4.24.6).

BUILDING NUMBER: 1410
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Airpark Complex
1000 N. Hercules Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Service Counter	Main Service Counter is too high and does not provide a 36" x 36" area accessible to wheelchairs.	(7.2)(1).
Seating	Desk and tables throughout Main Room in Main Building do not have proper knee clearance.	(4.32.3).
Parts Counter (Maintenance Building)	Parts Service Counter in Maintenance Building does not provide a 36" x 36" area accessible to wheelchairs.	(7.2)(1).
Water Fountain	A. Fountain in Main Building has a spout too high from floor.	A. (4.15.2).
	B. With table in present location, clear floor space in front of fountain is not provided.	B. (4.15.5)(1).
	C. Fountain has water flow toward rear.	C. (4.15.3).
Emergency Telephone	A. Highest operable part is 65" from ground on Emergency Phone at Maintenance Building.	A. (4.2.6).
	B. Clear ground space is not provided by Emergency Telephone at Maintenance Building, due to the fact that surface at phone is grass.	B. (4.31.2). Also (4.5).
Doors	A. 4" step exists at threshold to Parts Room.	A. (4.13.8).
	B. Doorway at top of stairs does not provide 32" opening.	B. (4.13.5).
	C. Doorway at Rest Room has an 8" and a 4" step at threshold.	C. (4.13.8).

BUILDING NUMBER: 1410
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Airpark Complex
1000 N. Hercules Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	A. Stairs to second floor Loft have open risers.	A. (4.9.2).
	B. Stairs to second floor Loft have handrails that are not a continuous 34" to 38" above stair nosings.	B. (4.9.4).
Toilet Stalls (Maintenance Building)	Grab bars do not exist.	(4.17.6).
Water Closets (Maintenance Building)	Toilet in Rest Room is not the proper height.	(4.16.3).
Lavatories and Mirrors (Maintenance Building)	A. Mirror over sink in Rest Room is too high from floor.	A. (4.19.6).
	B. Exposed water pipes exist underneath sink in Rest Room.	B. (4.19.4). Also (4.24.6).
	C. Paper towel dispenser in Rest Room is too high from floor.	C. (4.23.7). Also (4.2.5), (4.2.6).
Shower Stalls (Maintenance Building)	A. 6" step exists at door to shower stall (at threshold).	A. (4.21.7).
	B. 26" opening exists at shower stall door, thus not providing 32" opening.	B. (4.13.5).
	C. Shower stall is not the proper size and arrangement with seat and grab bars.	C. (4.21.2). Also (4.21.3), (4.21.4).
	D. Proper shower spray unit and proper controls do not exist.	D. (4.21). Also (4.21.5).

BUILDING NUMBER: 1420
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Cliff Stephens Park
801 Fairwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist by entrance to West side of Park, or by parking lot of East side of Park.	(4.6.2) See also (4.6.3), (4.6.4), (4.30). Modify as required.
Accessible Route	A. Does not exist to at least one Picnic Table that has proper clear floor space anywhere within Park.	A. (4.3.2)(2) Install sidewalk and designate Handicapped tables.
	B. Far West side dock is not accessible by an accessible walkway.	B. (4.3.2)(2). Install sidewalk.
	C. Slope is too great on both walkways on East side. Lacks level rest areas.	C. (4.3.7). See also (4.8.2). Modify as required and designate one dock handicapped.
	D. Slope from walkway to East dock is too great.	D. (4.3.7). See also (4.8.2). See C.
Ground and Floor Surfaces	A. Bridge on East side is slippery when wet; needs slip-resistant treads.	A. (4.5.1) Install slip-resistant material.
	B. Bridge on West side is slippery when wet; needs slip-resistant treads.	B. (4.5.1). See A.
	C. All docks throughout Park are slippery when wet and need slip-resistant treads.	C. (4.5.1). See A.
Handrails	Handrails on docks throughout Park are at 42" at top of handrail.	(4.9.4)(5) Lower handrails.
Drinking Fountains	A. Most fountains throughout Park are not accessible from walkways.	A. (4.3.2)(2) Install sidewalk.
	B. All but one fountain in Park do not provide at least 30" by 48" clear floor space that allows a person in wheelchair to make a parallel approach to unit.	B. (4.15.5)(2) Handicapped fountain exists, designate as such.

BUILDING NUMBER: 1420
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Cliff Stephens Park
801 Fairwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Spouts of all but one fountain are located at rear.	C. (4.15.3) See B.
	D. Water flow is less than 4" high on all fountains.	D. (4.15.3). See B.
	E. Water flow is not within 3" of front edge of fountain.	E. (4.15.3). See B.

BUILDING NUMBER: 1430
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clwr. Beach Recreation Center
69 Bay Esplanade

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. There is no walkway from parking lot to Basketball Courts.	NOTE: No Modifications at this time; UFAS, 4.1.6, (Exceptions). A. (4.3.2)(2).
	B. Does not exist from Center to accessible Picnic Benches, Tables and Grills on East side of Center.	B. (4.3.2)((2)).
Drinking Fountains	A. Fountain by Basketball Courts has a spout 37" from ground.	A. (4.15.2).
	B. Fountain inside has a spout 43" from ground.	B. (4.15.2).
Doors	A. Threshold at doorway to Pool Room is greater than 1/2".	A. (4.13.8).
	B. Both leaves of double doorway at Main Entrance are less than 32".	B. (4.13.4).
	C. Inside doorway to Meeting Room is 29" wide.	C. (4.13.5).
	D. Threshold at doorway to Meeting Room is greater than 1/2".	D. (4.13.8).
	E. Doorway to Weight Room provides a clear opening of 26-1/2".	E. (4.13.5).
	F. Doorway to Men's Rest Room provides a clear opening of 29".	F. (4.13.5).
	G. Doorway to Women's Rest Room provides a clear opening of 29".	G. (4.13.5).
Counters	Counters on both doors to Office are 41" above the floor.	(4.32.4).

BUILDING NUMBER: 1430
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clwr. Beach Recreation Center
69 Bay Esplanade

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	<p>A. Mirrors in Men's Rest Room (44-1/2") and Women's Rest Room (44"), are too high.</p> <p>B. Proper knee clearance is not provided underneath sinks in Men's or Women's Rest Rooms.</p>	<p>A. (4.19.6).</p> <p>B. (4.19.2).</p>
Toilet Stalls	<p>A. There are no stalls in Men's or Women's Rest Rooms that are accessible.</p> <p>B. Toilet stall doors in Men's Rest Room (19-3/4" opening to stalls), and Women's Rest Room (23"), do not provide a minimum clear opening of 32".</p> <p>C. Opening to stalls in Women's Rest Room does not provide a minimum clear opening of 32".</p>	<p>A. (4.17.3), (4.22.4).</p> <p>B. (4.17.5). Also (4.13.5).</p> <p>C. (4.17.5). Also (4.13.5).</p>
Urinals	<p>Urinal is 21-1/2" from rim to floor. A clear floor space is not provided in front of urinal.</p>	<p>(4.18.2). Also (4.18.3).</p>
Water Closets	<p>A. Grab bars do not exist in Men's or Women's Rest Rooms.</p> <p>B. Toilets in Men's Rest Room and Women's Rest Room are 16" from floor.</p>	<p>A. (4.16.4).</p> <p>B. (4.16.3).</p>

*NOTE: Playground was inspected as part of Mandalay Park. It is actually part of Clearwater Beach Recreation Center.

BUILDING NUMBER: 1440
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Coachman Park/Bandshell
100 N. Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Does not exist from walkway to stairs at front of Stage.	(4.3.2)(2). Install brick walkway.
Assembly Areas	Wheelchair location does not exist by Stage or anywhere at complex.	(4.33.3). Also (A4.33), (A4.33.3). Construct wheelchair area.
Doors	Thresholds of the three doors behind Stage are 1" high.	(4.13.8). Employees only.
Water Fountains	A. Fountain has water flow less than 4" high.	A. (4.15.3). Employees only.
	B. Fountain does not provide proper clear floor space that allows a person in a wheelchair to make a parallel approach to the unit.	B. (4.15.5)(2). See A.
Ramps	A. Ramp leading to Stage has a rise greater than 30". Handrails on ramp are located only on one side.	A. (4.8.2). Also (4.8.5). No ramp.
	B. Top of handrail gripping surface is at 33".	B. (4.8.5)(5). Raise handrail.
Stairs	Stairs at front of Stage have a handrail located only on one side.	(4.9.4). Install handrail.

BUILDING NUMBER: 1450
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Coachman Ridge Park
1400 Old Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist from walkway to Handball Courts.	A. (4.3.2)(2) Install sidewalk.
	B. Does not exist from walkway to Playground.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist from walkway to at least one picnic table with proper floor space.	C. (4.3.2)(2). Also see (4.32). Install sidewalk and designate handicapped table.
	D. Does not exist from walkway to Basketball Court.	D. (4.3.2)(2). Install sidewalk.
	E. Slope of walkway to Tennis Courts is too great for a wheelchair.	E. (4.3.7). See also (4.8.2). Modify as required.
Drinking Fountain	A. Fountain is not accessible from walkway.	A. (4.3.2)(2). See also (4.15.5)(2). Install sidewalk.
	B. Water flow is not within 3" of front edge of fountain.	B. (4.15.3). Install Handicapped fountain.
	C. Water flow is less than 4" high.	C. (4.15.3). See B.

BUILDING NUMBER: 1460
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Community Relations, 1st Floor
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Two accessible spaces exist, but signage is too low.	(4.6.4). Modify as required.
Doors	Main entrance door threshold exceeds 1/2".	(4.13.8) Modify as required.
Ramps	Handrail on ramp to main entrance is 31" high.	(4.8.5)(5) Raise handrail.
Water Closets	Grab bars do not exist behind toilets in Men's or Women's Rest Rooms.	(4.16.4) Install as required.
Sinks	A. Counter of kitchen sink is 34-1/2" above the floor.	A. (4.24.2) Employees only.
	B. Knee clearance is not provided underneath kitchen sink.	B. (4.24.3) Employees only.

BUILDING NUMBER: 1470 BUILDING LOCATION: Country Hollow Park
 TARGET DATE: 1994 2724 Brattle Lane
 COMPLETED DATE: 00/00/00

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist from parking lot to accessible walkway.	A. (4.3.2) Install sidewalk.
	B. Does not exist from walkway to field level.	B. (4.3.2)(2) Install sidewalk.
	C. Does not exist from walkway to playground.	C. (4.3.2)(2) Install sidewalk.
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility does not exist.	(4.6.2) See also (4.6.3), (4.6.4), (4.30). Modify as required.
Drinking Fountain	A. Fountain is not accessible from walkway.	A. (4.3.2)(2) Install sidewalk.
	B. Fountain does not provide at least 30" x 48" clear floor space that allows a person in a wheelchair to make a parallel approach to the unit.	B. (4.15.5)(2) Install Handicapped fountain.
	C. Spout is located at rear.	C. (4.15.3) See B.
	D. Water flow is less than 4" high.	D. (4.15.3) See B.
	E. Water flow is not within 3" of front edge of fountain.	E. (4.15.3) See B.

BUILDING NUMBER: 1480
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Countryside Community Park
2640 Sabal Springs

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Gravel walkway from road to Diamond #1 does not provide an accessible route.	A. (4.3.6) Also (4.5.1). Install sidewalk.
	B. Does not exist from walkway to playground and picnic area.	B. (4.3.2)(2) Install sidewalk.
	C. Does not exist from walkway to Basketball Court.	C. (4.3.2)(2) Install sidewalk.
	D. Only Diamond #2 has an accessible route from walkway. Walkway to and between all baseball diamonds must be provided.	D. (4.3.2)(2) Install sidewalk.
Parking	A. Only two spaces for accessible parking exist. With one hundred sixteen spaces, five accessible spaces, designated by signs showing the symbol of accessibility, must be provided.	A. (4.6.2) See also (4.6 (4.1.2)(5), (4.30). Modif. required.
	B. Accessible space by entrance has sign too low.	B. (4.6.4), (4.30). Modify as required.
	C. Accessible space on N.E. row is without access aisles.	C. (4.6.3). Modify as required.
	D. Accessible space on N.E. row does not provide shortest accessible route of travel from adjacent parking to an accessible entrance.	D. (4.6.2). Modify as required.
Assembly Areas (Bleachers)	Wheelchair locations do not exist at Diamonds #1, 2, 4 and 5.	(4.33.3) See also (A4.33) (A4.33.3). Designate area.
Doors	Thresholds at three doors on Utility Building by Diamond #1 are at least 5".	(4.13.8) Employees only.

BUILDING NUMBER: 1480
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Countryside Community Park
2640 Sabal Springs

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	Counters at Utility Building by Diamond #1 are at 41".	(4.32.4) Lower section of counter.
Drinking Fountains	A. Fountain between Diamonds #1 and #2 is not accessible to walkway.	A. (4.3.2)(2) Install sidewalk.
	B. Fountain between Diamonds #1 and #2 does not provide at least 30" by 48" clear floor space, allowing a person in a wheelchair to make a parallel approach to the unit.	B. (4.15.5)(2) Install handicapped fountain.
	C. Fountain between Diamonds #1 and #2 has a spout located at rear.	C. (4.15.3) See B.
	D. Fountain between Diamonds #1 and #2 has a water flow less than 4" high.	D. (4.15.3). See B.
	E. Fountain between Diamonds #1 and #2 has water flow not within 3" of front edge of fountain.	E. (4.15.3). See B.
	F. Fountain by Basketball Court is not accessible to walkway.	F. (4.3.2)(2). Install sidewalk.
	G. Fountain by Basketball Court does not provide at least 30" by 48" clear floor space, allowing a person in a wheelchair to make a parallel approach to the unit.	G. (4.15.5)(2). Install sidewalk.

BUILDING NUMBER: 1480
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Countryside Community Park
2640 Sabal Springs

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

- | | |
|---|---------------------|
| H. Fountain by Basketball Court has spout located at rear. | H. (4.15.3). See G. |
| I. Fountain by Basketball Court has a water flow less than 4" high. | I. (4.15.3). See G. |
| J. Fountain by Basketball Court has water flow not within 3" of front edge of fountain. | J. (4.15.3). See G. |

*All restrooms closed due to fire.

BUILDING NUMBER: 1490
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Countryside Sports Complx
3080 McMullin Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Except for field with bleachers and press box, accessible routes (walkways) do not exist to fields.	(4.3.2)(2) Install sidewalks.
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility does not exist.	(4.6.2) See also (4.6.3), (4.6.4), (4.30). Modify as required.
Stairs	At press box stairway, top of handrail is 45" above stair nosings.	(4.9.4)(5) Lower handrails.
Counters	Counters at Snack Bar are 36-1/2" and 37".	(4.32.4) See also (5.2). Modify section of counter.
Telephone	Public telephone is not hearing aid compatible nor does it have a volume control.	(4.31.5) See cover sheet.
Assembly Areas (Bleachers)	Wheelchair locations do not exist at any fields.	(4.33.3) See also (A4.33.2) (A4.33.3). Designate area.
Sinks	Sinks in both men's and women's restrooms have exposed water pipes.	(4.24.6) Modify as required.
Water Closets	Grab bar behind water closet is 21" in both the men's and women's restrooms.	(4.16.4) Install grab bars.
Toilet Stalls	There is no stall in men's or women's restrooms that is accessible.	(4.17.3) Also (4.22.4). Modify as required.
Doors	Thresholds of doors on Service Building exceed 1/2".	(4.13.8) Employees only.
Drinking Fountain	Spout outlet is 40" from the ground surface.	(4.15.2) Install handicapped fountain.

BUILDING NUMBER: 1500
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Crest Lake Park
201 Glenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	One accessible space should exist close to Playground.	(4.6.2),(4.6.3),(4.6.4). Modify as required.
Accessible Route	A. Does not exist from Parking to walkway by Playground.	A. (4.3.2)(2). Install sidewalk.
	B. Surface of Playground is sand, thus Playground is not accessible.	B. (4.3.6). N/A. Alters original intent of facility.
	C. Does not exist to a designated Picnic Table (by Playground).	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist to Water Fountain by Playground.	D. (4.3.2)(2). Install sidewalk.
	E. Does not exist to "PAR" exercise elements.	E. (4.3.2)(2). Install sidewalk.
	F. Does not exist from walkway to Rest Room entrance.	F. (4.3.2)(2). Install sidewalk.
	G. Does not exist to a designated Picnic Table by Rest Rooms.	G. (4.3.2)(2). Designate table by Playground as Handicapped.
	H. Does not exist to Men's portable toilets. (Men's Rest Rooms are closed).	H. (4.3.2)(2). Install sidewalk.
Water Fountains	A. Fountain by Playground has spout located at rear.	A. (4.15.3). Install Handicapped fountain.
	B. Fountain by Playground has water flow less than 4" high.	B. (4.15.3). See A.
	C. Fountain by Playground does not provide proper clear floor space.	C. (4.15.5)(2). See A.
	D. Fountain by Playground has water flow not within 3" of front edge of fountain.	D. (4.15.3). See A.

BUILDING NUMBER: 1500
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Crest Lake Park
201 Glenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	E. Fountain by Rest Rooms does not provide proper clear floor space.	E. (4.15.5)(2). See A.
	F. Foutain by Rest Rooms does not provide water flow greater than 4" high.	F. (4.15.3). See A.
Toilet Stalls	A. There are no stalls in Women's Rest Room that are accessible with proper clear floor space.	A. (4.17.3). Also (4.22.4). Modify as required.
	B. Toilet stall doors in Women's Rest Room do not provide a minimum clear opening of 32".	B. (4.17.5). Also (4.13.5). Modify as required.
Water/Closets	A. Grab bars do not exist behind or on the side of toilets in Women's Rest Rooms.	A. (4.17.6). Install grab bars.
Lavatories	A. Sinks in Women's Rest Rooms have exposed water pipes.	A. (4.24.6). Modify as required.
	B. Paper towel dispenser is 61" from floor.	B. (4.2.5). Lower dispenser.
Men's Rest Room	Men's Rest Room is closed.	

BUILDING NUMBER: 1510
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Cultural Arts Building
1776 Drew Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking space designated by a sign showing the symbol of accessibility, does not exist.	(4.6.2). Also (4.6.3), (4.6.4), (4.30). Modify as required.
Accessible Route	Does not exist from side (East) door to walkway leading to street or parking.	(4.3.2)(1), (4.3.2)(2). Staff only.
Ramps	Handrail on Ramp at main entrance is 27-1/2" high.	(4.8.5)(5). Raise handrail.
Drinking Fountains	A. Spout is 42-1/2" from floor.	A. (4.15.2). Staff only.
	B. Clear knee space and a minimum clear floor space is not provided.	B. (4.15.5)(1). See A.
Sinks	Kitchen sink does not provide knee clearance.	(4.24.3). Staff only.
Counters	Kitchen counters are 36-1/2" high.	(4.32.4). Staff only.
Doors	A. Doorways throughout building, including doors to Rest Rooms, do not provide a minimum clear opening of 32" when open 90 degrees.	A. (4.13.5). Staff only.
	B. Doorway to back office has a threshold greater than 1/2".	B. (4.13.8). Staff only.
	C. Doorway on East side of building has a threshold greater than 1/2", an 8" step and a 4-1/2" step leading to walkway.	C. (4.13.8). Staff only.
	D. Doorway to Compressor Room has a 4-1/2" step.	D. (4.13.8). Staff only.
	E. Step to hall leading to Rest Room has a 4-1/2" height.	E. (4.13.8). Staff only.

BUILDING NUMBER: 1510
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Cultural Arts Building
1776 Drew Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Toilet stall is not accessible, with 54" x 33" measurement.	A. (4.17.3). Staff only.
	B. Stall door is 19" wide.	B. (4.17.5), (4.13.5). See A.
	C. Grab bars do not exist in any Rest Room.	C. (4.17.6). Staff only.
Water Closets	A. Clear floor space in front of toilet by Compressor Room is not provided.	A. (4.16.2). Staff only.
	B. Toilet height on all toilets is too low.	B. (4.16.3). Staff only.
Lavatories and Mirrors	A. Mirrors in Rest Rooms are 46-1/2" high.	A. (4.19.6). Staff only.
	B. Sinks in both Rest Rooms have exposed hot water pipes.	B. (4.19.4). Staff only.
Shower Stalls	A. None of the shower stalls are accessible. Current size is 34-1/2" x 30".	A. (4.21.2). Staff only.
	B. Seat in stall is not provided.	B. (4.21.3). See A.
	C. Controls to showers are 41" high.	C. (4.21.5). See A.
	D. Shower heads are 65" from the floor.	D. (4.21.6). See A.
	E. Curb in shower stalls is 7-1/2" high, allowing no wheelchair access.	E. (4.21.7). See A.

BUILDING NUMBER: 1520
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: David Martin Soccer Field
1345 Court Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist.	(4 . 6 . 2) A l s o (4.6.3), (4.6.4), (4.30). Modify as required.
Accessible Route	Does not exist from walkway to Soccer Fields.	(4.3.2)(2). Install sidewalk.
Assembly Areas	Wheelchair locations do not exist at either Soccer Field.	(4.33.3). Also (A4.33), (A4.33.3). Designate area.
Drinking Fountain	A. Fountain is not accessible to a walkway.	A. (4.3.2)(2). Install Handicapped fountain.
	B. Fountain does not provide at least 30" x 48" clear floor space, allowing a person in a wheelchair to make a parallel approach to the unit.	B. (4.15.5)(2). See A.
	C. Fountain's spout is at rear.	C. (4.15.3). See A.
	D. Fountain has a water flow less than 4" high.	D. (4.15.3). See A.
	E. Fountain has water flow not within 3" of front edge of fountain.	E. (4.15.3). See A.

BUILDING NUMBER: 1525
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Cypress Point Park
Cypress Point Drive, West

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	<p>A. Does not exist from sidewalk to walkway.</p> <p>B. Does not exist from walkway to Playground.</p> <p>C. Does not exist from walkway to at least one Picnic Bench.</p>	<p>A. (4.3.2) Install sidewalk.</p> <p>B. (4.3.2)(2) Install sidewalk.</p> <p>C. (4.3.2)(2). See also (4.2.4.1). Install sidewalk.</p>

BUILDING NUMBER: 1540
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Del Oro Park
401 N. McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible Parking Spaces designated by a sign showing the symbol of accessibility, do not exist.	(4.6.2). See also (4.6.3), (4.6.4), (4.30). Modify as required.
Accessible Route	A. Does not exist from walkway to Basketball Courts.	A. (4.3.2)(2). Install sidewalk.
	B. Does not exist from walkway to Fitness Court.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist from walkway to Playground elements.	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist from walkway to Picnic Shelter.	D. (4.3.2)(2). Install sidewalk.
	E. Does not exist from walkway to Horseshoe Area.	E. (4.3.2)(2). Install sidewalk.
	F. With barrier wall, accessible route does not exist to Men's Rest Room.	F. (4.3.2)(2). Modify as required.
Ground/Floor Surface	Surface of Fitness Court is woodchips, making wheelchair accessibility impossible.	(4.5.1). N/A. Alters original intent of facility.
Toilet Stalls	A. There is no stall in Men's or Women's Rest Rooms that is accessible.	A. (4.17.3). Also (4.22.4). Modify as required.
	B. Grab bars do not exist in any stall in Men's or Women's Rest Rooms.	B. (4.17.6). Install grab bars.
Water Closet	A. Height of toilets in both Men's and Women's Rest Rooms is 16" from floor.	A. (4.16.3). Replace toilets.
Doors	A. Threshold at doorway to Men's and Women's Rest Rooms is 1-1/2".	A. (4.13.8). Install ramp.
	B. Threshold at doorway to fountain is 1-1/2".	B. (4.13.8). Install ramp.

BUILDING NUMBER: 1540
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Del Oro Park
401 N. McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	C. Minimum maneuvering clearance at Men's Rest Room door is not provided.	C. (4.13.6). Modify as required.
	A. Sinks in both Men's and Women's Rest Rooms have exposed water pipes.	A. (4.24.6). Modify as required.
	B. Knee clearance is only 14" wide underneath sinks in both Men's and Women's Rest Rooms.	B. (4.24.3). Modify as required.
Drinking Fountain	A. Fountain's spout is 44", measured from the floor to the spout outlet.	A. (4.15.2). Install Handicapped fountain.
	B. Proper clear knee space is not provided.	B. (4.15.5)(1). See A.
Assembly Area (Bleachers)	A. Wheelchair locations do not exist by bleachers.	A. (4.33.3). Designate area.
	B. Walkway does not exist to bleachers.	B. (4.3.2)(2). Install sidewalk.

BUILDING NUMBER: 1560
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./East Plant
3141 Gulf-To-Bay Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Two accessible spaces exist, with signage too low.	NOTE: No Public access; employees only. (4.6.4).
Accessible Route	Does not exist to second floor offices for a person in a wheelchair; (ramp needed).	(4.3.2)(2).
Stairs	A. Outside stairway from Administration by Main Entrance, does not have handrails.	A. (4.9.4)(1).
	B. Stairs in Lobby (first floor) have handrails on only one side.	B. (4.9.4)(1).
	C. Handrails on stairway from East double doors are not continuous proper height.	C. (4.9.4)(5).
	D. Handrails on stairway from East double doors have handrails on only one side.	D. (4.9.4)(1).
Doors	A. Main front door has threshold exceeding 1/2", and does not provide 32" wide opening.	A. (4.13.8)&(4.13.5).
	B. Threshold at double doors in main hallway (East side), exceeds 1/2".	B. (4.13.8).
Sinks	A. Kitchen sink in Lounge does not provide proper knee clearance.	A. (4.24.3).
	B. Sinks in Laboratory do not provide proper knee clearance.	B. (4.24.3).

BUILDING NUMBER: 1560
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./East Plant
3141 Gulf-To-Bay Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountains	Fountain in hallway does not provide proper knee clearance, and has spout too high above floor.	(4.15.5)(1)&(4.15.2).
Tables	Computer tables in Labs and Offices do not allow proper knee clearance.	(4.32.4).
Water Closets	Toilets in Men's and Women's Rest Rooms are not the proper height.	(4.16.3).
Toilet Stalls	A. There is no stall in Men's or Women's Rest Rooms that is the proper size and arrangement. B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening. C. Grab bars do not exist in stalls in Men's and Women's Rest Rooms.	A. (4.17.3). B. (4.17.5). C. (4.17.6).
Urinals	Urinals in Men's Rest Room have rims too high above floor.	(4.18.2).
Lavatories	Exposed pipes exist underneath sinks in Men's and Women's Rest Rooms.	(4.19.4).
Shower Stalls	A. Curbs exist at entrances to Men's and Women's stalls. B. Proper seat is not provided in any Men's and Women's stalls.	A. (4.21.7). B. (4.21.3).

BUILDING NUMBER: 1560
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./East Plant
3141 Gulf-To-Bay Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	C. Proper shower spray unit is not provided in any stalls in Men's and Women's Rest Rooms.	C. (4.21.6).
	D. No stall in Men's or Women's Rest Rooms is the proper size with clear floor space; (stalls are 30"x31").	D. (4.21.2).

BUILDING NUMBER: 1600
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ed Wright Park
1300 South Greenwood

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces designated by signs showing the symbol of accessibility, do not exist. (Should be close to Rest Rooms and Horseshoe Club.)	(4.6.2), (4.6.3), (4.6.4). Modify as required.
Accessible Route	A. Does not exist from driveway or walkway to designated Picnic Shelter and Grill.	A. (4.3.2)(2). Install sidewalk.
	B. Does not exist from driveway or walkway to Playground elements.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist from walkway to Drinking Fountain, (by Rest Rooms).	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist from walkway to Rest Rooms.	D. (4.3.2)(2). Install sidewalk.
	E. Does not exist from walkway to Shuffleboard Courts.	E. (4.3.2)(2). Install sidewalk.
	F. Does not exist from walkway to Horseshoe Club. (Also walkway should connect Parking by the Tennis Courts.	F. (4.3.2)(2). Also (4.3.2)(1). Install sidewalk.
	G. Does not exist from walkway to a designated Horseshoe Pit.	G. (4.3.2)(2). Install sidewalk.
Water Fountains	A. Fountain by Rest Rooms does not provide proper clear floor space that allows a person in a wheelchair to make a parallel approach to the unit.	A. (4.15.5)(2). Install Handicapped fountain.
	B. Fountain by Rest Rooms does not have water flow at least 4" high.	B. (4.15.3). Install Handicapped fountain.

BUILDING NUMBER: 1600
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ed Wright Park
1300 South Greenwood

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Fountain by Horseshoe Club directs water flow towards rear of fountain.	C. (4.15.3). Install Handicapped fountain.
	D. Fountain by Horseshoe Club does not provide proper clear floor space that allows a person in a wheelchair to make a parallel approach to the unit.	D. (4.15.5)(2). Install Handicapped fountain.
Doors	A. Threshold at doorways to Rest Rooms is 1" high.	A. (4.13.8). Modify as required.
	B. 3" step exists at entrance to Rest Rooms.	B. (4.13.8). Also (4.5.2). Install ramp.
	C. Doorways to Men's and Women's Rest Rooms have a clear opening of 28".	C. (4.13.5). Modify as required.
Water Closets	A. Grab bars do not exist behind and on the side of toilets in Men's or Women's Rest Rooms.	A. (4.17.6). Install grab bars.
	B. Toilet paper dispensers in all stalls of Men's and Women's Rest Rooms are too high.	B. (4.16.6). Lower dispensers.
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are accessible with proper clear floor space.	A. (4.17.3). Also (4.22.4). Renovate bathrooms; Unisex, with door locks.
	B. Toilet stall doors in Men's (28-3/4"), and Women's (29"/27"), Rest Rooms do not provide a minimum clear opening of 32".	B. (4.17.5). Also (4.13.5). Renovate bathrooms; Unisex, with door locks.

BUILDING NUMBER: 1600
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ed Wright Park
1300 South Greenwood

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	A. Sinks in Men's and Women's Rest Rooms have exposed water pipes.	A. (4.24.6). Renovate bathrooms; Unisex, with door locks.
	B. Doorway leading to sink does not provide a minimum clear opening of 32".	B. (4.13.5). Renovate bathrooms; Unisex, with door locks.
Assembly Area (Bleachers)	Wheelchair location does not exist at Bleachers by Horseshoe Club.	(4.33.3). Also (A4.33) & (A4.33.3). Designate wheelchair area.

BUILDING NUMBER: 1610
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Eddie C. Moore Complex
200 N. McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	A. Three accessible spaces exist, but signage is too low by entrance to Baseball Fields.	A. (4.6.4). Modify as required.
	B. Accessible parking spaces designated by signs showing the symbol of accessibility does not exist close to Soccer Fields.	B. (4.6.2). Also (4.6.3), (4.6.4), (4.30). Modify as required.
Accessible Route	A. Does not exist from walkway to designated accessible Picnic Bench by Ballfields.	A. (4.3.2)(2). Relocate picnic table.
	B. Does not exist from walkway to designated accessible Picnic Bench by One Charger Place.	B. (4.3.2)(2). Relocate picnic table.
	C. Does not exist from parking to accessible walkway leading to Soccer Fields.	C. (4.3.2)(1). Install sidewalk.
	D. Does not exist from walkway to Drinking Fountains by One Charger Place. (Soccer Fields).	D. (4.3.2)(2). Install sidewalk.
	E. Does not exist from an accessible walkway to Drinking Fountain between Ballfields #2 and #3.	E. (4.3.2)(2). Install sidewalk.
	F. Does not exist from an accessible walkway to Drinking Fountain between Ballfields #1 and #2.	F. (4.3.2)(2). Install sidewalk.
Drinking Fountains	A. Fountains around Soccer Fields do not provide proper clear space that allows a person in a wheelchair to make a parallel approach to the units.	A. (4.15.5)(2). Install Handicapped fountain.
	B. Fountains around Soccer Fields have spouts located at rear.	B. (4.15.3). Install Handicap fountain.

BUILDING NUMBER: 1610
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Eddie C. Moore Complex
200 N. McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Fountains around Soccer Fields have water flow less than 4" high.	C. (4.15.3). Install Handicapped fountain.
	D. Fountains around Soccer Fields have water flow not within 3" of front edge of fountain.	D. (4.15.3). Install Handicapped fountain.
	E. Fountains around Soccer Fields have spouts higher than 36", measured from the ground to the spout outlet.	E. (4.15.2). Install Handicapped fountain.
	F. Fountain by Ballfields #3 and #4, Fountain by Ballfields #2 and #3, and Fountain by Ballfield #1 and #2, do not provide at least 30" x 48" clear floor space (due to 5" step), allowing a person in a wheelchair to make a parallel approach to the unit.	F. (4.15.5)(2). Install Handicapped fountain.
	G. Fountain by Ballfields #2 and #3, Fountain by Ballfields #3 and #4, Fountain by Ballfields #1 and #2, and Fountain by Ballfields #1 and #4, have spouts located at rear.	G. (4.15.3). Install Handicapped fountain.
	H. Fountain by Ballfields #3 and #4, Fountain by Ballfields #2 and #3, and Fountain by Ballfields #1 and #2, have water flow less than 4" high.	H. (4.15.3). Install Handicapped fountain.
	I. Fountain by Ballfields #3 and #4, Fountain by Ballfields #2 and #3, and Fountain by Ballfields #1 and #2, have water flow not within 3" of front edge of fountain.	I. (4.15.3). Install Handicapped fountain.

BUILDING NUMBER: 1610
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Eddie C. Moore Complex
200 N. McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Assembly (Bleachers)	Areas Wheelchair locations do not exist at three Soccer Fields or four Ballfields.	(4.33.3). Also (A4.33)&(A4.33.3). Designate area.
Counters	A. Counters at One Charger Place are 42-1/4" high.	A. (4.32.4). Modify section of counter.
	B. Counters at Baseball Concession Stand are 42-1/2" high.	B. (4.32.4). Modify section of counter.
Doors	A. Thresholds at doors of One Charger Place are 1-1/2".	A. (4.13.8). Staff only.
	B. Thresholds at doorways of Baseball Building have 3-1/2" step.	B. (4.13.8). Staff only.
Baseball Tables	Scorer 8" step at Ballfields 1,2,3, & 4 Scorer Tables makes accessibility for a person in a wheelchair impossible.	(4.2.4.1), (4.3.2)(2). S
Telephone	A. Phone at Baseball Building has highest operable part at 62".	A. (4.31.3). See Cover Sheet.
	B. Volume controls do not exist on phone at Baseball Building.	B. (4.31.5)(2). See Cover Sheet.
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms at One Charger Place that are accessible.	A. (4.17.3), (4.22.4). Modify as required.
	B. There are no stalls in Men's or Women's Rest Rooms at Baseball Building that are accessible.	B. (4.17.3), (4.22.4). Modify as required.
	C. Grab bars do not exist behind toilets in Men's or Women's Rest Rooms at One Charger Place.	C. (4.17.6). Install grab bars.

BUILDING NUMBER: 1610
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Eddie C. Moore Complex
200 N. McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	D. Grab bars in Men's and Women's Rest Rooms at One Charger Place not long enough on side wall and begin more than 12" from back wall.	D. (4.17.6) (Figure 29). Reposition grab bars.
	E. Grab bar behind toilets in Men's and Women's Rest Rooms at Baseball Building is not long enough at 21".	E. (4.17.6) (Figure 29). Install grab bar.
Water Closet	A. Height of toilet in Men's Room of Baseball Building is 19-1/2" high.	A. (4.16.3). Modify as required.
Mirrors	Mirrors in both Men's and Women's Rest Rooms at Baseball Building are 58-1/2" from floor to bottom edge of mirror.	(4.19.6). Lower mirrors.
Paper Towel Dispenser	Dispenser is 62" from floor in Men's Rest Room and 61" from floor in Women's Rest Room at Baseball Building.	(4.2.5). Lower dispensers.
Sinks	A. Sinks in Men's and Women's Rest Rooms at Baseball Building have exposed water pipes.	A. (4.24.6). Modify as required.
	B. Knee clearance is 24-1/2" high underneath sinks at Baseball Building Rest Rooms.	B. (4.24.4). Modify as required.

BUILDING NUMBER: 1620
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ervin's Youth Center
1250 Holt Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist at the Center or on street by Tennis Courts, Playground, or Basketball Courts.	(4.6.2). Modify as required.
Accessible Route	A. Does not exist from Martin Luther King Ave. sidewalk to walkway leading into Tennis Courts.	A. (4.3.2)(2). Install sidewalk.
	B. Does not exist to an accessible Horseshoe Pit.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist to Shuffleboard Court.	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist to Playground elements.	D. (4.3.2)(2). Install sidewalk.
	E. Does not exist to either Basketball Courts.	E. (4.3.2)(2). Install sidewalk.
	F. Does not exist to Drinking Fountains by Tennis or Basketball Courts.	F. (4.3.2)(2). Install sidewalk.
	G. Does not exist to an accessible Picnic Table (on the side of Center).	G. (4.3.2)(2). Install sidewalk.
Ground Surfaces	A. Surface of Playground is made of woodchips.	A. (4.5.1) N/A, Alters original intent of the area.
	B. Surface of Fitness Court is name of sand.	B. (4.5.1). See A.
	C. Surface of Volleyball Court is made of sand. A Volleyball Court made of concrete does not exist.	C. (4.5.1). See A.

BUILDING NUMBER: 1620
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ervin's Youth Center
1250 Holt Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Drinking Fountains	A. Fountain by Tennis and Basketball Courts does not provide proper clear floor space.	A. (4.15.5)(2) Install Handicapped fountain.
	B. Fountain by Tennis and Basketball Courts does not provide proper clear floor space.	B. (4.15.3). See A.
	C. Fountain by Tennis and Basketball Courts has water flow not within 3" of front of fountain.	C. (4.15.3). See A.
	D. Fountain by Tennis and Basketball Courts has water flow less than 4" high.	D. (4.15.3). See A.
	E. Fountain in Main Room of Center does not provide proper knee clearance.	E. (4.15.5)(1). Handicapped fountain located in weight room.
	F. Fountain in Main Room of Center has a spout 42" from floor.	F. (4.15.2). See E.
	G. Fountain in Weight Room has a spout 39-1/2" from floor.	G. (4.15.2). Install Handicapped fountain.
	H. Fountain in Weight Room does not provide proper knee clearance.	H. (4.15.5)(1). See G.
	I. Fountain in Weight Room does not provide proper clear floor space.	I. (4.15.5)(1). See G.
	J. Fountain in Weight Room has water flow less than 4" high.	J. (4.15.3). See G.
Doors	A. Threshold at Main Entrance doorway exceeds 1/2".	A. (4.13.8). Install ramp.
	B. Threshold at rear doorway exceeds 1/2".	B. (4.13.8). Employees only.
	C. Doorway to room housing stereo equipment is 27" wide.	C. (4.13.5) Employees only.

BUILDING NUMBER: 1620
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ervin's Youth Center
1250 Holt Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	A. Counter on door to room housing stereo equipment is 43" from the floor.	A. (4.32.4) Employees only.
	B. Counters in Kitchen and outside of Kitchen in Main Room are 47" high.	B. (4.32.4). Employees only.
	C. Counter on door to Kitchen is 41" high.	C. (4.32.4). Employees only.
Sinks	A. Kitchen sink does not provide proper knee clearance.	A. (4.24.3) Employees only.
	B. Utility sink in Main Room does not provide proper knee clearance.	B. (4.24.3). Employees only.
Doors	Door to Kitchen does not have proper clear opening (26" wide).	(4.13.5) Employees only.
Rest Rooms	Rest Room off of Weight Room is accessible except that sign exists on door stating that Rest Room is for employees only. Accessible signage should be on door.	(4.30). Install sign.
Water Closets	Accessible Rest Room by Weight Room has no grab bars behind toilet.	(4.16.4). Install grab bars.
Lavatories	A. Accessible Rest Room by Weight Room has exposed water pipes underneath sink.	A. (4.19.4). Modify as required.
	B. Sink does not provide proper knee clearance underneath it.	B. (4.19.2). Modify as required.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	No accessible space with proper signage exists.	(4.6.2), (4.6.3), (4.6.4). Modify as required.
Curb Ramps	A. Does not exist where main South side door walkway and Department parking meet.	A. (4.7.1). Employees only.
	B. Does not exist at main South side door threshold.	B. (4.7.1). Also (4.13.6). Employees only.
	C. Does not exist where North side parking lot and walkway to Administration meet.	C. (4.7.1). Install curb ramp.
	D. Does not exist at Administration double door threshold.	D. (4.7.1). Also (4.13.6). Install curb ramp.
	E. Does not exist at West side door threshold off walkway to Administration (6" step).	E. (4.7.1). Also (4.13.6). Install ramp.
	F. Curb ramp at South sidewalk and driveway of Truck Bay has 1-1/2" level change.	F. (4.7.4). Also (4.5). Employees only.
	G. Does not exist where North sidewalk from Administration meets North driveway by Truck Bay doors.	G. (4.7.1). Employees only.
	H. Does not exist anywhere along Truck Bay where a curb exists all along Bay.	H. (4.7.1). Employees only.
	I. Does not exist at Northeast door by North Truck Bay side.	I. (4.7.1). Also (4.13.6). Employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramps	J. Does not exist at Southwest door by South Truck Bay side.	J. (4.7.1). Also (4.13.6). Employees only.
Accessible Route	A. Second floor is not accessible to persons in wheelchairs. Only a stairway exists to second floor.	A. (4.3.2)(2). Employees only.
	B. Does not exist to Picnic Table by West side Administration door.	B. (4.3.2)(2). Employees only.
	C. Northwest door to walkway by Truck Bay has a slope too great at door and does not provide minimum maneuvering clearance.	C. (4.3.7). Also (4.13.6). Employees only.
	D. Does not exist from East side outside stairs to street sidewalk or parking.	D. (4.3.2)(2). Employees only.
	E. Passage between sink area and stalls in Women's Administration Rest Room does not provide 36" minimum clear width.	E. (4.3.3). Modify as required.
Doors	A. Door at top of East side stairway has threshold exceeding 1/2".	A. (4.13.8). Employees only.
	B. Southwest door by Truck Bay does not provide 32" wide opening, and has threshold exceeding 1/2".	B. (4.13.5)&(4.13.8). Employees only.
	C. Lieutenant's Office door by Truck Bay does not provide 32" wide opening and has a threshold exceeding 1/2".	C. (4.13.5)&(4.13.8). Employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	D. Deputy Chief's door by Truck Bay does not provide 32" wide opening, and has threshold exceeding 1/2".	D. (4.13.5)&(4.13.8). Employees only.
	E. Deputy Chief's inside doorway to Dorm does not provide 32" wide opening.	F. (4.13.5). Employees only.
	F. Threshold at door from Truck Bay to Administration has threshold exceeding 1/2".	F. (4.13.8). Employees only.
	G. Men's and Women's Administration Rest Room doors do not provide 32" wide opening.	G. (4.13.5). Modify as required.
	H. Door off stairs (leading to roof) has threshold greater than 1/2"/	H. (4.13.8). Employees only.
	I. Door off stairs (leading to roof) has opening force that exceeds 5 LBF.	I. (4.13.11). Employees only.
	J. Doors at top of inside stairways have opening force exceeding 5 LBF.	J. (4.13.11). Employees only.
	K. Stairway door by Classrooms does not provide 32" wide opening.	K. (4.13.5). Employees only.
	L. Doorway to single bed Dorm does not provide 32" wide opening.	L. (4.13.5). Employees only.
	M. Door to single toilet Rest Room off hall by Dorms does not provide 32" wide opening.	M. (4.13.5). Employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	N. Door to toilet room in single toilet Rest Room off hall by Dorms does not provide 32" wide opening.	N. (4.13.5). Employees only.
	O. Door to Rest Room off second floor main hallway has opening force exceeding 5 LBF.	O. (4.13.11). Employees only.
	P. Three pantry doors off Kitchen do not provide 32" wide opening.	P. (4.13.5). Employees only.
	Q. Doors to Men's and Women's Truck Bay Rest Rooms do not provide 32" wide opening.	Q. (4.13.5). Employees only.
Stairs	East outside stairway has handrail on only one side.	(4.9.4). Employees only.
Drinking Fountains	A. Spouts on fountains in Truck Bay, Administration, and in second floor hallway, have spouts too high above floor.	A. (4.15.2). Install paper cup dispenser at Administration fountain only. Others, employees only.
	B. Clear floor space is not provided at Administration and second floor hallway Rest Rooms.	B. (4.15.5)(1). Modify Administration only. Other, employees only.
	C. Proper knee clearance is not provided at fountain in Truck Bay.	C. (4.15.5)(2). Employees only.
	D. Water flow is directed toward rear of fountain at Administration, Truck Bay, and second floor hallway fountains.	D. (4.15.3). See A. Administration only. Others, employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counter/Tables	Computer Table/Counter in Lieutenant's Office does not provide proper knee clearance.	(4.32.4). Employees only.
Sinks	<p>A. Sinks in Men's and Women's Truck Bay Rest Rooms, and in second floor hallway Rest Room, do not provide proper clear floor space, nor proper knee clearance.</p> <p>B. Sinks in Men's and Women's Administration Rest Rooms, Cleaning Supply Storage Room at Truck Bay, Utility Room by second floor hallway Rest Room/Shower, and in the second floor kitchen (2 sinks), do not provide proper knee clearance.</p> <p>C. Exposed pipes exist underneath sinks in the Men's and Women's Truck Bay Rest Rooms.</p> <p>D. Sink in single toilet Rest Room off hallway leading to Dorms does not provide proper knee clearance.</p>	<p>A. (4.24.5)&(4.24.3). Employees only.</p> <p>B. (4.24.3). Modify Administration Rest Room only. Others, employees only.</p> <p>C. (4.24.6). Employees only.</p> <p>D. (4.24.3). Employees only.</p>
Water Closets	Toilets in Men's and Women's Truck Bay Rest Rooms, Men's and Women's Administration Rest Rooms, second floor hallway Rest Room, and second floor single toilet Rest Room off hallway to Dorms, are not the proper height.	(4.16.3). Replace toilets in Administration only. Others, employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>A. Stall doors do not provide 32" wide opening in Men's and Women's Administration Rest Rooms, Men's and Women's Truck Bay Rest Rooms, and in second floor hallway Rest Room toilet stalls and shower stalls; also stall shower doors in single toilet Rest Room in hall to Dorms.</p> <p>B. There are no stalls in Men's and Women's Truck Bay Rest Rooms, Administration Men's and Women's Rest Rooms, and in second floor main hallway Rest Room, that are the proper size and arrangement.</p> <p>C. Grab bars do not exist in Men's and Women's Truck Bay Rest Rooms, Men's and Women's Administration Rest Rooms, main hallway second floor Rest Rooms, and in single toilet Rest Room off the hallway to Dorms.</p>	<p>A. (4.13.5)&(4.17.5). Modify Administration Rest Room only. Others, employees only.</p> <p>B. (4.17.3). See A.</p> <p>C. (4.17.6). See A.</p>
Mirrors	<p>Mirrors in Men's and Women's Truck Bay Rest Rooms are too high above the floor.</p>	(4.19.6). Employees only.
Urinals	<p>Urinals in Men's Truck Bay Rest Room, Administration Rest Room, and the four in the second floor main hallway Rest Room, have rims too high above floor.</p>	(4.18.2). Replace urinal in Administration Rest Room only. Others, employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Dispensers	Dispensers in Men's and Women's Administration Rest Rooms are too high above ground.	(4.23.7). Lower dispensers.
Shower Stalls	A. There are no shower stalls with the proper size and clearances in the showers in the second floor main hallway Rest Room, or in the single toilet Rest Room off the hallway to Dorms.	A. (4.21.2). Employees only.
	B. Curbs exist in shower stalls in second floor main hallway Rest Room, and in single toilet Rest Room off hallway to Dorms.	B. (4.21.7). Employees only.
	C. A proper shower spray unit is not provided in any shower stalls in second floor hallway Rest Room, or in single toilet Rest Room off hallway to Dorms.	C. (4.21.6). Employees only.
	D. Proper seat is not provided in any stalls of second floor hallway Rest Room, or in the single toilet Rest Room off hallway to Dorms.	D. (4.21.3). Employees only.
	E. Grab bars do not exist in any stalls of second floor hallway Rest Room, or in single toilet Rest Room off hallway to Dorms.	E. (4.21.4). Employees only.

BUILDING NUMBER: 1705
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Maint. Bldg.
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramps	A. Does not exist at South side doorway at threshold.	NOTE: No Public access; employees only. A. (4.7.1).
	B. Does not exist at walkway to South side doorway.	B. (4.7.1).
	C. Does not exist where North side Department parking connects with East-West walkway to Main Entrance.	C. (4.7.1).
Accessible Route	Sidewalk at South side of Maintenance Building does not provide 36" minimum clear width.	(4.3.3).
Doors	A. Threshold exceeds 1/2" on North side Maintenance door by Garage doors.	A. (4.13.8).
	B. Three doors on West side of Maintenance Building (double door) have 6" step and need proper curb ramp.	B. (4.7.1).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Rear West side door does not provide 32" wide opening.	NOTE: No Public access; employees only. A. (4.13.5).
	B. North side door does not provide 32" wide opening.	B. (4.13.5).
	C. North side double doors have floor level changes (step), and threshold greater than 1/2".	C. (4.13.8).
	D. Front door (Mandalay Avenue) has floor level changes (step), and threshold greater than 1/2".	D. (4.13.8).
	E. Thirteen inside doors throughout building do not provide 32" wide opening.	E. (4.13.5).
	F. Doorway to Employee Rest Room does not provide 32" wide opening.	F. (4.13.5).
	G. Floor level change (step) exists at Men's and Women's Rest Rooms by Truck Bay.	G. (4.13.8).
	H. Doors to Men's and Women's Rest Rooms by Truck Bay do not provide 32" wide opening.	H. (4.13.5).
	I. Utility Room by Truck Bay has a floor level change (step) and needs curb ramp.	I. (4.13.8).
	J. East side door has level change (step) at threshold and needs curb ramp.	J. (4.13.8).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	K. Door off Kitchen has threshold greater than 1/2", and does not provide proper 32" wide opening.	K. (4.13.8). Also (4.13.5).
	L. Rear West side door has two level changes (steps) and needs proper curb ramp.	L. (4.13.8).
	M. North side door has level change (step) and needs proper curb ramp.	M. (4.13.8).
	N. At front door (Mandalay) where walkway and porch meet, there is a level change (step) that needs curb ramp.	N. (4.13.8).
	O. Thresholds at some inside doorways exceed 1/2".	O. (4.13.8).
Stairs	A. Outside South stairway has open risers.	A. (4.9.2).
	B. Handrails on inside stairway are not the proper height and are not on both sides of stairs.	B. (4.9.4)(1-7).
Curb Ramp	Curbs exist on both sides of Truck Bay, making offices, etc., inaccessible. Proper curb ramps are needed.	(4.7.1). Also (4.3.2)(2).
Sinks	A. Sink in Employee Rest Room does not provide proper clear floor space.	A. (4.24.5).
	B. Sink in Employee Shower does not provide proper clear floor space.	B. (4.24.5).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	C. Sink in Men's Rest Room by Truck Bay does not provide proper clear floor space.	C. (4.24.5).
	D. Sink in Kitchen does not provide proper knee clearance.	D. (4.24.3).
Counters	Counters throughout Kitchen are not between 28" and 34" above floor.	(4.32.4).
Ground Surfaces	Walkway on North side of building is uneven.	(4.5.1).
Drinking Fountains	A. Two drinking fountains exist in Truck Bay and both have spouts too high from floor.	A. (4.15.2).
	B. Fountains have water flow less than 4" high.	B. (4.15.3).
	C. Fountains do not provide proper knee clearance.	C. (4.15.5)(1).
Water Closets	A. Employee Rest Room does not provide proper clear floor space.	A. (4.16.2).
	B. Employee Rest Room does not provide proper grab bars; (also Shower Room).	B. (4.16.4).
	C. Toilets in Employee Rest Room and Shower Room are not the proper height.	C. (4.16.3).
	D. Toilets in Men's and Women's Rest Rooms by Truck Bay are not the proper height.	D. (4.16.3).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Men's and Women's Rest Rooms by Truck Bay are not the proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Men's and Women's Rest Rooms by Truck Bay do not provide 32" wide opening.	B. (4.17.5).
	C. Grab bars do not exist in stalls of Men's and Women's Rest Rooms by Truck Bay.	C. (4.17.6).
Lavatories and Mirrors	A. Mirrors in Men's and Women's Rest Rooms by Truck Bay, and in Employee Rest Room and Shower Room, are too high above floor.	A. (4.19.6).
	B. Exposed pipes exist underneath sinks in Men's and Women's Rest Rooms by Truck Bay, and in Employee Rest Room and Shower Room.	B. (4.19.4).
Urinal	Urinal in Men's Rest Room by Truck Bay has a rim too high above floor.	(4.18.2).
Dispensers	Towel dispensers in Men's and Women's Rest Rooms by Truck Bay are too high above floor.	(4.23.7).
Shower Stall	A. Stalls in Employee Shower Room are not the proper size with proper clearances.	A. (4.21.2).
	B. Curb exists at entrance to stalls.	B. (4.21.7).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stall	C. Proper shower spray unit is not provided in Employee Shower Room.	C. (4.21.6).
	D. Proper seat is not provided in Employee Shower Stalls.	D. (4.21.3).
Accessible Route	Does not exist in Women's Rest Room by Truck Bay, since passage to toilet does not provide proper minimum clear width.	(4.3.3).

BUILDING NUMBER: 1715
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #47
1460 Lakeview Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible space, with a sign showing the symbol of accessibility, does not exist near Entrance.	NOTE: No Public access; employees only. (4.6.3), (4.6.4), (4.62).
Curb Ramps	A. Does not exist on walkway leading to sidewalk.	A. (4.7.1).
	B. Does not exist at Main Front Door.	B. (4.7.1).
	C. Does not exist at curl between driveway and Patio.	C. (4.7.1).
	D. Does not exist at rear sliding glass doors leading to Patio.	D. (4.7.1).
	E. Does not exist anywhere along curb that runs the length of Truck Bay.	E. (4.7.1).
	F. Sidewalk by rear Truck Bay does not provide proper curb ramp.	F. (4.7.1).
Doors	A. Thresholds of two doors at Main Entrance exceed 1/2".	A. (4.13.8).
	B. Two doors of office by Main Entrance do not provide 32" wide opening.	B. (4.13.5).
	C. Door to Rest Room (blue tile) does not provide 32" wide opening.	C. (4.13.5).
	D. Two doors of Computer Room do not provide 32" wide opening.	D. (4.13.5).

BUILDING NUMBER: 1715
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #47
1460 Lakeview Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	E. Door of Lieutenant's Dorm does not provide 32" wide opening.	E. (4.13.5).
	F. Doorway to Shower/Rest Room does not provide 32" wide opening.	F. (4.13.5).
	G. Two inside doors leading to Truck Bay have thresholds exceeding 1/2".	G. (4.13.8).
	H. Rear door of Truck Bay has threshold exceeding 1/2".	H. (4.13.8).
Water Fountains	A. Fountains in hall and Truck Bay have spouts too high above floor.	A. (4.15.2).
	B. Fountain in hall does not provide proper clear floor space.	B. (4.15.5)(2).
	C. Fountain in Truck Bay does not provide proper knee clearance.	C. (4.15.5)(1).
	D. Fountain in Truck Bay has water flow not within 3" of the front edge.	D. (4.15.3).
Counter	Counter in Kitchen is too high above floor.	(4.32.4).
Sink	A. Sink in Kitchen does not provide proper knee clearance.	A. (4.24.3).
	B. Sinks in Blue Bathroom and Lieutenant's Bathroom, do not provide proper clear floor space.	B. (4.24.5).
	C. Sinks in Shower/Rest Room do not provide proper knee clearance.	C. (4.24.3).

BUILDING NUMBER: 1715
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #47
1460 Lakeview Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	With sink in present location, clear minimum width of 36" is not provided.	(4.3.3).
Water Closets	A. Toilets in Blue Rest Room, Lieutenant's Bathroom, and Shower/Rest Room, are not the proper height.	A. (4.16.3).
	B. Blue Rest Room does not provide proper clear floor space.	B. (4.16.2).
	C. Grab bars do not exist in Blue Rest Room.	C. (4.16.4).
Toilet Stalls	A. Stalls in Lieutenant's Bathroom and in Shower/Rest Room are not the proper size and arrangement.	A. (4.17.3).
	B. Grab bars do not exist in stalls of Lieutenant's Bathroom and in Shower/Rest Room.	B. (4.17.6).
	C. Stall doors in Lieutenant's Bathroom and in Shower/Rest Room do not provide 32" opening.	C. (4.17.5).
Urinals	Urinals in Lieutenant's Bathroom and in Shower/Rest Room have rims too high above floor.	(4.18.2).
Dispensers	Paper towel dispensers in Blue Rest Room, Shower/Rest Room, and Lieutenant's Bathroom, are too high above floor.	(4.23.7).

BUILDING NUMBER: 1715
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #47
1460 Lakeview Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Mirrors	Mirrors over sinks in Blue Rest Room, Shower/Rest Room, and Lieutenant's Bathroom, are too high above floor.	(4.19.6).
Shower Stalls	A. Grab bars in stalls do not exist in Shower/Rest Room or Lieutenant's Bathroom.	A. (4.21.4).
	B. Curb exists at entrance to stalls in Shower/Rest Room and Lieutenant's Bathroom.	B. (4.21.7).
	C. Proper seat is not provided in Lieutenant's Bathroom and Shower/Rest Room stalls.	C. (4.21.3).
	D. Proper shower spray unit is not provided in stall of Lieutenant's Bathroom.	D. (4.21.6).

BUILDING NUMBER: 1720
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48/Training Bldg.
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space, with a sign showing the symbol of accessibility, does not exist.	(4.6.3), (4.6.4) & (4.6.2). Modify as required.
Curb Ramps	<p>A. Does not exist where walkway to entrance connects to parking.</p> <p>B. Does not exist at front double doors.</p> <p>C. Does not exist at two rear doors.</p>	<p>A. (4.7.1). Install curb ramp.</p> <p>B. (4.7.1). Install curb ramp.</p> <p>C. (4.7.1). Employees only.</p>
Ramps	<p>A. Sidewalk ramp at East office door has a slope too great.</p> <p>B. Handrails do not exist on sidewalk ramp at East office door.</p>	<p>A. (4.8.2). Employees only.</p> <p>B. (4.8.5). Employees only.</p>
Water Fountain	<p>A. Fountain has spout too high above floor.</p> <p>B. Clear floor space is not provided in front of fountain.</p>	<p>A. (4.15.2). Install paper cup dispensers.</p> <p>B. (4.15.5)(2). See A.</p>
Accessible Route	<p>A. With lockers in present location, minimum clear width is not provided into Women's Rest Room.</p> <p>B. Rear door off Meeting Room does not connect to accessible walkway.</p>	<p>A. (4.3.3). Relocate lockers.</p> <p>B. (4.3.2)(2). Employees only.</p>
Water Closets	Toilets in Men's and Women's Rest Rooms are not the proper height.	(4.16.3). Replace toilets.

BUILDING NUMBER: 1720
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48/Training Bldg.
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3). Modify as required.
	B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	B. (4.17.5). See A.
	C. Grab bars do not exist in stalls of Men's or Women's Rest Rooms.	C. (4.17.6). Install grab bars.
Urinals	Urinal in Men's Rest Room has rim too high above floor.	(4.18.2). Replace urinal.
Sinks	Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	(4.24.3). Modify as required.

BUILDING NUMBER: 1725
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48/Fire Tower
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

(No renovations needed;
no public access.)

BUILDING NUMBER: 1730
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist by walkway to transportation.	A. (4.3.2)(1). Install sidewalk.
	B. Does not exist from Patio to Training Center parking lot, and on to Training Center entrance.	B. (4.3.2)(2). Install sidewalk.
Curb Ramps	A. Does not exist where rear Truck Bay door meets porch.	A. (4.7.1). Employees only.
	B. Does not exist anywhere along curb which runs the length of Truck Bay.	B. (4.7.1). Employees only.
	C. Does not exist at doors from Lounge to Patio; (step exists).	C. (4.7.1). Employees only.
Doors	A. Rear door of Truck Bay has threshold greater than 1/2".	A. (4.13.8). Employees only.
	B. Two main front doors have thresholds greater than 1/2".	B. (4.13.8). Employees only.
	C. Two Radio Room doors do not provide 32" wide opening.	C. (4.13.5). Employees only.
	D. Two doors of Lieutenant's Office do not provide 32" wide opening.	D. (4.13.5). Employees only.
	E. Rest Room by Lieutenant's Office does not provide 32" wide opening.	E. (4.13.5). Employees only.
	F. Threshold at door between Lounge and Truck Bay exceeds 1/2".	F. (4.13.8). Employees only.

BUILDING NUMBER: 1730
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	G. Lieutenant's bathroom has two doors that do not provide 32" wide opening.	G. (4.13.5). Employees only.
	H. Door into Lieutenant's Dorm does not provide 32" wide opening.	H. (4.13.5). Employees only.
	I. Door to Showers/Rest Room does not provide 32" wide opening.	I. (4.13.5). Employees only.
	J. Door between hall and Shower/Rest Room and Truck Bay, has a threshold greater than 1/2".	J. (4.13.5). Employees only.
Water Fountains	A. Fountains in Truck Bay and inside hall do not provide proper knee clearance.	A. (4.15.5)(1). Employees only
	B. Fountains in Truck Bay and inside hall have spouts too high above the floor.	B. (4.15.2). Employees only.
Counters	Counter in Kitchen is too high above floor.	(4.32.4). Employees only.
Sinks	Kitchen sink does not provide proper knee clearance.	(4.24.3). Employees only.
Water Closets	A. Toilets in Rest Room by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room, are not the proper height.	A. (4.16.3). Employees only.
	B. Proper grab bars do not exist in Rest Room by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room.	B. (4.16.4). Also (4.17.6). Employees only.

BUILDING NUMBER: 1730
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Stalls in Shower/Rest Room are not the proper size and arrangement.	A. (4.17.3). Employees only.
	B. Stall doors in Shower/Rest Room do not provide 32" wide opening.	B. (4.17.5). Employees only.
Lavatories	A. Sinks in Rest Room by Lieutenant's Office, and Shower/Rest Room, do not provide proper knee clearance.	A. (4.24.3). Employees only.
	B. Sink in Rest Room by Lieutenant's Office does not have the proper clear floor space.	B. (4.24.5). Employees only.
Urinals	Urinals in Lieutenant's Bathroom and in Shower/Rest Room have rims too high above floor.	(4.18.2). Employees only.
Shower Stalls	A. There are no stalls in Lieutenant's Bathroom or Shower/Rest Room that are the proper size.	A. (4.21.2). Employees only.
	B. Proper grab bars do not exist in stalls of Lieutenant's Bathroom or Shower/Rest Room.	B. (4.21.4). Employees only.
	C. Proper shower spray unit does not exist in stalls of Lieutenant's Bathroom or Shower/Rest Room.	C. (4.21.6). Employees only.

BUILDING NUMBER: 1730
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	D. Curbs exist in shower stalls of Lieutenant's Bathroom and Shower/Rest Room.	D. (4.21.7). Employees only.
	E. Proper seat is not provided in Lieutenant's Bathroom, or Shower/Rest Room stalls.	E. (4.21.3). Employees only.

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	One accessible space exists, but signage is too low. Two should exist; (33 spaces).	(4.6.4). Modify as required.
Accessible Route	A. North walkway to Fire Education Building does not provide minimum clear width of 36".	A. (4.3.3). Widen sidewalk.
	B. Walkway by parking and walkway on East side of building do not provide minimum clear width of 36".	B. (4.3.3). Employee area only.
	C. Walkway to flagpole does not provide minimum clear width of 36".	C. (4.3.3). Employees only.
	D. Walkway from parking to Fire Education Building does not provide minimum clear width of 36".	D. (4.3.3). Widen sidewalk.
	E. Does not exist from building to transportation.	E. (4.3.2)(1). Install sidewalk.
Doors	A. Thresholds at three doors to Fire Education Building exceed 1/2".	A. (4.13.8). Modify as required.
	B. Doors to Men's and Women's Rest Rooms in Fire Education Building do not provide 32" wide opening.	B. (4.13.5). Modify as required.
	C. Doorway into Storage Room of Fire Education Building does not provide 32" wide opening.	C. (4.13.5). Employees only.

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	D. Threshold at Main Doorway exceeds 1/2"; (Station).	D. (4.13.8). Employees only.
	E. Main Doorway (Station) does not provide 32" wide opening.	E. (4.13.5). Employees only.
	F. Door between Lieutenant's Office and Rest Room does not provide 32" opening.	F. (4.13.5). Employees only.
	G. Doorway from Lieutenant's Dorm to Sleeping Quarters does not provide 32" wide opening.	G. (4.13.5). Employees only.
	H. Doorway to Lieutenant's Bathroom does not provide proper 32" wide opening.	H. (4.13.5). Employees only.
	I. Door of Utility Closet off hallway does not provide 32" wide opening.	I. (4.13.5). Employees only.
Curb Ramps	A. Do not exist at two South outside doors at walkway.	A. (4.7.1). Employees only.
	B. Do not exist at Main Entrance where porch and walkway meet.	B. (4.7.1). Employees only.
	C. Does not exist at doorway between Radio Room and Truck Bay.	C. (4.7.1). Employees only.
Counters	Counters in Kitchen are too high above floor.	(4.32.4). Employees only.
Sinks	Sink in Kitchen does not provide proper knee clearance.	(4.24.3). Employees only.

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountain	A. Fountains in Fire Education Building, Station Truck Bay, and Station hallway, have spouts too high above ground.	A. (4.15.2). Install paper cup dispenser.
	B. Fountains in Fire Education Building, Station Truck Bay and Station hallway, have water flow toward rear.	B. (4.15.3). See A.
	C. Fountain in Truck Bay does not provide proper knee clearance.	C. (4.15.5)(1). Employees only.
	D. Fountain in Fire Education Building does not provide proper clear floor space.	D. (4.15.5)(2). See A.
Water Closets	A. Toilets in Men's and Women's Rest Rooms by Lieutenant's Office, Lieutenant's Bathroom, Shower/Rest Room, and Men's and Women's Rest Rooms in the Fire Education Building, are not the proper height.	A. (4.16.3). Employees only.
	B. Proper clear floor space is not provided in Men's and Women's Rest Rooms by Lieutenant's Office.	B. (4.16.2). Employees only.
Toilet Stalls	A. There are no stalls in Men's and Women's Rest Rooms in the Fire Education Building, in Station Shower/Rest Room, or in Lieutenant's Bathroom, that are the proper size and arrangement.	A. (4.17.3). Modify bathrooms in Fire Education Bldg. only.

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>B. Stall doors in Men's and Women's Fire Education Building Rest Rooms, Station Shower/Rest Room, and Lieutenant's Bathroom, do not provide 32" wide opening.</p> <p>C. Grab bars do not exist in stalls of Men's and Women's Fire Education Building Rest Rooms, Station Shower/Rest Room, or in Lieutenant's Bathroom.</p>	<p>B. (4.17.5). Designated two bathrooms in Fire Education Bldg. as Handicapped accessible, remodeling as required.</p> <p>C. (4.17.6). See B.</p>
Urinals	<p>Urinals in Station Shower/Rest Room and Lieutenant's Bathroom, have rims too high above floor.</p>	(4.18.2). Employees only.
Lavatories/Mirrors	<p>A. Mirrors in Men's and Women's Fire Education Building Rest Rooms, Rest Rooms by Lieutenant's Office, Lieutenant's Bathroom, and Station Shower/Rest Room, have mirrors too high above floor.</p> <p>B. Exposed pipes underneath sinks exist in Rest Rooms by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room.</p>	<p>A. (4.19.6). Lower mirrors in Fire Education Building.</p> <p>B. (4.19.4). Employees only.</p>
Dispensers	<p>Paper towel dispensers in Men's and Women's Fire Education Building Rest Rooms, Rest Room by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room, are too high above floor.</p>	(4.23.7). Lower dispensers in Fire Education Bldg.

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	Men's and Women's Rest Rooms in Fire Education Building do not provide proper clear floor space at sinks.	(4.24.5). modify as required.
Shower Stalls	A. Shower stalls in Shower/Rest Room has curb at entrance.	A. (4.21.7). Employees only.
	B. Shower stalls in Shower/Rest Room do not provide proper seat.	B. (4.21.3). Employees only.
	C. Proper shower spray unit is not provided in either stall in Shower/Rest Room.	C. (4.21.6). Employees only.
	D. Grab bars are too high above floor in stalls of Shower/Rest Room.	D. (4.21.4). Employees only.

BUILDING NUMBER: 1740
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #50
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space, with a sign showing the symbol of accessibility, does not exist.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Curb Ramps	A. Does not exist on sidewalk to Main Entrance door.	A. (4.7.1).
	B. Curb exists all along Truck Bay without proper curb ramps.	B. (4.7.1).
	C. Does not exist at sliding glass doors leading to Patio.	C. (4.7.1).
Doors	A. Thresholds at two Main Entrance doors exceed 1/2".	A. (4.13.8).
	B. Threshold at rear door of Truck Bay exceeds 1/2".	B. (4.13.8)
	C. Door between Truck Bay and Lounge has threshold exceeding 1/2".	C. (4.13.8).
	D. Doorway between Lounge and Radio Room does not provide 32" wide opening.	D. (4.13.5).
	E. Two doors of Lieutenant's Office do not provide 32" wide opening.	E. (4.13.5).
	F. Rest Room door by Lieutenant's Office does not provide 32" wide opening.	F. (4.13.5).
	G. Doorway to Lieutenant's Dorm does not provide 32" wide opening.	G. (4.13.5).

BUILDING NUMBER: 1740
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #50
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	H. Doorway to Lieutenant's Bathroom does not provide 32" wide opening.	H. (4.13.5).
	I. Threshold at doorway between hallway and Truck Bay exceeds 1/2".	I. (4.13.8).
	J. Doorway to shower stall in Shower/Rest Room does not provide 32" wide opening.	J. (4.13.5).
Drinking Fountains	A. Drinking fountains in hallway and Truck Bay have spouts too high above floor.	A. (4.15.2).
	B. Drinking fountain in Truck Bay does not provide proper knee clearance.	B. (4.15.5)(1).
	C. Drinking fountain in hallway does not provide proper knee clearance.	C. (4.15.5)(1).
Counter	Kitchen counter is too high above floor.	(4.32.4).
Sinks	Kitchen sink does not provide proper knee clearance.	(4.24.3).
Water Closets	A. Toilets in Rest Room by Lieutenant's Office, Lieutenant's Bathroom, and Shower/Rest Room, are not the proper height.	A. (4.16.3).
	B. Proper Grab bars do not exist in Rest Rooms by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room.	B. (4.16.4). Also (4.17.6).

BUILDING NUMBER: 1740
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #50
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Stalls in Shower/Rest Room are not the proper size and arrangement.	A. (4.17.3).
	B. Stalls doors in Shower/Rest Room do not provide 32" wide opening.	B. (4.17.5).
Lavatories	A. Sinks in Rest Rooms by Lieutenant's Office and in Lieutenant's Bathroom, do not provide clear floor space.	A. (4.24.5).
Urinals	Urinals in Lieutenant's Bathroom and Shower/Rest Room have rims too high above floor.	(4.18.2).
Mirrors	Mirror in Rest Room by Lieutenant's Office is too high above floor.	(4.19.6).
Dispensers	Paper Towel Dispenser in Rest Room by Lieutenant's Office is too high above floor.	(4.23.7).
Shower Stalls	A. There are no stalls in Lieutenant's Bathroom or Shower/Rest Room that are the proper size.	A. (4.21.2).
	B. Proper grab bars do not exist in stalls of Lieutenant's Bathroom or Shower/Rest Room.	B. (4.21.4).
	C. Proper shower spray unit does not exist in stalls of Lieutenant's Bathroom or Shower/Rest Room.	C. (4.21.6).

BUILDING NUMBER: 1740
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #50
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	D. Curbs exist in shower stalls of Lieutenant's Bathroom and in Shower/Rest Room.	D. (4.21.7).
	E. Proper seat is not provided in any stall in Lieutenant's Bathroom or in Shower/Rest Room.	D. (4.21.3).

BUILDING NUMBER: 1810
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Maintenance
1900 Grand Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	<p>A. (64 Spaces) Two accessible spaces exist, with proper signage.</p> <p>B. Accessible parking spaces do not exist on the shortest route of travel from adjacent parking.</p>	<p>A. (4.1.2).</p> <p>B. (4.6.2). Relocate Handicapped parking spaces.</p>
Accessible Route	<p>A. Accessible route does not exist to 2nd floor.</p> <p>B. Threshold at Main Entrance is greater than 1/2".</p> <p>C. Threshold at entrance to Radio Shop is greater than 1/2".</p> <p>D. Curb ramp does not exist from parking to Main Entrance.</p> <p>E. Does not exist from sidewalk to Picnic Table.</p> <p>F. Threshold on East side of building by Supervisors' Offices exceeds 1/2".</p>	<p>A. (4.3.2). Employees only.</p> <p>B. (4.13.8). Install ramp.</p> <p>C. (4.13.8). Employees only.</p> <p>D. (4.7.1). Install ramp.</p> <p>E. (4.3.2)(2). Employees only.</p> <p>F. (4.13.8). Install ramp.</p>
Counters	<p>A. Counter in Waiting Area is 37" above the floor.</p> <p>B. Counters in employee Break Room are 37" above the floor.</p>	<p>A. (4.15.2). Employees only.</p> <p>B. (4.15.2). Employees only.</p>
Water Fountain	<p>Fountain at employee's sink does not provide proper knee clearance.</p>	<p>(4.15.5)(1). Employees only.</p>
Water Closets	<p>Toilets in Men's and Women's Rest Rooms are not the proper height.</p>	<p>(4.16.3). Replace toilets.</p>

BUILDING NUMBER: 1810
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Maintenance
1900 Grand Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>A. There are no toilet stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.</p> <p>B. Grab bars are not at proper height, and do not exist behind toilets.</p>	<p>A. (4.17.3). Modify as required.</p> <p>B. (4.17.6). Install grab bars.</p>
Urinals	<p>Urinals in Men's Rest Room have rims higher than 17" from floor.</p>	<p>(4.18.2). Replace urinal.</p>
Sinks	<p>A. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.</p> <p>B. Sink in Break Room does not provide proper knee clearance.</p>	<p>A. (4.24.3). Modify counter.</p> <p>B. (4.24.3). Employees only.</p>
Shower Stalls	<p>Showers in Men's Rest Room do not provide proper shower unit with hose at least 60" long.</p>	<p>(4.21.6). Employees only.</p>
Alarms	<p>Visual Alarm System is not an integrated part of building's Alarm System.</p>	<p>(4.28.1). Install as required.</p>

BUILDING NUMBER: 1820
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Radio Transmitter Tower
Lakeview and Missouri

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Accessible Route	Does not exist to Main Entrance from transportation (lacks connecting walkway).	NOTE: No Public access; employees only. (4.3.2)(1).
------------------	---	---

BUILDING NUMBER: 1830
TARGET DATE: 1993
COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Radio Transmitter Tower
S.R. 580 and McMullen

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Accessible Route	Does not exist to Main Entrance from transportation (lacks connecting walkway).	(4.3.2)(1). Employees only.
------------------	---	-----------------------------

BUILDING NUMBER: 1835
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Fuel Site/Fire #6
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramp	Does not exist at gas pumps to allow an accessible route to hose or to screen and card operated fueling system.	NOTE: No Public access; employees only. (4.7.1).
Reach Ranges	<p>A. Screen and card operated fueling system is not within reach ranges.</p> <p>B. Emergency shut-off is not within proper reach ranges.</p>	<p>A. (4.2.5) or (4.2.6).</p> <p>B. (4.2.5) or (4.2.6).</p>

BUILDING NUMBER: 1840
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Fuel Site/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramp	Does not exist at pump islands to allow an accessible route to hose or to screen and card operated fueling system.	NOTE: No Public access; employees only. (4.7.1).
Reach Ranges	A. Screen and card operated fueling system is not within proper reach ranges.	A. (4.2.5) or (4.2.6).
	B. Emergency shut-off is not within proper reach ranges.	B. (4.2.5) or (4.2.6).

BUILDING NUMBER: 1900
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Forest Run Park
3450 Landmark Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Does not exist from walkway to basketball courts.	(4.3.2)(2). Install sidewalk.
Drinking Fountain	A. Fountain by basketball court is not accessible to walkway.	A. (4.3.2)(2). Install sidewalk.
	B. Fountain by basketball court does not provide at least 30" by 48" clear floor space, allowing a person in a wheelchair to make a parallel approach to the unit.	B. (4.15.5)(2). Install Handicapped fountain.
	C. Fountain by basketball court has a spout located at rear.	C. (4.15.3). See B.
	D. Fountain by basketball court has a water flow less than 4" high.	D. (4.15.3). See B.
	E. Fountain by basketball court has water flow not within 3" of front edge of fountain.	E. (4.15.3). See B.
	F. Fountain by tennis courts is not accessible to walkway.	F. (F.3.2)(2). Install Handicapped fountain.
	G. Fountain by tennis courts does not provide at least 30" by 48" clear floor space, allowing a person in a wheelchair to make a parallel approach to the unit.	G. (4.15.5)(2). See F.
	H. Fountain by tennis courts has a spout located at rear.	H. (4.15.3). See F.

BUILDING NUMBER: 1900
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Forest Run Park
3450 Landmark Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
I. Fountain by tennis courts has water flow less than 4" high.	I. (4.15.3). See F.	
J. Fountain by tennis courts has water flow not within 3" of front edge of fountain.	J. (4.15.3). See F.	
Ground and Floor Surfaces	Bridge along walkway is slippery when wet.	(4.5.1). Coat surface with non-slip material.

BUILDING NUMBER: 1920
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Frank Tack Park
1667 N. Hercules Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist.	(4 . 6 . 2) See also (4.6.3), (4.6.4), (4.30). Modify as required.
Accessible Route	A. Does not exist from parking lot to accessible walkways.	A. (4.3.2) Install side walk.
	B. Does not exist from walkway to Baseball Fields (Bleachers).	B. (4.3.2)(2). Install sidewalk.
Assembly Areas (Bleachers)	Wheelchair locations do not exist at either Ball Field.	(4.33.3) See also (A 4.33), (A 4.33.3). Designate area.
Drinking Fountains	A. Neither fountain is accessible from an accessible walkway.	A. (4.3.2)(2). Install handicapped fountain.
	B. Neither fountain provides the clear floor space to allow a person in a wheelchair to make a parallel approach to the unit.	B. (4.15.5)(2) See A.
	C. Both fountains have spouts located at rear.	C. (4.15.3) See A.

BUILDING NUMBER: 1920
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Frank Tack Park
1667 N. Hercules Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	D. Both fountains have a water flow less than 4" high.	D. (4.15.3). See A.
	E. Both fountains have their water flow more than 3" of the front edge of fountain.	E. (4.15.3). See A.
Rest Rooms	Not accessible from an accessible walkway connecting other elements of the Park.	(4.3.2)(2). Install sidewalk.
Toilet Stalls	A. There is no stall in Men's or Women's Rest Room that is totally accessible.	A. (4.17.3). Also (4.22.4). Modify as required.
	B. Grab bars do not exist in any stalls.	B. (4.17.6). Install grab bars.
Water Closets	Height of toilets in both Men's and Women's Rest Rooms is too low. (Men's, 15-1/2"; Women's, 16").	(4.16.3) Replace toilets.
Doors	Threshold at both Men's and Women's Rest Room is 2" high.	(4.13.8) Install ramp.
Sinks	A. Sinks in both Men's and Women's Rest Rooms have exposed water pipes.	A. (4.24.6). Modify as required.
	B. Knee clearance is 20-3/4" wide in Men's Rest Room, and 21" wide in Women's Rest Room.	B. (4.24.3) Modify as required.

BUILDING NUMBER: 1930
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Fred Cournoyer Building
714 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Two accessible spaces by walkway to entrance need access aisle to allow proper access.	(4.6.3). Modify as required.
Accessible Route	With bushes, walkway to entrance (West side walkway), does not provide minimum clear width for wheelchair.	(4.3.2)(2). Trim or remove hedges.
Counters	Counter at Refreshment Stand is 43" high.	(4.32.4) Modify section of counter.
Doors	A. 4-1/2" steps exist on West side doors. Also, thresholds are 1" high.	A. (4.13.8) Install ramp.
	B. 4-1/2" step exists on East side door. Also, threshold is 1" high.	B. (4.13.8). Modify as required.
	C. Two doors leading to Women's Rest Room are 30" wide.	C. (4.13.5) Modify as required.
	D. All Rest Room inside doors are 30" wide.	D. (4.13.5). Modify as required.
	E. 1" threshold exists at doorway to Concession Area.	E. (4.13.8). Staff only.
Toilet Stalls	A. Stall doors in Women's Rest Room (22"), and Men's Rest Room (22-1/2", 22"), do not provide a clear opening of 32".	A. (4.17.5). Also (4.13.5). Modify as required.
	B. There are no stalls in Men's or Women's Rest Rooms that are accessible.	B. (4.17.3), (4.22.4). See A.
	C. Grab bars do not exist in Men' or Women's Rest Rooms.	C. (4.17.6) [Figure 29]. Install grab bars.

BUILDING NUMBER: 1930
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Fred Cournoyer Building
714 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	A. Height of toilets in both Men's and Women's Rest Rooms is 16" high.	A. (4.16.3) Replace toilets.
Lavatories and Mirrors	A. Sinks in both Men's and Women's Rest Rooms have exposed water pipes.	A. (4.24.6). Modify as required.
	B. Mirrors in Women's Rest Room are 46" from the floor.	B. (4.19.6) Lower mirrors.
	C. Knee clearance is 15" wide underneath sinks.	C. (4.24.3) Modify as required.
Water Fountain	A. Water Fountain has spout 42" from floor.	A. (4.15.2) Install paper cup dispenser.
	B. Clear knee space between the bottom of the apron and the floor is not provided.	B. (4.15.5)(1) See A.

BUILDING NUMBER: 1950
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Garden Avenue Garage
28 N. Garden Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(270 Spaces) Four accessible spaces exist but signage is too low. With two hundred seventy spaces, seven accessible spaces should exist.	(4.6.4). Also (4.1.2). Modify as required.
Accessible Route	Does not exist to allow person in wheelchair access into ticket booth.	(4.3.2)(2). Employees only.
Doors	A. Threshold at door leading to elevator door on Level 4 is 1" high.	A. (4.13.8). Install ramp.
	B. Thresholds at stairway doors on Levels 4,3,2, and 1, are 2".	B. (4.13.8). Provide curb ramp.
Stairs	Handrails on stairs are not uniform 34" to 38" above stair nosings.	(4.9.4)(5). Adjust railing to proper height.
Door Opening Force	Door leading to elevator door on Level 4 takes more than 5 IBF to open.	(4.13.11). Adjust door tension.
Elevators	A. Hall lanterns do not exist on Levels 2,3, and 4.	A. (4.10.4). Elevator Contract.
	B. Reopening device does not stay open for at least twenty seconds.	B. (4.10.6). Elevator Contract.

BUILDING NUMBER: 2000
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Gas Division/2nd Floor
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Aisle space throughout offices does not provide minimum clear width of 36".	NOTE: No Public Access. (4.3.3).
Counters	Desks and counters throughout offices do not provide proper knee clearance.	(4.32.3).
Curb Ramps	Ramp's current location (into a parking place) makes its obstruction by a parked vehicle likely.	(4.7.8) Could lead into access aisle next to an accessible parking space.
Drinking Fountain	A. Fountain in Garage has a spout too high from floor.	A. (4.15.2).
	B. Fountain in Garage does not provide proper clear floor space.	B. (4.15.5)(2).
Sinks	Kitchen sink counter does not provide proper knee clearance.	(4.24.3).
Doors	A. Threshold at rear door leading to stairway exceeds 1/2".	A. (4.13.8).
	B. Rear door leading to stairway does not provide 32" wide opening.	B. (4.13.5).
	C. Threshold at Main Entrance door exceeds 1/2".	C. (4.13.8).
	D. Door at Main Entrance does not provide 32" wide opening.	D. (4.13.5).
	E. Rear Garage door has threshold exceeding 1/2".	E. (4.13.8).
Stairs	A. Rear stairway has open risers.	A. (4.9.2).

BUILDING NUMBER: 2000
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Gas Division/2nd Floor
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	B. Stairs in Garage have open risers.	B. (4.9.2).
	C. Handrails on rear stairway, handrails in Garage, and handrails at Main Entrance have handrails too high in spots.	C. (4.9.4)(1-7).
Water Closets	A. Toilets in Men's and Women's Rest Rooms are not the proper height.	A. (4.16.3).
	B. Grab bars do not exist in Men's or Women's Rest Rooms.	B. (4.16.4).
Lavatories and Mirrors	A. Mirrors are too high from ground in Men's and Women's Rest Rooms.	A. (4.19.6).
	B. Exposed water pipes exist underneath sinks in Men's and Women's Rest Rooms.	B. (4.19.4).

BUILDING NUMBER: 2010
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Gas Division/Welding Shop
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Rear Garage door has a threshold exceeding 1/2".	A. (4.13.8). Employees only.
	B. 5" step exists at Main Entrance.	B. (4.13.8). Employees only.

BUILDING NUMBER: 2020
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Gas Division/West Building
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Threshold at Main Entrance door exceeds 1/2".	A. (4.13.8). Employees only.
	B. Door between Lounge and Storage does not provide 32" wide opening.	B. (4.13.5). Employees only.
	C. Door between Locker Room and Employee Rest Room does not provide 32" wide opening.	C. (4.13.5). Employees only.
Stairs	Handrails on stairs at Main Entrance are too high.	(4.9.4)(5). Employees only.
Counters, Tables	A. Counters and tables throughout office do not provide proper knee clearance.	A. (4.32.3). Employees only.
	B. Counter in Supervisor's Office is too high off floor.	B. (4.32.4). Also (7. Employees only.
	C. Tables in Employee Lounge do not provide proper knee clearance.	C. (4.32.3). Employees only.
Drinking Fountains	A. Fountain in Employee Lounge has spout too high from floor.	A. (4.15.2). Employees only.
	B. Fountain in Employee Lounge has water flow toward rear.	B. (4.15.3). Employees only.
	C. Fountain in Employee Lounge does not provide proper knee clearance.	C. (4.15.5)(1)&(2). Employees only.
Sinks	A. Kitchen sink in Employee Lounge does not provide proper knee clearance.	A. (4.24.3). Employees only.
	B. Utility sink in Employee Rest Room does not provide proper knee clearance.	B. (4.24.3). Employees only.

BUILDING NUMBER: 2020
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Gas Division/West Building
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Sink in Employee Rest Room does not provide proper knee clearance.	C. (4.24.3). Employees only.
	D. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	D. (4.24.3). Employees only.
Shower Stalls	A. Shower stall in Employee Rest Room has a 5" curb.	A. (4.21.7). Employees only.
	B. Shower stall in Employee Rest Room does not provide proper size and clearances.	B. (4.21.2). Employees only.
	C. Seat is not provided in shower stall in Employee's Rest Room.	C. (4.21.3). Employees only.
	D. Proper shower spray unit does not exist in Employee Shower stall.	D. (4.21.6). Employees only.
Urinals	Urinal in Employee Rest Room has a rim higher than 17" above ground.	(4.18.2). Employees only.
Water Closets	A. Toilets in Men's and Women's and rear Employee Rest Rooms, are not the proper height.	A. (4.16.3). Employees only.
	B. Grab bars do not exist in Men's and Women's and rear Employee Rest Rooms.	B. (4.16.4). Employees only.
Mirrors	Mirrors above sinks in Men's and Women's and rear Employee Rest Rooms are too high from the floor.	(4.19.6). Employees only.
Dispensers	Paper towel dispensers in Men's and Women's Rest Rooms are too high from the floor.	(4.23.7). Employees only.

BUILDING NUMBER: 2020
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Gas Division/West Building
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	No stalls in Employee Rest Room are proper size and arrangement.	(4.17.3). Employees only.
Accessible Route	A. In Women's Rest Room, file cabinet in present location blocks a minimum clear width of 36" for accessibility.	A. (4.3.3). Employees only.
	B. With sink in present location in Men's Rest Room, toilet is not accessible.	B. (4.3.3). Employees only.

BUILDING NUMBER: 2030
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: Glen Oaks Golf Course
1345 Court Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space, designated by a sign showing the symbol of accessibility, does not exist.	(4.6.2),(4.6.3),(4.6.4). Modify as required.
Accessible Route	A. Does not exist to transportation (Bus Stop).	A. (4.3.2)(1). Install sidewalk.
	B. Where parking and sidewalk leading to facility meet, a rough surface exists.	B. (4.3.6). Extend sidewalk.
	C. Does not exist from walkway to "Flower Factory".	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist via a ramp into Main Building (Pro Shop).	D. (4.3.2)(2). Modify as required.
Telephone	A. Public Phone Booth is not Hearing Aid compatible with volume control.	A. (4.31.5)(1)&(2). See Cover Sheet.
	B. Public Phone Booth does not provide proper clear floor space.	B. (4.31.2). See A.
	C. Threshold at Public Phone Booth has step exceeding 1/2".	C. (4.13.8). Modify as required.
Stairs	A. Stairs at Main Entrance have handrails that are not the proper height.	A. (4.9.4)(1-7). Modify handrails.
	B. Entrances on S.R. 60 side do not have handrails.	B. (4.9.4)(1-7). Install handrails.
	C. South side stairs have no handrails.	C. (4.9.4)(1-7). Install handrails.

BUILDING NUMBER: 2030
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: Glen Oaks Golf Course
1345 Court Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Stairs by Practice Green lead to door with 4" step.	A. (4.13.8). Not designated Handicapped entrance.
	B. Thresholds at Main Entrance, S.R. 60 doors, South door, and door at Practice Green, have steps exceeding 1/2".	B. (4.13.8). Modify Main Entrance as required.
	C. Door at Main Entrance does not provide 32" wide opening.	C. (4.13.5). Modify as required.
	D. Doorways to Men's and Women's Rest Rooms do not provide 32" wide opening.	D. (4.13.5). Modify as required.
	E. Office door in hallway does not provide 32" wide opening.	E. (4.13.5). Employees only.
	F. Door to Club Storage does not provide 32" wide opening.	F. (4.13.5). Employees only.
Tables and Counters	A. Main Counter does not provide a 36" x 36" area for wheelchair accessibility (Pro Shop).	A. (7.2). Staff to provide assistance as needed.
	B. Tables in Pro Shop do not provide proper knee clearance.	B. (4.32.3). Provide Handicapped accessible table.
	C. Counter on door to Club Storage is too high from floor.	C. (4.32.4). Employees only.
Accessible Route	A. With barrier wall in present location, minimum clear width of 36" is not provided at Men's Rest Room entrance.	A. (4.3.3). Modify as required.
	B. With sink in present location, minimum clear width of 36" is not provided at Women's Rest Room entrance.	B. (4.3.3). Modify as required.

BUILDING NUMBER: 2030
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: Glen Oaks Golf Course
1345 Court Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>A. There are no toilet stalls in Men's and Women's Rest Rooms that are proper size and arrangement.</p> <p>B. There are no grab bars provided in any stalls in Men's or Women's Rest Rooms.</p> <p>C. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.</p>	<p>A. (4.17.3). Modify as required.</p> <p>B. (4.17.6). Install grab bars.</p> <p>C. (4.17.5). Modify as required.</p>
Water Closets	<p>Toilets in Men's and Women's Rest Rooms are not the proper height.</p>	<p>(4.16.3). Replace toilets.</p>
Sinks	<p>A. Proper knee clearance is not provided at any sinks in Men's or Women's Rest Rooms.</p> <p>B. Sink in Pro Shop does not provide proper knee clearance.</p>	<p>A. (4.24.3). Modify counter.</p> <p>B. (4.24.3). Employees only.</p>

BUILDING NUMBER: 2040
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Holt Street Pool
1259 Holt Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space, designated by a sign showing the symbol of accessibility, does not exist.	NOTE: Designate Ross Norton Pool as Handicapped accessible. (4.6.2), (4.6.3), (4.6.4).
Accessible Route	A. Walkway to street has a slope greater than 1:20.	A. (4.3.7).
	B. Steps at entrance do not have an accessible ramp.	B. (4.3.8).
	C. Walkway from Lockers to Pool has 4-1/2" step. (Men's).	C. (4.3.8).
	D. Walkway from Women's Lockers to Pool is obstructed by a Water Fountain, which allows only 28" clear width.	D. (4.3.3).
Doors	A. Threshold on double doors at main entrance has 5" step.	A. (4.13.8). Also (4.5.2).
	B. Doors with counters at front office (front and rear), do not provide minimum clear opening of 32".	B. (4.13.5).
Counters	Counters at front and rear front office doors are 42" from floor.	(4.32.4).
Water Fountain	A. Fountain behind Women's Lockers has a spout 42" from floor.	A. (4.15.2).
	B. Spout is located at rear of fountain.	B. (4.15.3).
	C. No clear floor space at fountain is provided.	C. (4.15.5)(2).
	D. Proper knee clearance is not provided.	D. (4.15.5)(2).

BUILDING NUMBER: 2040
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Holt Street Pool
1259 Holt Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	A. Mirrors in both Men's and Women's Rest Rooms are too high.	A. (4.19.6).
	B. Sinks in Men's and Women's Rest Rooms have exposed water pipes.	B. (4.24.6).
	C. Knee clearance under sinks in both Men's and Women's Rest Rooms is 14" wide.	C. (4.24.3).
Toilet Stalls	A. Toilet stall doors in Men's (30" wide), and Women's (29" wide) Rest Rooms, do not provide a clear opening of 32".	A. (4.17.5). Also (4.13.5).
	B. There are no stalls in Men's or Women's Rest Rooms that are accessible with proper floor space.	B. (4.17.3). Also (4.22.4).
Water Closets	A. Grab bars do not exist in Men's or Women's Rest Rooms.	A. (4.17.6).
	B. Paper towel dispenser in Women's Rest Room is 57" from the ground.	B. (4.2.5).
Urinals	Accessible urinal does not exist.	(4.18.2).
Shower Stalls	A. Men's Shower has 4-1/2" curb.	A. (4.21.7).
	B. Seat is not provided in Men's Shower.	B. (4.21.3).
	C. Shower spray unit with a hose at least 60" long is not provided.	C. (4.21.6).
	D. Grab bars are not provided in Men's or Women's shower stalls.	D. (4.21.4).

BUILDING NUMBER: 2040
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Holt Street Pool
1259 Holt Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	E. Women's three stalls have doorway openings of 23".	E. (4.22.2). Also (4.13).
	F. Bench is not provided in any Women's shower stall.	F. (4.21.3).
	G. All Women's stalls have 4" curb.	G. (4.21.7).
	H. Shower spray unit with a hose at least 60" long is not provided.	H. (4.21.6).
	I. Women's three shower stalls are 32" x 36", thus not accessible.	I. (4.21.2).
	J. Controls are 49" from floor, with shower head at 69".	J. (4.21.5).
	K. Bench by showers is 22-1/2" high.	K. (4.35.4).
Dressing Rooms	A. Doors on Dressing Rooms are 25" wide.	A. (4.35.3). Also (4.13).
	B. Dressing Room stalls do not provide the proper clear floor space.	B. (4.35.2).

BUILDING NUMBER: 2045
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Jack Russell Stadium
801 Phillies Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	13 spaces exist, but they are located on grass, not the proper surface for an accessible route.	(4.1.2)(4). Modify as required.
Ticket Counter	Proper 36" x 36" area of counter is not provided for persons in wheelchairs at any Ticket Counter or Booth.	(7.2). Modify as required.
Concession Counters	Height of counters throughout Stadium is too high (Concession and Souvenir).	(4.32.4). Also (5.2). Modify sections of counters.
Accessible Route	<p>A. Does not exist from parking or walkways to Astroturf Field at rear of complex.</p> <p>B. Does not exist to Batting Cages at rear of complex.</p> <p>C. Does not exist to Dugouts (walkway not present; also ramp is not provided). (Home and Visitor).</p>	<p>A. (4.3.2)(1). Install sidewalk.</p> <p>B. (4.3.2)(2). Staff and players only.</p> <p>C. (4.3.2)(2). Staff and players only.</p>
Ramps	All ramps leading to Grandstand have slope and rise exceeding standards.	(4.8). No modifications at this time; UFAS, 4.1.6 (Exceptions).
Assembly Areas	Wheelchair location does not exist at Bleachers of Astroturf Field at rear of Complex.	(4.33.3). Designate area.
Stairs	<p>A. Handrails are not continuous and are too high on stairway to second floor Offices (South, rear of Complex).</p> <p>B. Open risers exist on stairway to second floor Offices (South, rear of Complex).</p> <p>C. North side second floor Offices (over Locker Room) stairway has open risers.</p>	<p>A. (4.9.4)(1)(2)(5). Staff only.</p> <p>B. (4.9.2). Staff only.</p> <p>C. (4.9.2). Staff only.</p>

BUILDING NUMBER: 2045
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Jack Russell Stadium
801 Phillies Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	D. North side second floor Offices (over Locker Room) stairway has handrail on one side only.	D. (4.9.4)(1). Staff only.
	E. North side second floor Offices (over Locker Room) stairway has handrail too high.	E. (4.9.4)(5). Staff only.
	F. Stairs to Third Base side outfield stands have open risers.	F. (4.9.2). Modify as required.
Telephones	Public Telephones throughout Stadium do not have volume controls and are not Hearing Aid compatible.	(4.31.5)(1)&(2). See Cover Sheet.
Doors	A. Clearance in front of Rest Room doors (behind Home Plate) is not level.	A. (4.13.6). Modify as required.
	B. Clearance in front of Women's Rest Room doors (by Souvenir Stand) is not level.	B. (4.13.6). Modify as required.
	C. Thresholds of both doors at Ticket Office Building exceed 1/2"; (3" steps).	C. (4.13.8). Staff only.
	D. Threshold at South side door leading outside from Laundry Room exceeds 1/2".	D. (4.13.8). Staff only.
	E. Door to Training Room does not provide 32" opening; (leading from outside).	E. (4.13.5). Staff only.
	F. Double doors leading from Locker Room to Field (Home Lockers) has threshold greater than 1/2".	F. (4.13.8). Staff only.
	G. Media Room has threshold greater than 1/2"; (4" step).	G. 4.13.8). Install ramp.
	H. Film Room has threshold greater than 1/2".	H. (4.13.8). Staff only.

BUILDING NUMBER: 2045
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Jack Russell Stadium
801 Phillies Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	I. Threshold at door to Visitor's Locker Room exceeds 1/2"; (4" step).	I. (4.13.8). Staff and players only.
	J. Space in front of Women's Rest Room (Third Base Outfield) door is not level.	J. (4.13.6). Modify as required.
Toilet Stalls	A. There is no stall in Women's Rest Room (First Base side) that is proper size and arrangement.	A. (4.17.3). Modify as required.
	B. Stall doors in Women's Rest Room (First Base side) do not provide 32" opening with latch in present location.	B. (4.17.5). Modify as required.
	C. There is no stall in Men's Rest Room (First Base side) that is proper size and arrangement.	C. (4.17.3). Modify as required.
	D. Stall doors in Men's Rest Room (First Base side) do not provide 32" opening with latch in present location.	D. (4.17.5). Modify as required.
	E. There is no stall in Women's Rest Room (behind Home Plate) that is proper size and arrangement.	E. (4.17.3). Modify as required.
	F. Stall doors in Women's Rest Room (behind Home Plate) do not provide 32" opening with latch in present location.	F. (4.17.5). Modify as required.
	G. There is no stall in Men's Rest Room (behind Home Plate) that is proper size and arrangement.	G. (4.17.3). Modify as required.

BUILDING NUMBER: 2045
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Jack Russell Stadium
801 Phillies Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	H. Stall doors in Men's Rest Room (behind Home Plate) do not provide 32" opening with latch in present location.	H. (4.17.5). Modify as required.
	I. There is no stall in Women's Rest Room (Third Base Outfield area) that is proper size and arrangement.	I. (4.17.3). Modify as required.
	J. Stall doors in Women's Rest Room (Third Base Outfield area) do not provide 32" opening with latch in present location.	J. (4.17.5). Modify as required.
	K. There is no stall in Men's Rest Room (Third Base Outfield area) that is proper size and arrangement.	K. (4.17.3). Modify as required.
	L. Stall doors in Men's Rest Room (Third Base Outfield area) do not provide 32" opening with latch in present location.	L. (4.17.5). Modify as required.
Water Closets	Toilet in Men's Rest Room (behind Home Plate) is not the proper height.	(4.16.3). Replace toilet.
Urinals	Urinal in Men's Rest Room (behind Home Plate) has rim too high from floor.	(4.18.2). Lower urinal.
Lavatories and Mirrors	Exposed water pipes underneath sinks in all Public Rest Rooms exist.	(4.19.4). Modify as required.
Sinks	Sinks in Men's Rest Room (behind Home Plate) are 36" high.	(4.24.2). Lower sinks.
Doors	Door opening force on doors at Rest Rooms (Men's and Women's) located on First Base side is greater than 5 IBF.	(4.13.11). Adjust closer.

BUILDING NUMBER: 2055
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Kings Highway Rec. Center
1751 Kings Highway

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(65 Spaces) Two accessible spaces exist. With sixty-five spaces, three accessible spaces should exist.	(4.1.2). Modify as required.
Accessible Route	A. Does not exist from parking or from Center Building to elements of Playground.	A. (4.3.2)(1). Install sidewalk.
	B. Does not exist to a designated picnic table.	B. (4.3.2)(2) Install sidewalk.
	C. Does not exist from rear exit door to walkway leading to parking.	C. (4.3.2)(1). Main entrance designated as Handicapped.
Doors	A. Double-leaf doorway at main entrance does not have at least one leaf 32" wide when open at 90 degrees.	A. (4.13.4). Also (4.13.5). Re-evaluation; meets ADA Standards.
	B. Double-leaf door by vending machines leading to Ping Pong/Pool Room, does not have at least one leaf 32" wide when open at 90 degrees.	B. (4.13.4). Also (4.13.5). Staff to provide assistance as needed.
	C. Rear exit door is 27" wide.	C. (4.13.5). Re-evaluation; meets ADA Standards.
	D. Doors to Men's and Women's Rest Rooms are 29" wide.	D. (4.13.5). Modify as required.
Sinks	Knee clearance is not provided at kitchen sink.	(4.24.3). Modify as required.

BUILDING NUMBER: 2055
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Kings Highway Rec. Center
1751 Kings Highway

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountain	A. Fountain at entrance has a spout 39", measured from the floor to the spout outlet.	A. (4.15.2). Install Handicapped fountain.
	B. Fountain at entrance does not provide proper knee clearance.	B. (4.15.5)(1). Install Handicapped fountain.
Toilet Stalls	A. Women's stall is not accessible, with 55-1/2" x 33" measurement.	A. (4.17.3). Modify as required.
	B. Men's stall is not accessible, with 56" x 33" measurement.	B. (4.17.3). Modify as required.
	C. Stall doors in both Men's and Women's Rest Rooms are 21" wide.	C. (4.17.5) (4.13.5). Modify as required.
	D. Grab bars do not exist in Men's or Women's Rest Rooms.	D. (4.17.6). Install grab bars.
Lavatories and Mirrors	A. Mirrors in Men's and Women's Rest Rooms are 48" from floor to bottom of mirror.	A. (4.19.6). Lower mirrors.
	B. Sinks in Men's and Women's Rest Rooms have exposed hot water pipes.	B. (4.19.4). Modify as required.

BUILDING NUMBER: 2060
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Lawn Bowling Club
1040 Calumet Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Neither leaf on double doors at Main Entrance provide 32" wide opening.	A. (4.13.5). Modify as required.
	B. Front double doors threshold is greater than 1/2".	B. (4.13.8). See A.
	C. Rear double doors and South side double doors do not have level area in front of doors. (Now sloped at door entrance.)	C. (4.13.6). Modify as required.
	D. Two sets of double doors in Meeting Room have doors with neither leaf providing 32" wide opening.	D. (4.13.5). Staff to provide assistance as needed.
	E. Doors leading to Men's and Women's Rest Rooms do not provide 32" opening.	E. (4.13.5). Modify as required.
	F. Door to office does not provide 32" wide opening.	F. (4.13.5). Staff only.
Counter	Counter is 42-1/2" high.	(4.32.4). N/A; not a permanent fixture.
Raised Platform	Raised platform, used as speaker's lecturn or head table, has an 11" step all around.	(5.7). Install ramp.
Sinks	Kitchen sink does not provide proper knee clearance.	(4.24.3). Staff only.
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are accessible, with proper size and arrangement.	A. (4.17.3). Also (4.22.4). Modify as required.
	B. Doors to stalls in Men's and Women's Rest Rooms are not a minimum of 32" wide.	B. (4.17.5). See A.

BUILDING NUMBER: 2060
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Lawn Bowling Club
1040 Calumet Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	<p>A. Toilets in Men's and Women's Rest Rooms are not the proper height.</p> <p>B. Grab bars do not exist in Men's or Women's Rest Room stalls.</p>	<p>A. (4.16.3). Modify as required.</p> <p>B. (4.17.6). Install grab bars.</p>
Urinals	<p>Urinal in Men's Rest Room has rim 25" from floor.</p>	<p>(4.18.2). Lower urinal.</p>
Lavatories and Mirrors	<p>A. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.</p> <p>B. Mirrors over sinks in both Men's and Women's Rest Rooms are too high.</p> <p>C. Sinks in Men's and Women's Rest Rooms have exposed water pipes.</p> <p>D. Paper towel dispensers in Men's and Women's Rest Rooms are too high.</p>	<p>A. (4.24.3). Modify as required.</p> <p>B. (4.19.6). Lower mirrors.</p> <p>C. (4.19.4). Also (4.24.6) Modify as required.</p> <p>D. (4.23.7). Also (4.2.5), (4.2.6). Lower dispensers.</p>
Accessible Route	<p>In Men's Rest Room, with lockers in present location, accessible opening to stalls does not exist.</p>	<p>(4.3.3). Rearrange lockers.</p>

BUILDING NUMBER: 2065
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Beach Library
40 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Double doors at Main Lobby entrance do not provide 32" wide opening (neither door).	A. (4.13.4). Modify as required.
	B. Threshold at door on North side leading outside is greater than 1/2".	B. (4.13.8). Modify as required.
	C. Doorway to Office does not provide 32" wide opening.	C. (4.13.5). Employee only.
	D. Doorway at Rest Room (inside Office), does not provide 32" wide opening.	D. (4.13.5). Employee only.
Space Allowance	Clear floor space is not provided in front of Change Machine.	(4.2.4)(1). Modify as required.
Reading/Study Areas	A. Card Catalog computer desk does not provide proper knee clearance.	A. (8.2). Also (4.32.3). Modify as required.
	B. Reading tables (4 tables), do not provide proper knee clearance.	B. (8.2). Also (4.32.3). Provide table with proper clearance.
Alarms	Visual Alarm System is not an integrated part of building's Alarm System.	(4.28.1). Install as required.
Counter	A portion of Main Counter (36" x 36") is not provided for wheelchair accessibility.	(7.2)(2). Library Staff to provide assistance as needed.
Accessible Route	Minimum clear aisle width is not provided around carousel of books located throughout.	(8.5). Library Staff to provide assistance as needed.
Water Closets	A. Grab bars do not exist in Rest Room by Office.	A. (4.16.4). Employee only.
	B. Clear floor space in front of toilet in Rest Room by Office is not provided.	B. (4.16.2). Employee only.

BUILDING NUMBER: 2065
TARGET DATE: 1993
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Beach Library
40 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sink	Clear floor space is not provided in front of sink in Rest Room by Office.	(4.24.5). Employee only.
Lavatories and Mirrors	A. Mirror over sink in Rest Room by Office is too high.	A. (4.19.6). Employee only.
	B. Sink in Rest Room by Office has exposed water pipes.	B. (4.19.4). Employee only.

BUILDING NUMBER: 2070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Library/Main Branch
100 N. Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(58 Spaces) Two accessible, with signage too low.	(4.6.4). Modify as required.
Curb Ramp	<p>A. Does not exist where driveway and South staff entrance walkway meet.</p> <p>B. Does not exist at South staff entrance door threshold.</p> <p>C. Curb ramp from parking to Book Deposit box has rough surface.</p>	<p>A. (4.7.1). Employees only.</p> <p>B. (4.7.1). Employees only.</p> <p>C. (4.7.4). Modify as required.</p>
Ramp	Ramp from Circulation Room to Acquisition Room has improper slope and rise.	(4.8.2). Employees only.
Doors	<p>A. Double doors of East outside stairway to first floor has threshold exceeding 1/2".</p> <p>B. Northwest double doors by Chamber of Commerce parking lot has threshold exceeding 1/2".</p> <p>C. Single East side outside door leading to inside stairway has threshold exceeding 1/2".</p> <p>D. Threshold at South delivery door exceeds 1/2".</p> <p>E. Door in stairway by outside Book Deposit box has threshold exceeding 1/2".</p>	<p>A. (4.13.8). Not designated Handicapped entrance.</p> <p>B. (4.13.8). Employees only.</p> <p>C. (4.13.8). Not designated Handicapped entrance.</p> <p>D. (4.13.8). Employees only.</p> <p>E. (4.13.8). Employees only.</p>

BUILDING NUMBER: 2070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Library/Main Branch
100 N. Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	F. Neither leaf of Auditorium double doors (off Lobby) provide 32" wide opening.	F. (4.13.4). Re-evaluation; meets ADA Standard.
	G. Inside double doors by Book Return (Lobby) has neither leaf providing 32" wide opening.	G. (4.13.4). Re-evaluation; meets ADA Standard.
	H. Custodian door by Lobby Rest Rooms does not provide 32" wide opening.	H. (4.13.5). Employees only.
	I. Supply Room door off "Acquisition Room" does not provide 32" wide opening.	I. (4.13.5). Employees only.
	J. Door opening force exceeds 5 LBF at Rest Room doors throughout building.	J. (4.13.11). Adjust operator.
	K. Door into Women's Lounge Rest Room does not provide 32" wide opening; (first floor).	K. (4.13.5). Employees only.
	L. Cleaning Supplies Room (by first floor Lounge) does not provide 32" wide opening.	L. (4.13.5). Employees only.
	M. Two doorways in passage to first floor Lounge do not provide 32" wide opening.	M. (4.13.5). Employees only.
	N. Doors into boy's and girl's Children's Rest Rooms do not provide 32" wide opening.	N. (4.13.5). Not designated Handicapped Rest Room.

BUILDING NUMBER: 2070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Library/Main Branch
100 N. Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	O. Neither of the double doors at the second floor Audio Room provides 32" opening.	O. (4.13.4). Staff to provide assistance as needed.
	P. Custodian's door by second floor Rest Rooms does not provide 32" wide opening.	P. (4.13.5). Employees only.
	Q. Second floor Staff Storage door does not provide 32" wide opening.	Q. (4.13.5). Employees only.
	R. Neither double doors at second floor Administration entrance provides 32" wide opening.	R. (4.13.5). Employees only.
	S. Second floor East emergency door does not provide 32" wide opening.	S. (4.13.5). Re-evaluation; meets ADA Standard.
	T. Third floor East emergency exit door does not provide 32" wide opening (with bar), and has threshold exceeding 1/2".	T. (4.13.5)&(4.13.8). Employees only.
	U. Door into third floor Rest Room has threshold exceeding 1/2"/	U. (4.13.8). Employees only.
	Stairs	A. East outside stairway down to first floor has no handrails.
B. South outside stairway to Book Deposit box has no handrails.		B. (4.9.4). Install handrails.

BUILDING NUMBER: 2070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Library/Main Branch
100 N. Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	C. Stairway from Lobby to second floor has handrails too high, and outside handrail is not continuous.	C. (4.9.4)(1)&(5). Not designated Handicapped.
	D. Stairway to second floor of "Acquisition Room" has handrail on only one side, and is not the proper height.	D. (4.9.4)(1)&(2). See C.
	E. Stairway from second floor "Staff Storage" has handrails on one side, is not continuous, and is not the proper height.	E. (4.9.4)(1)&(5). See C.
Alarms	A Visual Alarm System is not an integral part of building's Alarm System.	(4.28.1), (4.28.2), (4.28. Install as required.
Accessible Route	A. Does not exist to outside Northwest double doors by the Chamber of Commerce parking lot.	A. (4.3.2)(2). Employees only.
	B. Outside Book Deposit Drop exceeds reach limits.	B. (4.2.5)&(4.2.6). Modify as required.
	C. Passage to first floor Lounge has uneven floor surface (slant).	C. (4.3.6)&(4.5). Employees only.
	D. Passage to stairway off "Acquisition Room" has level change (step) at employee entrance.	D. (4.3.8). Employees only.
	E. Clear width of 36" is not provided in second floor Staff Storage.	E. (4.3.3). Employees only.

BUILDING NUMBER: 2070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Library/Main Branch
100 N. Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Drinking Fountains	A. Fountains in Lobby and by second floor Rest Rooms do not provide proper knee clearance.	A. (4.15.5)(1). Install Handicapped fountain.
Telephones	Outside public telephone at entrance is not Hearing Aid compatible with volume control.	(4.31.5)(1)&(2). See Cover Sheet.
Book Stacks	Minimum clear aisle space between stacks is not always provided on first and second floor, especially by walls.	(8.5). Staff to provide assistance as needed.
Reading & Study Areas	A. First floor (including Children's Section) and second floor reading tables do not provide proper knee clearance. B. Minimum clear width between book carrouzels by first floor Check-Out, is not provided.	A. (8.2). Modify table and designate Handicapped. B. (8.2). Relocate as needed.
Card Catalogs	Catalog Computer Counter is too high above ground at first and second floor locations.	(8.4). Also (4.32.4). Modify as required.
Counters/Tables	Computer tables and counters, and desks throughout first, second and third floors do not provide proper knee clearance.	(4.32.3). Modify and designate table as required.
Sinks	A. Exposed pipes exist underneath sinks in Men's and Women's Lobby Rest Rooms, boy's and girl's Children's Rest Rooms, and second floor Men's and Women's Rest Rooms.	A. (4.24.6). Modify as required.

BUILDING NUMBER: 2070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Library/Main Branch
100 N. Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	<p>B. Proper knee clearance is not provided underneath sinks in Lounge Rest Room (1st floor), Lounge kitchen, and third floor Rest Room.</p> <p>C. Clear floor space in front of sink is not provided at boy's and girl's Children's Rest Rooms, and third floor Rest Room.</p>	<p>B. (4.24.3). Employees only.</p> <p>C. (4.24.5). Not designated as Handicapped. Third floor, employees only.</p>
Water Closets	<p>A. Toilets in boy's and girl's Children's Rest Rooms, third floor Rest Room, and first floor Lounge, are not the proper height.</p> <p>B. Clear floor space is not provided in Rest Room on third floor, and in boy's and girl's Children's Rest Rooms.</p> <p>C. Grab bars do not exist in third floor Rest Room and in boy's and girl's Children's Rest Rooms.</p>	<p>A. (4.16.3). Not designated as Handicapped. Third floor and Lounge, employees only.</p> <p>B. (4.16.2). Not designated as Handicapped. Third floor, employees only.</p> <p>C. (4.16.4). Third floor, employees only. Children's Rest Room not designated Handicapped.</p>
Toilet Stalls	<p>A. There are no stalls in Men's and Women's first floor (Lobby), second floor Rest Rooms, and first floor Lounge, that are the proper size and arrangement.</p> <p>B. Stall doors in Men's and Women's Lobby Rest Rooms, Men's and Women's second floor Rest Rooms, and first floor Lounge, do not provide 32" wide opening.</p>	<p>A. (4.17.3). Modify as required. Lounge, employees only.</p> <p>B. (4.17.5). Modify as required. Lounge, employees only.</p>

BUILDING NUMBER: 2070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Library/Main Branch
100 N. Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	C. Grab bars do not exist behind toilets in Men's and Women's first floor (Lobby) and second floor Rest Room stalls, and do not exist at all in first floor Lounge stall.	C. (4.17.6). Install grab bars. Lounge, employees only.
Urinals	Urinals in Men's second floor and Men's Lobby Rest Rooms, have rims too high above floor.	(4.18.2). Replace urinal.
Dispensers	Paper towel dispenser in Lounge Rest Room is too high above floor.	(4.23.7). Employees only.
Mirrors	Mirrors in boy's and girl's Children's Rest Rooms are too high above floor.	(4.19.6). Not designated Handicapped.
Shower Stall	A. There are no grab bars in shower at first floor Lounge.	A. (4.21.4). Employees only.
	B. Proper shower spray unit is not provided in shower of first floor Lounge.	B. (4.21.6). Employees only.
	C. Curb exists at shower of first floor Lounge.	C. (4.21.7). Employees only.
	D. Proper seat is not provided at shower of first floor Lounge.	D. (4.21.3). Employees only.
Elevators	A. Hall lantern, with visual and audible signal, is not provided.	A. (4.10.4). Install as required.
	B. Call Button for main floor is not indicated by a raised star.	B. (4.10.12)(2). Install as required.

BUILDING NUMBER: 2070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Library/Main Branch
100 N. Osceola Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Elevators	C. Reopening device requires contact to reopen, and door does not remain open for at least twenty seconds.	C. (4.10.6). Modify as required.
	D. Braille characters on panels of hoistway entrances are less than 2" high.	D. (4.10.5). Modify as required.

BUILDING NUMBER: 2075
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater East Library
2250 Drew Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(82 Spaces) Four accessible spaces exist, but signage is too low and there is no access aisle between accessible spaces which are side by side.	(4.6.3). Also (4.6.4). Modify parking area as required.
Alarms	Visual Alarm System is not an integrated part of building's Alarm System.	(4.28.1). Install as required.
Telephone	Outside public telephone is not Hearing Aid compatible with volume controls.	(4.31.5)(1)&(2). See Cover Sheet.
Accessible Route	<p>A. Does not exist from door leading outside from Meeting Room "B".</p> <p>B. Does not exist from parking to rear Book Deposit Drop, due to lack of curb ramp.</p>	<p>A. (4.3.2)(2). Provide as required.</p> <p>B. (4.3.2)(2). Also (4.7.1). Provide as required.</p>
Reach Ranges	Rear Book Deposit Drop is too high from ground.	(4.2.6). Modify as required.
Passenger Loading Zones	Curb ramp is not provided and Loading Zone (Main Entrance) does not provide a proper access aisle.	(4.6.6). Provide as required.
Water Fountain	Small fountain in Lobby does not provide proper knee clearance.	(4.15.5)(1). Install Handicapped fountain.
Doors	<p>A. Double doors between Lobby and Meeting Room "A", do not provide 32" opening (neither door).</p> <p>B. West side Emergency Door does not provide 32" opening.</p> <p>C. Exit Door (Emergency) in Meeting Room "B" does not provide 32" opening.</p>	<p>A. (4.13.4). Library Staff to provide assistance.</p> <p>B. (4.13.5). Re-evaluation; meets ADA Standard.</p> <p>C. (4.13.5). Re-evaluation; meets ADA Standard.</p>

BUILDING NUMBER: 2075
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater East Library
2250 Drew Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	A. Sink in Meeting Room "A" does not provide proper knee clearance underneath.	A. (4.24.3). Modify as required.
	B. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	B. (4.24.3). Modify as required.
	C. Sink in Workroom does not provide proper knee clearance.	C. (4.24.3). Employee only.
	D. Sink in Employee Lounge does not provide proper knee clearance.	D. (4.24.3). Employee only.
Reading Tables	Tables in Meeting Room "A" do not provide proper knee clearance. Same situation exists with tables in Youth Section.	(8.2). Also (4.32.3). Designate Handicapped Table when needed.
Aisles	Aisle along East wall, most aisles between Stack, and aisle between Youth Section, (along wall), do not provide 36" openings.	(8.5). Library Staff to provide assistance.
Counters	A. Check-Out Counter does not provide 36" x 36" counter space.	A. (7.2)(1). Modify section as required.
	B. Counter along wall in Workroom does not provide proper knee clearance.	B. (4.32.3). Employee only.
Tables and Desks	A. "Index for Magazine Articles" Desk does not provide proper knee clearance.	A. (4.32.3). Also (8.2). Modify table.
	B. Microfilm Reader/Printer Desk does not provide proper knee clearance.	B. (4.32.3). Also (8.2). Modify table.

BUILDING NUMBER: 2075
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater East Library
2250 Drew Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Card Catalog Computer Desk is too high.	C. (4.32.4). Modify desk.
	D. Computer Desk for Large Print Books does not provide proper knee clearance.	D. (4.32.3). Also (8.2). Modify desk.
Toilet Stalls	Doors to stalls in Men's and Women's Public Rest Rooms and also Men's and Women's Employee Rest Rooms do not provide 32" openings.	(4.17.5). Meets Standards in accordance with UFAS, Article 4.1.6, Sub. F.
Urinals	A. Urinal in Men's Public Rest Room has rim greater than 17" from floor.	A. (4.18.2). Replace as required.
	B. Clear width of passage to urinal in Men's Public Rest Room is less than 36".	B. (4.3.3). Modify as required.
Water Closets	A. Grab bars do not exist in Men's or Women's Employee Rest Rooms.	A. (4.17.6). Install as required.
	B. Toilets in Men's and Women's Employee Rest Rooms are not the proper height.	B. (4.16.3). Replace as required.
Lavatories and Mirrors	A. Sinks in Men's and Women's Employee Rest Rooms have exposed water pipes.	A. (4.19.4). Also (4.24.6). Modify as needed.
	B. Mirrors over sinks in Men's and Women's Employee Rest Rooms are too high.	B. (4.19.6). Lower as required.

BUILDING NUMBER: 2080
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Countryside Library
2742 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	There are no access aisles between accessible spaces which are side by side.	(4.6.3). Modify as required.
Reach Ranges	<p>A. Book Deposit Drop is too high from ground.</p> <p>B. Clear, level ground space is not provided in front of Book Deposit Drop.</p>	<p>A. (4.2.6). Lower Book Drop.</p> <p>B. (4.2.4)(1). Modify as required.</p>
Telephone	Outside Public Telephone is not Hearing Aid compatible with volume controls.	(4.31.5)(1)&(2). See Cover Sheet.
Water Fountain	Small fountain in Lobby does not provide proper knee clearance.	(4.15.5)(1). Install Handicapped fountain.
Doors	<p>A. Double doors to Meeting Room off Lobby do not provide 32" opening; (neither door).</p> <p>B. Threshold on double doors in Workroom is greater than 1/2".</p> <p>C. Doorway leading outside from Meeting Room "B" does not provide 32" opening.</p> <p>D. 2-1/2" step exists at doorway leading outside from Meeting Room "B".</p>	<p>A. (4.13.4). Re-evaluation; meets ADA Standard.</p> <p>B. (4.13.8). Employee only.</p> <p>C. (4.13.5). Re-evaluation; meets ADA Standard.</p> <p>D. (4.13.8). Also (4.5.2). Install exterior ramp.</p>
Alarms	Visual Alarm System is not an integrated part of building's Alarm System.	(4.28.1). Install as required.
Sinks	<p>A. Sink in Employee Lounge has rim too high from floor.</p> <p>B. Sink in Workroom has rim too high from floor.</p> <p>C. Sink in Workroom does not provide proper knee clearance.</p>	<p>A. (4.24.2). Employee only.</p> <p>B. (4.24.2). Employee only.</p> <p>C. (4.24.3). Employee only.</p>

BUILDING NUMBER: 2080
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Countryside Library
2742 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Reading Tables	Tables in Children's Section does not provide proper knee clearance.	(4.32.3). Also (8.2). Not required; designed for children's area only.
Tables and Desks	A. "Index for Magazine Articles" Desk does not provide proper knee clearance.	A. (4.32.3). Also (8.2). Modify as required.
	B. Application Desk does not provide proper knee clearance.	B. (4.32.3). Also (8.2). Modify as required.
	C. Periodical Index Desk does not provide proper knee clearance.	C. (4.32.3). Also (8.2). Modify as required.
	D. Desks in Workroom do not provide proper knee clearance.	D. (4.32.3). Also (8.2). Employee only.
Counters	A. Check-Out Counter does not provide 36" x 36" counter space.	A. (7.2)(1). Also (8.3). Modify as required.
	B. Counter behind Check-Out Counter is too high.	B. (4.32.4). Employee only.
	C. Check-Out Counter is too high.	C. (4.32.4). Modify as required.
	D. Counters in Workroom (on walls) are too high.	D. (4.32.4). Employee only.
	E. Counters in Workroom (on walls) do not provide proper knee clearance.	E. (4.32.3). Also (8.2). Employee only.
	F. Tables in Employee Lounge do not provide proper knee clearance.	F. (4.32.3). Also (8.2). Employee only.
Aisles	Aisles on North wall by shelves, South wall by Children's Section, and between some carrouseles, (fiction cassettes), do not allow 36" clear aisle opening.	(8.5). Library Staff to provide assistance as needed.

BUILDING NUMBER: 2080
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Countryside Library
2742 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	Stall doors in Men's and Women's Public Rest Rooms do not provide 32" opening.	(4.17.5). Meets Standards in accordance with UFAS, Article 4.1.6., Sub. F.
Doors	Doors to Men's and Women's Rest Rooms do not provide 32" opening.	(4.13.5). Meets Standards in accordance with UFAS, Article 4.1.6., Sub. F.
Water Closets	A. Toilets in Men's and Women's Employee Rest Rooms are not the proper height.	A. (4.16.3). Employee only.
	B. Clear floor space (with door opened inward) is not provided in Men's and Women's Employee Rest Rooms.	B. (4.16.2). Employee only.
	C. Grab bars do not exist in Men's or Women's Employee Rest Rooms.	C. (4.16.4). Employee only.
Lavatories and Mirrors	A. Sinks in Men's and Women's Public and Employee Rest Rooms have exposed water pipes.	A. (4.19.4). Employee only.
	B. Mirrors over sinks in Men's and Women's Public and Employee Rest Rooms are mounted too high from floor.	B. (4.19.6). Modify as required.
	C. Sinks in Men's and Women's Public Rest Rooms do not provide proper knee clearance (depth).	C. (4.24.3). Modify as required.
	D. Paper towel dispensers in Men's and Women's Public Rest Rooms are too high.	D. (4.23.7). Also (4.27). Lower as required.

BUILDING NUMBER: 2085
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Greenwood Library
1250 Palmetto Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space, designated by a sign showing the symbol of accessibility, does not exist.	(4.6.2). Also (4.1.2). Modify as required.
Telephone	Outside public telephone is not Hearing Aid compatible, with volume control.	(4.31.5)(1)&(2). See Cover Sheet.
Alarms	Visual Alarm System is not an integrated part of building's Alarm System.	(4.28.1). Install as required.
Reach Ranges	Book Deposit Drop is too high from ground.	(4.2.6). Lower as required.
Accessible Route	A. Clear width of 36" is not provided to get behind main counter (to workroom).	A. (4.3.3). Employees only.
	B. Does not exist from rear Emergency Exit to an accessible walkway.	B. (4.3.2). Install sidewalk.
	C. Does not exist from Exit (by Kitchen) to an accessible walkway.	C. (4.3.2). Install sidewalk.
Water Fountain	Fountain does not provide proper knee clearance.	(4.15.5)(1). Install Handicapped fountain.
Reading/Study Areas	A. Study tables throughout do not provide proper knee clearance.	A. (8.2). Also (4.32.3). Modify table and designate Handicapped.
	B. Computer Card Catalog desk does not provide proper knee clearance.	B. (8.2). Also (4.32.3). Modify as required.
	C. Wall study units do not provide proper knee clearance; (4 units).	C. (8.2). Also (4.32.3). Modify as required.
	D. Book stacks on North side do not provide minimum clear aisle width.	D. (8.5). Staff to provide assistance as needed.

BUILDING NUMBER: 2085
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Greenwood Library
1250 Palmetto Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Rear Emergency Exit Door does not provide 32" opening.	A. (4.13.5). Re-evaluation; meets ADA Standards.
	B. Exit door leading outside from workroom does not provide 32" opening.	B. (4.13.5). Re-evaluation; meets ADA Standards.
	C. Doorway to Rest Room (off Kitchen) does not provide 32" opening.	C. (4.13.5). Employees only.
Sinks	A. Utility sink in Janitor's Closet does not provide proper knee clearance.	A. (4.24.3). Employees only.
	B. Sink in Kitchen does not provide proper knee clearance.	B. (4.24.3). Employees only.
	C. Kitchen sink has rim higher than 34" above floor.	C. (4.24.2). Employees only.
	D. Sink in Rest Room (off Kitchen) has rim higher than 34" above floor.	D. (4.24.2). Employees only.
	E. Mirror over sink in Rest Room (off Kitchen) is too high.	E. (4.19.6). Employees only.
	F. Sink in Rest Room (off Kitchen) has exposed water pipes.	F. (4.19.4). Employees only.
Urinals	Urinal in Men's Public Rest Room has rim greater than 17" from floor.	(4.18.2). Replace urinal.
Toilet Stalls	A. Grab bars in Men's and Women's Public Rest Rooms are too high.	A. (4.17.6). Lower grab bars.

BUILDING NUMBER: 2085
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Clearwater Greenwood Library
1250 Palmetto Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	B. Grab bars in Men's and Women's Public Rest Rooms do not exist behind toilets.	B. (4.17.6). Install grab bars.
	C. Stall doors in Men's and Women's Public Rest Rooms do not provide 32" wide opening.	C. (4.17.5). Modify as required.
	A. Mirrors over sinks in Men's and Women's Public Rest Rooms are too high.	A. (4.19.6). Lower mirrors.
	B. Sinks in Men's and Women's Public Rest Rooms have exposed water pipes.	B. (4.19.4). Also (4.24.6). Modify as required.
	C. Sinks in Women's Public Rest Room have a rim higher than 34" above floor.	C. (4.24.2). Lower sink as required.

BUILDING NUMBER: 2090
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Life Guard Building
Pier 60 Parking Lot

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramps	Not present at entrance or at Rest Rooms.	NOTE: No public access; employees only. (4.71). Also (4.7.6).
Water Fountain	<p>A. Spout is 42" from floor.</p> <p>B. Clear floor space of 30" x 48" is not provided.</p> <p>C. Water flow trajectory is not parallel to the front of the unit.</p>	<p>A. (4.15.2).</p> <p>B. (4.15.5)(2).</p> <p>C. (4.15.3).</p>
Doors	<p>A. Doorways to both Rest Rooms do not provide a minimum clear opening of 32".</p> <p>B. Doorway to shower does not provide a minimum clear opening of 32".</p>	<p>A. (4.13.5).</p> <p>B. (4.13.5).</p>
Lavatories and Mirrors	<p>A. Mirror in Rest Room with shower has bottom edge 54" from floor.</p> <p>B. Both Rest Rooms have exposed water pipes underneath sinks.</p> <p>C. Proper knee clearance (depth) is not provided underneath sinks in either Rest Room.</p> <p>D. Clear floor space in front of sinks is not provided.</p>	<p>A. (4.19.6).</p> <p>B. (4.24.6).</p> <p>C. (4.24.3).</p> <p>D. (4.19.3).</p>

BUILDING NUMBER: 2090
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Life Guard Building
Pier 60 Parking Lot

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are accessible with proper clear floor space.	A. (4.17.3). Also (4.22.4).
	B. Opening to toilet stalls is 23" wide.	B. (4.17.5). Also (4.13.5).
Water Closets	A. No grab bars exist behind or on the side of toilets in either Rest Room.	A. (4.17.6).
	B. Height of toilets in both Rest Rooms is 15-3/4" high.	B. (4.16.3).
Urinal	A. Clear floor space in front of urinals to allow forward approach is not provided.	A. (4.18.3).
	B. Height of urinal is too high for proper accessibility.	B. (4.18.2).
Shower Stall	A. 6" curb exists at shower entrance.	A. (4.21.7).
	B. Seat is not provided.	B. (4.21.3).
	C. Grab bars do not exist.	C. (4.21.4).
	D. Proper shower unit and proper controls at proper height are not provided.	D. (4.21.6). Also (4.21.5).

BUILDING NUMBER: 4010
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Magnolia Street Dock
West End of Magnolia Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist.	(4 . 6 . 2) . A l s o (4.6.3), (4.6.4.), (4.30). NOTE: Parking is not provided for this area.

BUILDING NUMBER: 4020
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Mandalay Pier
West End/Eldorado Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	<p>A. Walkway does not exist through Park (South of Firehouse), from parking or from sidewalk.</p> <p>B. Walkway does not exist through Park (South of Firehouse), to a designated Picnic Bench.</p>	<p>A. (4.3.2)(1). Install sidewalk.</p> <p>B. (4.3.2)(2). Install sidewalk and provide handicapped accessible table.</p>
Ramp	<p>Ramp leading up to Pier has a rise greater than 30"; handrails 40" high.</p>	<p>(4.8.2). Also (4.8.5)(5). Modify as required.</p>
Assembly Area (Benches)	<p>Wheelchair location does not exist by benches at the end of designated walkway next to Pier.</p>	<p>(4.33.3). Designate area.</p>
Drinking Fountains	<p>A. Four fountains exist in combination with showers. Three have no walkways.</p> <p>B. All four fountains do not provide proper clear floor space that allows a person in a wheelchair to make a parallel approach to the unit.</p>	<p>A. (4.3.2)(2). Fountains are being replaced.</p> <p>B. (4.15.5)(2) See A.</p>
Showers	<p>A. Four showers exist in combination with water fountains. Three have no walkways leading to showers.</p> <p>B. All four showers have controls and shower head beyond proper reach ranges.</p> <p>C. Minimum clear floor space is not provided at four drinking fountains/shower units.</p>	<p>A. (4.3.2)(2). Showers are being replaced.</p> <p>B. (4.27.3). Also (4.2.5), (4.2.6), (4.21.6). See A.</p> <p>C. (4.24.1) See A.</p>

BUILDING NUMBER: 4020
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Mandalay Pier
West End/Eldorado Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Ramp (To Rest Rooms)	Has handrails 33" high.	(4.8.5)(5) Raise handrail.
Handrails	Handrails on walkway (designated) by Pier down to beach are 32" high.	(4.8.5)(5). Raise handrail.
Toilet Stalls	A. The size of stalls at Rest Rooms (East side of Parking Lot #36), is not accessible.	A. (4.17.3). Modify as required.
	B. Grab bars behind toilets do not exist.	B. (4.17.6). Install grab bars.
	C. Toe clearance on side portion of stalls is 5".	C. (4.17.4) Modify as required..
Water Closets	Toilet paper dispensers are 26" from floor.	(4.16.6) Lower dispenser.
Sinks (Rest Room)	With knee clearance at only 26" high at sinks, proper clearance is not provided. (East side of Parking Lot #36).	(4.24.3) Modify as required.

BUILDING NUMBER: 4030
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Mandalay Park
Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	<p>A. Does not exist from Parking Lot #38 to playground elements.</p> <p>B. Does not exist from a walkway to Horseshoe Pits.</p>	<p>A. (4.6.2), also (4.3.2)(1). Install sidewalk.</p> <p>B. (4.3.2)(2). Install sidewalk.</p>

BUILDING NUMBER: 4040
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina Building
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Double doors at Main Entrance do not provide at least one leaf that has a 32" wide opening.	A. (4.13.4). Install automatic door openers.
	B. Double doors at Rear Entrance do not provide at least one leaf that has a 32" wide opening.	B. (4.13.4). North entrance will be designated Handicapped Entrance.
	C. All doors (dockside) to Offices and Shops have thresholds greater than 1/2" high.	C. (4.13.8). Install ramps as required.
	D. Door (dockside) leading to second floor Harbormaster Offices does not provide a 32" wide opening.	D. (4.13.5). Employee only.
	E. Doorways throughout "Beach Views" Office do not provide 32" wide opening.	E. (4.13.5). Employee only.
	F. Double doors on second floor by "Beach Views" Office leading to roof has 8" step at threshold.	F. (4.13.8). Modify as required.
	G. Double doors on second floor by "Beach Views" Office leading to roof do not provide at least one leaf that has a 32" wide opening.	G. (4.13.4). Modify as required.
	H. Double doors on second floor by "Beach Views" Office leading to hallway do not provide at least one leaf that has a 32" wide opening.	H. (4.13.4). Remove doors.
	I. Office doors off of second floor hallway do not provide a 32" wide opening.	I. (4.13.5). Modify doors as required.

BUILDING NUMBER: 4040
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina Building
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	J. Double doors on second floor between hallway and Harbormaster's Office, do not have at least one leaf that has a 32" wide opening.	J. (4.13.4). Remove doors.
	K. Door at front of Building leading to second floor has threshold which exceeds 1/2".	K. (4.13.8). Accessible route to 2nd floor provided by lift on East stairwell.
	L. Door at front of Building leading to second floor does not provide a 32" wide opening.	L. (4.13.5). Accessible route to 2nd floor provided by lift on East stairwell.
	M. Front door to Gift Shop does not provide a 32" wide opening.	M. (4.13.5). Designate interior entrance doors as Handicapped accessible.
	N. Doors leading to Offices and Shops in front by parking, have thresholds exceeding 1/2".	N. (4.13.8). Install ramp as required.
	O. Both doors leading to unmarked Rest Room on second floor do not provide 32" opening.	O. (4.13.5). Designate 1st floor bathrooms as Handicapped accessible.
	P. Door at second floor Men's Rest Room does not provide a 32" opening or clear maneuvering space.	P. (4.13.5). Also (4.13.6). Designate 1st floor bathrooms as Handicapped accessible.
	Q. Doorways throughout Marina Building have a door opening force greater than 5 IBF.	Q. (4.13.11). Modify as required.
	R. Door to Dinner Boat (Admiral) Ticket Office has 8" step at threshold.	R. (4.13.8). Employee only.
	S. Door to Dinner Boat (Admiral) Ticket Office does not provide 32" wide opening.	S. (4.13.5). Employee only.

BUILDING NUMBER: 4040
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina Building
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	T. North side door of Bait House does not provide a 32" wide opening.	T. (4.13.5). Area not accessible past entry area; not required. (UFAS, 4.1.4, Ex. 1).
	U. Doorway through small hall (on second floor) leading to Men's Rest Room, does not provide 32" wide opening.	U. (4.13.5). Employee only.
Accessible Route	A. Does not exist to second floor Rest Rooms (Men's and Women's) due to present location of stairway handrail.	A. (4.3.2)(2). Employee only.
	B. Aisles throughout Gift Shop do not provide 36" wide opening.	B. (4.3.3). Lessee responsibility.
Parking	Two accessible spaces share a common access aisle (by Double Eagle Dock), but access aisle is only 50" wide.	(4.6.3). Modify as required.
Alarms	Visual Alarm System is not an integrated part of Building's Alarm System.	(4.28.1). Install as required.
Counters	A. Counter at Dinner Boat (Admiral) Ticket Office does not provide 36" x 36" section.	A. (7.2)(1)&(2). Lessee responsibility.
	B. Counter at second floor "Beach Views" Office does not provide 36" x 36" section.	B. (7.2)(1)&(2). Lessee responsibility.
	C. Counter at second floor Harbormaster's Office does not provide 36" x 36" section.	C. (7.2)(1)&(2). Modify as required.
	D. Counter at second floor Unidentified Rest Room has counter by mirror too high.	D. (4.32.4). Modify as required.
	E. Proper counter arrangement and size is not provided at Snack Bar in Main Lobby.	E. (5.2). Lessee responsibility.

BUILDING NUMBER: 4040
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina Building
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Telephones	Two Public Telephones in Lobby are not Hearing Aid Compatible, nor do they provide volume control.	(4.31.5)(1)&(2). See Cover Sheet.
Stairs	A. Stairs by Docks leading to second floor Harbormaster's Office provide handrails on only one side, and are not continuous.	A. (4.9.4). Install additional handrail.
	B. Stairs from Lobby to second floor have handrails on only one side, and are not continuous.	B. (4.9.4). Wheelchair lift to be installed for access to 2nd floor.
	C. Handrails on East side doors leading to second floor are only on one side, and are not continuous.	C. (4.9.4). Install additional handrail.
Fitting Room	Fitting Room in Gift Shop does not provide proper clear floor space, allowing for a wheelchair to make a 180 degree turn.	(4.35.2). Lessee responsibility.
Drinking Fountain	A. Fountain in second floor hallway has a spout too high from floor.	A. (4.15.2). Install Handicapped fountain.
	B. Fountain in second floor hallway has water flow directed toward rear.	B. (4.15.3). Install Handicapped fountain.
	C. Fountain in Lobby has a spout too high from floor.	C. (4.15.2). Install Handicapped fountain.
	D. Fountain in Lobby has water flow directed toward rear.	D. (4.15.3). Install Handicapped fountain.
Sinks	A. Sink in Room 27 (second floor) does not provide proper knee clearance.	A. (4.24.3). Employee only.
	B. Sink in Conference Room (second floor) does not provide proper knee clearance.	B. (4.24.3). Employee only.

BUILDING NUMBER: 4040
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina Building
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Sink in Unidentified second floor Rest Room does not provide proper knee clearance.	C. (4.24.3). Modify as required.
	D. Sinks in second floor Men's and Women's Rest Rooms do not provide proper knee clearance.	D. (4.24.3). Employee only.
	E. Sinks in first floor Men's and Women's Rest Rooms do not provide proper knee clearance.	E. (4.24.3). Modify as required.
Water Closets	Toilets in Unidentified second floor Rest Room, and second floor Men's and Women's Rest Rooms are not the proper height.	(4.16.3). Modify as required.
Lavatories and Mirrors	A. Mirrors in Unidentified second floor Rest Room, first floor Men's and Women's Rest Rooms, and second floor Men's and Women's Rest Rooms, are too high above floor.	A. (4.19.6). Lower as required.
	B. Exposed water pipes underneath sinks exist in Men's and Women's second floor Rest Rooms.	B. (4.19.4). Employee only.
Urinals	Urinal in Men's first floor Rest Room has rim too high from floor.	(4.18.2). Lower or replace.
Grab Bars	Grab bars do not exist in second floor Unidentified Rest Room.	(4.16.4). Install as required.
Operating Mechanisms	Paper towel dispenser in second floor Unidentified Rest Room is too high from ground.	(4.23.7)&(4.27.3). Lower dispensers.
Toilet Stalls	A. Stall doors in Men's and Women's first floor Rest Rooms, second floor Rest Rooms, and second floor Unidentified Rest Room, do not provide 32" wide opening.	A. (4.17.5). Meets ADA Standards per UFAS 4.1.6, Sub. F.

BUILDING NUMBER: 4040
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina Building
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	B. Grab bars do not exist in second floor Men's and Women's Rest Room stalls.	B. (4.17.6). Employee only.
	C. Second floor Men's and Women's Rest Rooms do not provide proper size and arrangement in any stalls.	C. (4.17.3). Employee only.
	D. Grab bars do not exist behind toilets in Men's and Women's first floor Rest Rooms.	D. (4.17.6). Also (4.16.4). Install as required.
	E. 35-1/2" wide stalls in first floor Men's and Women's Rest Rooms do not provide proper size and arrangement.	E. (4.17.3). Increase width to 36".

BUILDING NUMBER: 4050
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina/Post Office
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counter	Main Counter and Counter for Zip Code Directories do not provide a 36" x 36" section.	(7.2)(1)&(2). Modify as required.
Doors	A. Doorway to Rest Room in Mail Room does not provide a 32" wide opening.	A. (4.13.5). Postal Employees only.
	B. Doorway to Locker Room does not provide a 32" wide opening.	B. (4.13.5). Postal Employees only.
	C. Threshold at Main Entrance exceeds 1/2" in height.	C. (4.13.8). Also (4.13.6). Install ramp as required.
	D. Single door leading to parking does not provide 32" wide opening.	D. (4.13.5). Re-evaluation; meets ADA Standard.
Drinking Fountain	A. Fountain in Mail Room has spout too high from floor.	A. (4.15.2). Postal Employ
	B. Clear floor space is not provided at fountain in Mail Room.	B. (4.15.5)(2). Postal Employees only.
Toilet Stalls	Stall in Mail Room Rest Room is not the proper size and arrangement.	(4.17.3). Postal Employees only.
Sinks	A. Sinks in Mail Room Rest Room and Locker Rooms have exposed pipes underneath sinks.	A. (4.24.6). Postal Employees only.
	B. Proper knee clearance is not provided underneath sink in Locker Room.	B. (4.24.3). Postal Employees only.
Mirrors	Mirror in Mail Room Rest Room is too high from floor.	(4.19.6). Postal Employees only.
Water Closets	Grab bars do not exist in Mail Room Rest Room stall.	(4.17.6). Postal Employees only.

BUILDING NUMBER: 4070
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina/Maintenance Building
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Does not exist into Maintenance area due to slope at doorway exceeding 1:50.	NOTE: No public access; employees only. (4.3.7). Also (4.13.6).

BUILDING NUMBER: 4080
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina/Fuel Dock
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	Doors on Office Building have thresholds greater than 1/2".	(4.13.8). Modify as required.
Counters	Counter in Office Building does not provide a 36" x 36" area on an accessible route.	(7.2)(1)&(2). Modify as required.
Accessible Route	A minimum clear width is not provided inside the Office Building around counters and behind counters.	(4.3.3). Also (4.3.2)(2). Employee only.
Telephone	Public Telephone by Fuel Dock does not provide volume control, nor is it Hearing Aid compatible.	(4.31.5)(1)&(2). See Cover Sheet.

BUILDING NUMBER: 4090
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marshall Street Park
1141 Beckett Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist to designated accessible Picnic Bench.	A. (4.3.2)(2). Install sidewalk.
	B. Does not exist to the three Water Fountains in the Park.	B. (4.3.2)(2). Designate one fountain as handicapped.
	C. Does not exist from walkway to Playground elements.	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist from walkway to Picnic Shelter.	D. (4.3.2)(2). Install sidewalk.
	E. Does not exist from walkway to Utility Building.	E. (4.3.2)(2). Employees only.
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist.	(4.6.2). Also (4.6.3), (4.6.4). Street parking only.
Surface Textures	Surface of Playground is made of wood chips and thus non-accessible.	(4.5.1) N/A, Alters original intent of Building.
Drinking Fountains	A. East fountain has a spout 37" from floor.	A. (4.15.2) Install one handicapped fountain.
	B. West fountain has a spout 38" from floor.	B. (4.15.2). See A.
	C. All three fountains have water flow less than 4" high.	C. (4.15.3). See A.
	D. All three fountains do not provide proper clear floor space that allows a person in a wheelchair to make a parallel approach to the unit.	D. (4.15.5) See A.

BUILDING NUMBER: 4090
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marshall Street Park
1141 Beckett Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

- | | |
|---|-----------------------|
| E. Walkway does not exist to any drinking fountains. | E. (4.3.2)(2). See A. |
| F. All three fountains have spouts located at rear of fountains. | F. (4.15.3). See A. |
| G. All three fountains have water flow not within 3" of front edge of fountain. | G. (4.15.3). See A. |

BUILDING NUMBER: 4200
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Marshall Street
1605 Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Main front door has threshold exceeding 1/2", and does not provide 32" wide opening.	NOTE: No Public access; employees only. A. (4.13.8)&(4.13.5).
	B. Door to outside stairway does not provide 32" wide opening.	B. (4.13.5).
	C. D o o r t o Superintendent's Rest Room does not provide 32" wide opening.	C. (4.13.5).
Water Fountains	Second floor fountain has spout too high above floor.	(4.15.2).
Stairs	A. Handrails on West and East outside stairways are not continuous proper height.	A. (4.9.4)(5).
	B. Stairs on East outside stairway have open risers.	B. (4.9.2).
Sinks	A. Kitchen sink in Lounge does not provide proper knee clearance.	A. (4.24.3).
	B. S i n k i n Superintendent's Rest Room does not provide proper clear floor space (2nd floor).	B. (4.24.5).
	C. Sinks in Men's and Women's second floor Rest Rooms do not provide proper clear floor space.	C. (4.24.5).
	D. Exposed pipes exist underneath sinks in Men's and Women's 2nd floor Rest Rooms.	D. (4.24.6).

BUILDING NUMBER: 4200
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Marshall Street
1605 Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	A. Toilets in Men's, Women's, and Superintendent's Rest Rooms are not the proper height (2nd floor).	A. (4.16.3).
	B. Clear floor space is not provided in Women's or Superintendent's Rest Rooms (2nd floor).	B. (4.16.2).
	C. Grab bars do not exist in Men's, Women's, or Superintendent's Rest Rooms (2nd floor).	C. (4.16.4).
Toilet Stalls	A. Toilet stalls in Men's second floor Rest Room are not proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Men's second floor Rest Room do not provide 32" wide opening.	B. (4.17.5).
	C. Grab bars do not exist in stalls of Men's second floor Rest Room.	C. (4.17.6).
Mirrors	Mirrors over sinks in Men's, Women's, and Superintendent's second floor Rest Rooms are too high above floor.	(4.19.6).
Dispensers	Paper Towel Dispensers in Men's, Women's, and Superintendent's Rest Rooms are too high above floor.	(4.23.7).
Elevators	A. Hall Lantern with visual and audial signal is not provided.	A. (4.10.4).

BUILDING NUMBER: 4200
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Marshall Street
1605 Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Elevators	B. Car Position Indicators are not provided.	B. (4.10.13).
	C. Call Button for Main Floor is not indicated by a Raised Star.	C. (4.10.12)(2).
	D. Proper floor plan is not provided in elevator car, and doorway does not provide 36" opening.	D. (4.10.9).
	E. Reopening device requires contact to reopen, and door does not remain open for at least twenty seconds.	E. (4.10.6).
	F. Braille characters on jambs of hoistway entrances are less than 2" high..	F. (4.10.5).
	Counters	A. Counters throughout Labs are too high above floor.
B. Control Room counters do not provide proper knee clearance.		B. (4.32.3).

BUILDING NUMBER: 4300
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Martin Luther King Center
1201 Martin Luther King Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(86 Spaces) Three accessible spaces exist; four should exist. Of the three accessible spaces, one is without signage and two have signage too low.	(4.6.3). Also (4.1.2)(5B). Modify as required.
Alarms	Visual Alarm System is not an integrated part of building's Alarm System.	(4.28.1). Install as required.
Curb Ramps	<p>A. East-West running curb ramps on North side of building by parking lot has slope too great.</p> <p>B. Threshold at Main Entrance door has step exceeding 1/2".</p> <p>C. Ramp from street to entrance walkway has slope too great.</p> <p>D. Does not exist from parking to North side double doors.</p>	<p>A. (4.7.2). Install curb ramp.</p> <p>B. (4.7.1). Install ramp.</p> <p>C. (4.7.2). Modify as required.</p> <p>D. (4.7.1). Install sidewalk.</p>
Doors	<p>A. Main Entrance door (with bar) does not provide 32" wide opening.</p> <p>B. Doorways to Offices #2 through #8 do not provide 32" wide opening.</p> <p>C. Neither leaf of double doors leading outside from Game Room provide 32" wide opening.</p>	<p>A. (4.13.5). Re-evaluation: Meets A.D. A. standards.</p> <p>B. (4.13.5). Staff to provide assistance in other location as needed.</p> <p>C. (4.13.4). Re-evaluation: Meets A.D.A. standards.</p>

BUILDING NUMBER: 4300
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Martin Luther King Center
1201 Martin Luther King Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD	
Doors	D. Double doors leading outside from Game Room have threshold exceeding 1/2".	D. (4.13.8). Modify as required.	
	E. Doorway between hall and Game Room does not provide 32" wide opening.	E. (4.13.5). Re- evaluation: Meets A.D.A. requirements.	
	F. Rear Exit Door from Game Room does not provide 32" wide opening, and has a threshold exceeding 1/2".	F. (4.13.5)&(4.13.8). Re- evaluation: Meets A.D.A. requirements.	
	G. South Exit Door by Vending Machine does not provide 32" wide opening, and has threshold exceeding 1/2".	G. (4.13.5)&(4.13.8). Modify as required.	
	H. South side double outside doors do not provide 32" wide opening, and have a threshold exceeding 1/2".	H. (4.13.5)&(4.13.8). Re- evaluation: Meets A.D.A. requirements.	
	I. Threshold at double inside doors exceeds 1/2".	I. (4.13.8). Re- evaluation: Meets A.D.A. requirements.	
	J. Two doors into Men's Rest Room by Office #9, and two doors into Women's Rest Room by Office #9, do not provide 32" wide opening.	J. (4.13.5). Modify as required and designate as Handicapped.	
	Accessible Route	A. Rear door from Game Room does not have proper walkway to parking.	A. (4.3.2)(1)&(2). Modify as required.
		B. South side double doors do not have walkway to parking.	B. (4.3.2)(1)&(2). Install sidewalk.

BUILDING NUMBER: 4300
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Martin Luther King Center
1201 Martin Luther King Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Telephones	A. Public Telephone by Game Room has highest operable part beyond Reach Limits.	A. (4.31.3). See Cover sheet.
	B. Public Telephone by Game Room is not Hearing Aid compatible with proper volume control.	B. (4.31.5)(1)&(2). See A.
Counters	A. Main Counter is too high above floor and does not provide 36" x 36" area for wheelchairs.	A. (4.32.4). Also (7.2). Provide accessible area.
	B. Counters over sinks in Women's Rest Room by Office #9 are too high above floor.	B. (4.32.4). Lower counter.
	C. Counters in Kitchen are too high above floor.	C. (4.32.4). Modify section counter.
	D. Counter over sink in Game Room is too high above floor.	D. (4.32.4). Lower counter.
Sinks	A. Sink in Game Room does not provide proper knee clearance.	A. (4.24.3). N/A; Alters original intent of device.
	B. Kitchen sink does not provide proper knee clearance.	B. (4.24.3). Modify as required.
Drinking Fountains	A. Fountain by Vending Machines and fountain by Game Room have spouts too high above floor.	A. (4.15.2). Install Handicapped fountain.
	B. Fountains by Game Room, in hall by phone, and by Vending Machines, have water flow toward rear.	B. (4.15.3). See A.
	C. Fountains by Vending Machines and by Game Room, do not provide clear floor space.	C. (4.15.5)(2). See A.

BUILDING NUMBER: 4300
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Martin Luther King Center
1201 Martin Luther King Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	A. Toilets in Men's and Women's Rest Rooms off Pool Room and by Office #9, are not the proper height.	A. (4.16.3). Replace toilets as required.
Toilet Stalls	A. There are no stalls in Men's and Women's Rest Rooms off Pool Room, and by Office #9, that are the proper size and arrangement.	A. (4.17.3). Modify as required.
	B. Toilet stall doors in Men's and Women's Rest Rooms by Pool Room, and in Men's and Women's Rest Rooms by Office #9, do not provide 32" wide opening.	B. (4.17.5). Modify as required.
	C. Grab bars do not exist in stalls of Men's and Women's Rest Rooms by Pool Room, and in Men's and Women's Rest Rooms by Office #9.	C. (4.17.6). Install grab bars.
Urinal	Urinals in Men's Rest Room by Pool Room and in Men's Rest Room by Office #9, have rims too high above floor.	(4.18.2). Replace urinal.
Lavatories/Mirrors	A. Mirrors in Men's and Women's Rest Rooms by Office #9 are too high above floor.	A. (4.19.6). Lower mirrors.
	B. Exposed pipes underneath sinks exist in Men's and Women's Rest Rooms by Office #9.	B. (4.19.4). Modify as required.
Dispensers	Paper towel dispensers in Men's and Women's Rest Rooms by Pool Room are too high above floor.	(4.23.7). Lower dispensers.

BUILDING NUMBER: 4305
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marvmont Park
1900 Gilbert Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist.	(4 . 6 . 2) . A l s o (4.6.3), (4.6.4), (4.30). Modify as required.
Accessible Route	A. Does not exist from sidewalk into facility.	A. (4.3.2). Install sidewalk.
	B. Does not exist from parking to Basketball Court.	B. (4.3.2). Install sidewalk.
	C. Does not exist from an accessible walkway to Bleachers.	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist from an accessible walkway to Picnic Shelter.	D. (4.3.2)(2). Install sidewalk.
	E. Does not exist from an accessible walkway to Playground.	E. (4.3.2)(2). Install sidew
Assembly Area (Bleachers)	Wheelchair location does not exist at Bleachers.	(4.33.3). Also (A4.33), (A4.33.3). Designate area.
Drinking Fountain	A. Water fountain not parallel trajectory to the front of the unit.	A. (4.15.3). Install Handicapped fountain.
	B. Fountain leaks, making surface around fountain slippery.	B. (4.5.1). See A.
Rest Rooms	Not accessible from an accessible walkway connecting other elements of the Park.	(4.3.2)(2). NOTE: Structural impracticality; UFAS, 4.1.6, (Exceptions, 5A).

BUILDING NUMBER: 4305
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marvmont Park
1900 Gilbert Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>A. There is no stall in Men's or Women's Rest Room that is accessible.</p> <p>B. Grab bars do not exist in any stall.</p>	<p>A. (4.17.3). Also (4.22.4).</p> <p>B. (4.17.6).</p>
Water Closet	<p>A. Height of toilets in both Men's and Women's Rest Rooms is 16" from floor.</p>	<p>A. (4.16.3).</p>
Doors	<p>A. Doorways into both Rest Rooms do not allow proper wheelchair passage width. (Now 30" and 29-1/2").</p> <p>B. Clearance between wall and stall side is 27-3/4" in Women's Rest Room, and 25-1/4" in Men's Rest Room. (Passage way).</p>	<p>A. (4.21). Also (4.13.6).</p> <p>B. (4.2.1). Also (4.13.6).</p>
Sinks	<p>Sinks in both Men's and Women's Rest Rooms have exposed water pipes.</p>	<p>(4.24.6).</p>

BUILDING NUMBER: 4310
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: McKay Field
615 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist from Parking Lot #39 to Field. (Sideline wheelchair location).	A. (4.3.2)(1)(2). Also (4.33.3). Install sidewalk.
	B. Does not exist from sidewalk to Field. (Sideline wheelchair location).	B. (4.3.2)(1)(2). Also (4.33.3). Install sidewalk.
	C. Does not exist to Lawn Bowling Court.	C. (4.3.2)(2). Install sidewalk.

BUILDING NUMBER: 4315
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: McMullen Tennis Park
1000 Edenville Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(46 Spaces) Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist.	(4.6.2). Also (4.1.2). Modify as required.
Accessible Route	<p>A. Does not exist from walkway and parking to "Game Field" Fitness Course.</p> <p>B. Picnic Tables throughout Complex do not have accessible walkways from main walkway.</p>	<p>A. (4.3.2)(2). Install sidewalk.</p> <p>B. (4.3.2)(2). Designate one picnic table area as Handicapped accessible.</p>
Counters	<p>A. Office counters do not provide a 36" x 36" section for wheelchair accessibility.</p> <p>B. Office counters do not provide proper knee clearance (behind counter).</p>	<p>A. (7.2). Office Staff to provide assistance as needed.</p> <p>B. (4.32.3). Employees only.</p>
Drinking Fountains	<p>A. Fountain by Main Entrance does not provide proper knee clearance.</p> <p>B. Fountain by Main Entrance has spout too high from the ground.</p> <p>C. Drinking fountain by Concession Area does not provide proper knee clearance.</p> <p>D. Fountain by Concession Area has spout too high from the ground.</p>	<p>A. (4.15.5)(1)&(2). Designated Handicapped fountain located on South end.</p> <p>B. (4.15.2). Designated Handicapped fountain located on South end.</p> <p>C. (4.15.5)(1)&(2). Install Handicapped fountain.</p> <p>D. (4.15.2). Install Handicapped fountain.</p>

BUILDING NUMBER: 4315
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: McMullen Tennis Park
1000 Edenville Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Telephones	A. Public Telephone by Main Entrance is not Hearing Aid compatible nor does it have a volume control.	A. (4.31.5)(1)&(2). See Cover Sheet.
	B. Public Telephone by Main Entrance does not provide proper clear floor space.	B. (4.31.2). See Cover Sheet.
Doors	A. Thresholds at doors to Men's and Women's Locker Rooms exceed 1/2".	A. (4.13.8). Modify as required.
	B. Door at Main Entrance has threshold greater than 1/2".	B. (4.13.8). Modify as required.
Tables	Tables at Concession Area do not provide proper knee clearance.	(4.32.3). Provide accessible table.
Accessible Route	A. Does not exist to West Courts bleacher section.	A. (4.3.2)(2). Install sidewalk.
	B. Does not exist to walled Practice Area.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist from walkway to Utility Buildings.	C. (4.3.2)(2). Employees only.
Assembly Areas (Bleachers)	Wheelchair locations do not exist at either bleacher section by Courts.	(4.33.3). Allocate space for wheelchairs.
Water Closets	Toilets in Men's and Women's Locker Rooms are not the proper height.	(4.16.3). Replace as required.
Toilet Stalls	A. There are no toilet stalls in Men's or Women's Locker Rooms that are the proper size and arrangement.	A. (4.17.3). Modify as required.

BUILDING NUMBER: 4315
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: McMullen Tennis Park
1000 Edenville Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	B. Stall doors in Men's and Women's Locker Rooms do not provide 32" wide opening.	B. (4.17.5). Widen doors as required.
	C. Grab bars do not exist in any stall in Men's or Women's Locker Rooms.	C. (4.17.6). Install grab bars as required.
Urinals	Urinal in Men's Locker Room has a rim higher than 17" from floor.	(4.18.2). Replace urinal.
Sinks	Sinks in Men's Locker Room do not provide proper knee clearance.	(4.24.3). Modify as required.
Lavatories and Mirrors	A. Mirrors over sinks in Men's and Women's Locker Rooms are too high from floor.	A. (4.19.6). Lower mirrors as required.
	B. Exposed water pipes underneath sinks in Men's and Women's Locker Rooms exist.	B. (4.19.4). Modify as required.
Accessible Route	Barrier wall at entrance to Women's Locker Room prohibits a minimum clear width of 36" for accessible entrance.	(4.3.3). Modify wall to allow clearance.
Shower Stalls	A. Shower stalls in Women's Locker Room do not provide the proper size and clearances.	A. (4.21.2). Modify one shower in each bathroom.
	B. Curbs exist at entrance to shower rooms in Men's and Women's Locker Rooms.	B. (4.21.7). Remove curbs.

BUILDING NUMBER: 4315
TARGET DATE: 1993
COMPLETED: 00/00/00

BUILDING LOCATION: McMullen Tennis Park
1000 Edenville Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Seats are not provided in shower stalls in Women's Locker Room, nor in shower room in Men's Locker Room.	C. (4.21.3). Install seats as required.
	D. A proper shower spray unit does not exist at showers in Men's or Women's Locker Rooms.	D. (4.21.6). Install hand-held shower device.

BUILDING NUMBER: 4320
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Memorial Park South
Pierce & Cleveland Streets

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

No Renovation Needed.

BUILDING NUMBER: 4330
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Moccasin Lake Park
2750 Park Trail Lane

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	One accessible space exists but signage is too low.	(4.6.4). Modify as required.
Accessible Route	A. Walkway around main building is not continuous 36" wide and needs curb ramps where walkway crosses a curb.	A. (4.3.2)(2). Also (4.7.1). Modify as required.
	B. Does not exist to a designated picnic grill with proper floor space.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist to Water Tower Exhibit.	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist from walkway to camp fire site (wooden benches), to the left of Main Building.	D. (4.3.2)(2). Install sidewalk.
	E. Walkway by Recycleable Bins next to Picnic Shelter, does not extend close enough to Bin to be within proper reach ranges.	E. (4.3.2)(2). Also (4.2.4.1) & (4.2.5). Relocate Bins.
Counter	Counter in Main Lobby is 42" above the ground.	(7.2)(2). Staff to provide assistance as needed.
Drinking Fountain	A. Fountain on path does not provide proper clear floor space.	A. (4.15.5)(2). Install Handicapped fountain.
	B. Fountain on path has a spout 40" from ground.	B. (4.15.2). Install Handicapped fountain.
Assembly Area	Wheelchair locations do not exist at camp fire area (wooden benches).	(4.33.3). Designate area and install platform.

BUILDING NUMBER: 4330
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Moccasin Lake Park
2750 Park Trail Lane

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sink	A. Sink in Animal Diet Preparation Room does not provide proper knee clearance.	A. (4.24.3). Employee only.
	B. Sink in Animal Diet Preparation Room is 37" from rim to floor.	B. (4.24.2). Employee only.
Ground and Floor Surfaces	A. Wooden ramp to Rest Rooms should have slip-resistant strips.	A. (4.5.1). Install slip-resistant material.
	B. None of the trails are made of stable, firm, and slip-resistant material.	B. (4.5.1). Also (4.3.2)(2). No modifications at this time; UFAS, 4.1.6 (Exceptions).
Stairs	A. Stairs at Rest Rooms leading to paths have open risers.	A. (4.9.2). Close in risers.
	B. Stairs at Rest Rooms leading to paths have handrails 41" - 43" above nosings. (Two sets of stairs).	B. (4.9.4)(5). Lower handrails.
Doors	A. Threshold of double doors at Main Entrance is greater than 1/2".	A. (4.13.8). Modify as required.
	B. Doorway leading outside from Main Lobby does not provide 32" opening.	B. (4.13.5). Re-evaluation; meets ADA Standard.
	C. Doorway leading outside from Main Lobby has threshold greater than 1/2".	C. (4.13.8). Modify as required.
	D. There are two screen doors of the screened room area of the Main Building that do not provide 32" openings.	D. (4.13.5). Modify one door as required.
	E. Inside door behind counter does not provide 32" opening.	E. (4.13.5). Staff only.

BUILDING NUMBER: 4330
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Moccasin Lake Park
2750 Park Trail Lane

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	F. Door leading outside from behind counter does not provide 32" opening.	F. (4.13.5). Employee only.
	G. Door leading outside from behind counter has a threshold greater than 1/2".	G. (4.13.8). Employee only.
	H. Door to Animal Diet Preparation Room does not provide 32" opening.	H. (4.13.5). Employee only.
	I. Doorway to Park Supervisor's Office has a 5" curb at threshold.	I. (4.7.1). Employee only.
	J. There are two screen doors of the screened room area of the Main Building that have thresholds greater than 1/2".	J. (4.13.8). Modify as required.
Handrails	Ramped walkway to Rest Rooms has handrails 39" high.	(4.8.5)(5). Lower handrails.
Lavatories and Mirrors	A. Sinks in Men's and Women's Rest Rooms have exposed water pipes.	A. (4.24.6). Modify as required.
	B. Mirrors in both Men's and Women's Rest Rooms are 50" above floor.	B. (4.19.6). Lower mirrors.
	C. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	C. (4.24.3). Modify as required.
Toilet Stalls	A. Grab bars do not exist behind toilets in Men's or Women's Rest Rooms.	A. (4.17.6) (Figure 29), Install grab bars.

BUILDING NUMBER: 4330
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Moccasin Lake Park
2750 Park Trail Lane

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Boardwalk	<p>B. There are no stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.</p> <p>C. Clear floor space in front of toilets is not the proper size in Men's or Women's Rest Rooms.</p> <p>Boardwalks and wooden bridges throughout trails have no handrails.</p>	<p>B. (4.17.3)(Figure 30). Rearrange stalls to meet ADA Standard without altering original intent of building.</p> <p>C. (4.17.2). Also (4.16.2). Rearrange stalls to meet ADA Standard without altering original intent of building.</p> <p>(4.8.5). No modification at this time; USAF, 4.1.6 (Exceptions).</p>

BUILDING NUMBER: 4335
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Montclair Park
1821 Montclair Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist from walkway to Handball Courts. B. Does not exist from walkway to at least one accessible Picnic Bench. C. Does not exist from walkway into Playground area.	A. (4.3.2)(2). Install sidewalk. B. (4.3.2)(2). Install sidewalk and designated Handicapped table. C. (4.3.2)(2). Install sidewalk.

BUILDING NUMBER: 4340
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside/Handball Courts
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Proper walkways do not connect other facilities of the Complex to Handball Courts.	A. (4.3.2)(2). Install sidewalk.
	B. Walkway does not connect Handball Courts with drinking fountain.	B. (4.3.2)(2). Install sidewalk.
Drinking Fountain	A. Fountain by Courts has spout too high above ground.	A. (4.15.2). Install Handicap fountain.
	B. Proper clear floor space and knee clearance are not provided at fountain by Courts.	B. (4.15.5)(2). See A.

BUILDING NUMBER: 4345
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside Center/Pool
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Two spaces exist, but signage is too low and an access aisle between spaces should exist.	(4.6.2),(4.6.3),(4.6.4). Modify as required.
Ramps	A. Ramp should exist from parking to building. With present slope of walkways by Pool, entrance accessible route is not provided.	A. (4.8.1). Install ramp.
	B. Ramp should exist from Office and Shower, uphill to Pool area. With present slope of walkway up to Pool, an accessible route is not provided.	B. (4.8.1). Install ramp.
Curb Ramps	A. Two doors of office do not have proper curb ramp where step now exists.	A. (4.7.1). Employees only.
	B. Two outside East doors do not have proper curb ramps.	B. (4.7.1). Install curb ramp.
Counters	Front Counters too high above floor and do not provide 36" x 36" area (at Office).	(4.32.4)&(7.2). Modify section of counter.
Drinking Fountains	Outside fountains (side by side), do not provide proper knee clearance.	(4.15.5)(1). Install Handicapped fountain.
Doors	Thresholds at doors to Men's and Women's Rest Rooms/Showers exceed 1/2".	(4.13.8). Modify as required.

BUILDING NUMBER: 4345
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside Center/Pool
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Accessible walkways do not connect Pool with Volleyball Courts, Basketball Courts, Playground, Swing and Slide area, Handball Courts, Tennis Courts, and to Picnic Tables (with proper clear floor space) at East of Pool.	A. (4.3.2)(2). Install sidewalk and designate Handicapped table.
	B. Minimum clear width is not provided at aisles in Men's Rest Room.	B. (4.3.3). Modify as required.
	C. Minimum clear width is not provided at entrance to Women's Rest Room, due to present location of barrier walls.	C. (4.3.3). Modify as required.
Ground Surfaces	Surfaces of Swing and Slide areas covered with wood chips, and surface of Volleyball Court and Playground is sand.	(4.5.1). N/A; alters original intent of facility. (4.3.6).
Sinks	A. Two sinks in Men's Rest Room do not provide proper knee clearance.	A. (4.24.3). Modify as required.
	B. Exposed pipes exist underneath sinks in Men's and Women's Rest Rooms.	B. (4.24.6). Modify as required.
	C. Sink in Women's Rest Room does not provide proper knee clearance.	C. (4.24.3). Modify as required.
Water Closets	Toilets in Men's and Women's Rest Rooms are not the proper height.	(4.16.3). Replace toilets.

BUILDING NUMBER: 4345
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside Center/Pool
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3). Modify as required.
	B. Grab bars do not exist at any stalls in Men's and Women's Rest Rooms.	B. (4.17.6). Install grab bars.
	C. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	C. (4.17.5). See A.
Mirrors	Mirrors over sinks in Men's and Women's Rest Rooms are too high above floor.	(4.19.6). Lower mirrors.
Shower Stalls	A. Curbs exist at Men's and Women's stalls.	A. (4.21.7). Modify shower a
	B. Proper seats are not provided in Men's and Women's Rest Rooms.	B. (4.21.3). See A.
	C. Grab bars do not exist in Men's and Women's stalls.	C. (4.21.4). See A.
	D. Proper shower spray unit is not provided in Men's and Women's Rest Rooms.	D. (4.21.6). See A.
	E. Proper shower spray unit is not provided at outside Pool shower.	E. (4.21.6). See A.
Fixed Seating	Picnic Tables in Training Pool area do not provide proper knee clearance.	(4.32.3). Designate one table as Handicapped.

BUILDING NUMBER: 4350
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside/Tennis Courts
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Drinking Fountain	A. Spout at Tennis Court fountain is too high above ground.	A. (4.15.2). Install Handicapped fountain.
	B. Tennis Court fountain does not provide proper clear floor space and knee clearance.	B. (4.15.5)(2). See A.
Accessible Route	A. Walkway does not connect Tennis Court with drinking fountain.	A. (4.3.2)(2). Install sidewalk.
	B. Proper walkways do not connect other facilities of the Complex to Tennis Court.	B. (4.3.2)(2). Install sidewalk.
	C. Walkway from parking to Tennis Courts has slope too great.	C. (4.3.7)&(4.3.8). Modify as Required.

BUILDING NUMBER: 4355
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside Recreation Cent
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(48 Spaces) Two accessible with signage too low; spaces are on a slope exceeding 1:50, and access aisle should be between spaces.	(4.6.4)&(4.6.3). Modify as required.
Curb Ramps	Surface where access aisle and walkway to Main Entrance meet, is uneven and rough.	(4.7.4). Modify as required.
Ramp	Walkway from first floor outside terrace leading to parking has slope too great and needs ramp.	(4.8.1). Not designated as Handicapped entrance.
Doors	A. Maneuvering clearance to main front door does not exist because slope exists in front of doorway.	A. (4.13.6). Modify as required.
	B. Threshold at Main Entrance door exceeds 1/2".	B. (4.13.8). Modify as required.
	C. Double inside doors to Pottery Room has neither leaf providing 32" wide opening.	C. (4.13.4). Staff to provide assistance as needed.
	D. Double outside doors between Pottery Room and dock have neither leaf providing 32" wide opening, and threshold exceeding 1/2".	D. (4.13.4)&(4.13.8). Employees only.
	E. Two doors on dock have thresholds exceeding 1/2".	E. (4.13.8). Employees only.
	F. Doors at Men's and Women's Pottery Room Rest Rooms do not provide 32" wide opening.	F. (4.13.5). Not designated as Handicapped.

BUILDING NUMBER: 4355
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside Recreation Center
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	G. Double doors of Art Room leading to North exit doors have neither leaf providing 32" wide opening.	G. (4.13.4). Staff to provide assistance as needed.
	H. Inside Art Room doors to storage have neither leaf providing 32" wide opening.	H. (4.13.4). Employees only.
	I. North side exit door by Rest Rooms does not provide 32" wide opening, and has threshold exceeding 1/2".	I. (4.13.5)&(4.13.8). Not designated as Handicapped.
	J. West exit door from Pool Room does not provide 32" opening and has threshold exceeding 1/2".	J. (4.13.5)&(4.13.8). Not designated as Handicapped.
	K. Men's and Women's Rest Room doors (2 doors in a series at each), do not provide minimum space between doors, and do not provide proper 32" wide opening; (by North exit door).	K. (4.13.7)&(4.13.5). Not designated as Handicapped.
	L. First floor exit door at bottom of inside Southeast stairway does not provide 32" opening, and has threshold exceeding 1/2".	L. (4.13.5)&(4.13.8). Modify as required.
	M. Doorway (from Southeast inside stairway) into Meeting Rooms of first floor, does not provide 32" opening and has a threshold exceeding 1/2".	M. (4.13.5)&(4.13.8). Re-evaluation; meets ADA Standards.

BUILDING NUMBER: 4355
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside Recreation Cent
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	N. Double doors from first floor Lobby into Meeting Rooms have neither leaf providing 32" wide opening.	N. (4.13.4). Re-evaluation; meets ADA Standards.
	O. Door into first floor Rest Room by Kitchen does not provide 32" opening.	O. (4.13.5). Modify as required.
	P. Four exit doors of first floor Meeting Rooms leading to terrace, do not provide 32" wide opening (with bars), and have thresholds exceeding 1/2".	P. (4.13.5)&(4.13.8). Re-evaluation; meets ADA Standards.
Water Fountains	A. Fountain in Lobby has spout too high above floor.	A. (4.15.2). Install paper dispenser.
	B. Fountain in Lobby has water flow not within 3" of fountain edge.	B. (4.15.3). See A.
	C. Fountain by North exit door (second floor), does not provide proper knee clearance.	C. (4.15.5)(1). Install paper cup dispenser.
Counters/Tables	A. Counter at first floor Lobby is too high above floor.	A. (4.32.4). Lower counter.
	B. First floor terrace metal tables do not provide proper knee clearance.	B. (4.32.3). Modify and designate one table.
Stairs	A. Dock stairway does not provide proper handrails.	A. (4.9.4)(1-7). Employees only.
	B. Stairs from North exit door do not provide proper continuous handrails.	B. (4.9.4)(1). Not designated Handicapped entrance.

BUILDING NUMBER: 4355
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside Recreation Center
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	C. Stairs from West exit door do not provide proper continuous handrails at proper height.	C. (4.9.4)(1)&(5). Not designated Handicapped entrance.
	D. Inside Southeast stairway from Meeting Room has handrails too high and not continuous.	D. (4.9.4)(5)(1). Lower handrails.
Accessible Route	Passage in front of Men's and Women's Rest Rooms by North exit door, does not provide minimum clear width of 36".	(4.3.3). Not designated Handicapped entrance.
Ramp	Does not exist at North exit door; walkway and porch have level changes (2 steps).	(4.8). Not designated Handicapped entrance.
Sinks	A. Sinks in Men's and Women's Rest Rooms off Pottery Room, and Men's Rest Room in Art Room, do not provide proper clear floor space.	A. (4.24.5). N/A; alters original intent of device. (4.1.6).
	B. Sinks in Men's and Women's Lobby Rest Rooms, first floor Rest Room by Kitchen, first floor Kitchen sink, and utility sink in first floor pink Meeting Room, do not provide proper knee clearance.	B. (4.24.3). Modify as required.
	C. Exposed water pipes exist underneath sinks in Men's and Women's Rest Rooms by Pottery Room, and Men's and Women's Rest Rooms by Art Room.	C. (4.24.6). Modify as required.

BUILDING NUMBER: 4355
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside Recreation Center
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Mirrors	Mirrors over sinks in Men's and Women's Lobby Rest Rooms are too high above floor.	(4.19.6). Lower mirrors.
Water Closets	A. Toilets in Men's and Women's Pottery Rest Rooms, Art Rest Rooms, Lobby Rest Rooms, and in first floor Rest Room by Kitchen, are not the proper height. B. Grab bars do not exist in Rest Room by first floor Kitchen.	A. (4.16.3). Replace toilets in Lobby Rest Room. Others, not designated Handicapped. B. (4.16.4). Not designated Handicapped.
Toilet Stalls	A. There are no stalls in Men's and Women's Pottery Rest Rooms, Art Room Rest Rooms, and Lobby Rest Rooms, that are the proper size and arrangement. B. Stall doors in Men's and Women's Pottery Rest Rooms, Art Room Rest Rooms, and Lobby Rest Rooms, do not provide 32" wide opening. C. Grab bars do not exist in stalls of Men's and Women's Pottery Rest Rooms, Art Room Rest Rooms, and Lobby Rest Rooms.	A. (4.17.3). Modify Lobby Rest Rooms. Others, not designated Handicapped. B. (4.17.5). See A. C. (4.17.6). Install grab bars in Lobby Rest Rooms.
Dispensers	Paper towel dispensers in Men's and Women's Lobby Rest Rooms are too high above floor.	(4.23.7). Lower dispensers.
Shower Stalls	A. Stall door at shower in first floor Rest Room by Kitchen does not provide 32" wide opening.	A. (4.13.5). Not designated Handicapped.

BUILDING NUMBER: 4355
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Morningside Recreation Center
2400 Harn Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	B. Curb exists at stall in first floor Rest Room by Kitchen.	B. (4.21.7). See A.
	C. Proper seat is not provided in stall at first floor Rest Room by Kitchen.	C. (4.21.3). See A.
	D. Proper shower spray unit is not provided at stall in first floor Rest Room by Kitchen.	D. (4.21.6). See A.
	E. Proper size and clearances are not provided in stall at first floor Rest Room by Kitchen.	E. (4.21.2). See A.
	Alarms	Visual Alarm System is not an integrated part of building's Alarm System.

BUILDING NUMBER: 4500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Two spaces exist, but both have signage too low. Access aisle between spaces should exist.	NOTE: No Public access; employees only. (4.6.3), (4.6.4).
Curb Ramp	<p>A. Does not exist where walkway to entrance and parking access aisle meet.</p> <p>B. Rear Exit Door of hallway by first floor Rest Rooms needs curb ramp where step exists at threshold.</p>	<p>A. (4.7.1).</p> <p>B. (4.7.1).</p>
Doors	<p>A. Main Entrance door (with bar) does not provide 32" wide opening, and threshold exceeds 1/2".</p> <p>B. First floor doorway leading to Rest Rooms does not provide 32" wide opening.</p> <p>C. Two doorways leading to first floor Women's Rest Room do not provide 32" wide opening.</p> <p>D. Two doorways leading to first floor Men's Rest Room do not provide 32" wide opening.</p> <p>E. Rear Exit Door of hallway by first floor Rest Rooms does not provide 32" wide opening.</p>	<p>A. (4.13.5)&(4.13.8).</p> <p>B. (4.13.5).</p> <p>C. (4.13.5).</p> <p>D. (4.13.5).</p> <p>E. (4.13.5).</p>

BUILDING NUMBER: 4500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	F. Doorways to Men's and Women's second floor Rest Rooms do not provide 32" wide opening.	F. (4.13.5).
	G. Two doorways of Bacteria Room do not provide 32" wide opening.	G. (4.13.5).
Sinks	A. Second floor Men's and Women's Rest Room sinks do not provide proper knee clearance.	A. (4.24.3).
	B. Sink in AAGC Room does not provide proper knee clearance.	B. (4.24.3).
Stairs	North and South stairway handrails are not continuous proper height.	(4.9.4)(5).
Doors	A. North and South stairway doors (top) do not provide 32" wide opening.	A. (4.13.5).
	B. Door opening force on North and South stairway (top) doors exceeds 5 LBF.	B. (4.13.11).
Drinking Fountains	A. Spout is too high above floor on first and second floor fountains.	A. (4.15.2).
	B. Proper knee clearance is not provided on first and second floor fountains.	B. (4.15.5)(1).
	C. First floor fountain does not provide clear floor space.	C. (4.15.5)(2).

BUILDING NUMBER: 4500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	Toilets in Men's and Women's first and second floor Rest Rooms are not the proper height.	(4.16.3).
Toilet Stalls	<p>A. There are no stalls in Men's and Women's first and second floor Rest Rooms that are the proper size and arrangement.</p> <p>B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.</p> <p>C. Grab bars do not exist in Men's and Women's second floor Rest Rooms, and are not behind toilets in Men's and Women's first floor Rest Rooms.</p>	<p>A. (4.17.3)&(4.16.2).</p> <p>B. (4.17.5).</p> <p>C. (4.17.6). Also (4.16.4).</p>
Urinals	Urinals in Men's first floor Rest Room have rims too high above floor.	(4.18.2).
Lavatories/Mirrors	<p>A. Exposed pipes exist underneath sinks in Men's and Women's first and second floor Rest Rooms.</p> <p>B. Mirrors in Men's and Women's first and second floor Rest Rooms are too high above floor.</p>	<p>A. (4.19.4).</p> <p>B. (4.19.6).</p>
Shower Stalls	<p>A. Grab bars do not exist in Men's and Women's first floor Rest Room shower.</p> <p>B. Curb exists at entrances to Men's and Women's first floor Rest Room showers.</p>	<p>A. (4.21.4).</p> <p>B. (4.21.7).</p>

BUILDING NUMBER: 4500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	C. Proper seat is not provided in any stalls in Men's and Women's first floor Rest Room shower.	C. (4.21.3).
	D. Proper shower spray unit does not exist in any stall in Men's and Women's first floor Rest Room showers.	D. (4.21.6).
Accessible Route	Door to Women's shower stalls in first floor Shower Rest Room, does not provide minimum clear width of 36".	(3.3.3).
Elevators	A. Hall lantern is not provided. Visual and Audible Signal is not provided.	A. (4.10.4).
	B. Car position indicators are not provided.	B. (4.10.13).
	C. Call button for Main Floor is not indicated by a raised star.	C. (4.10.12)(2).
	D. Proper floor plan is not provided in elevator car.	D. (4.10.9).
	E. Reopening device requires contact to reopen, and device does not remain open for at least twenty seconds.	E. (4.10.6).
	F. Braille characters on jams of hoistway entrance are less than 2" high.	F. (4.10.5).

BUILDING NUMBER: 4600
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Nursery Building
901 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space, designated by a sign showing the symbol of accessibility, does not exist.	NOTE: No Public access; employees only. (4.6.2).
Doors	A. Door to Men's Rest Room does not provide 32" opening.	A. (4.13.5).
	B. With refrigerator in present location, a clear width of 32" is not provided at Women's Rest Room door.	B. (4.13.5).
Accessible Route	Walkway leading from East office door is a rough surface where walkway and drive meet.	(4.5.1).
Water Fountains	A. Spout on water fountain is 42-1/2" from ground.	A. (4.15.2).
	B. Water flow on fountain is toward rear.	B. (4.15.3).
	C. Fountain does not provide proper clear floor space (with counter in present location).	C. (4.15.5)(1).
Toilet Stalls	A. Both Men's and Women's Rest Rooms do not provide proper clear floor space.	A. (4.17.3), (4.16.2).
	B. Toilets in both Men's and Women's Rest Rooms are not between 17" and 19" high.	B. (4.16.3).
	C. Grab bars do not exist in Men's or Women's Rest Rooms.	C. (4.16.4).
Urinal	Rim is 40" from floor.	(4.18.2).

BUILDING NUMBER: 4600
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Nursery Building
901 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	A. Proper knee clearance is not provided at sinks in both Men's and Women's Rest Rooms. B. Sinks in Men's and Women's Rest Rooms have exposed water pipes underneath.	A. (4.19.2) (Figure 31). B. (4.19.4).
Sink	Utility sink has a rim 40" high and does not provide proper knee clearance.	(4.24.2). Also (4.24.3).
Reach Ranges	Towel dispenser next to utility sink exceeds forward or side reach maximums.	(4.2.6). Also (4.2.5).
Shower Stall	A. Curb into stall exceeds 1/2" height maximum. B. A shower spray unit with a hose 60" long, that can be used as a fixed head or hand-held shower, is not provided.	A. (4.21.7). B. (4.21.6).

BUILDING NUMBER: 4605
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Nursery/Chemical Storage
901 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Accessible Route	A. Does not exist via an accessible walkway.	NOTE: No Public access; employees only. A. (4.3.2)(2). B. (4.3.2)(1).
	B. Does not exist from transportation (Bus Stop) to entrance.	

BUILDING NUMBER: 4610
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Old Williams School Lot
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

No renovation needed.

BUILDING NUMBER: 4615
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Park Street Garage
613 Park Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD	
Parking	(409 Spaces) Six accessible spaces exist, but signage is too low. With four hundred nine spaces, nine accessible spaces should exist.	(4.6.4) (4.1.2).	Modify as required.
Accessible Route	Does not exist to allow person in wheelchair access into ticket booth.	(4.3.2)(2).	Employees only.
Door Opening Force	Door leading to elevator door on Level 4 takes more than 5 IBF to open.	(4.13.11).	Adjust door tension.
Doors	Threshold at door leading to elevator door on Level 4 is 1" high.	(4.13.8).	Install ramp.
Stairs	Handrails on stairs are not uniform 34" to 38" above stair nosings.	(4.9.4)(5).	Adjust railing to proper height.
Elevators	A. Hall lanterns do not exist on Levels 1,2,3, and 4.	A. (4.10.4).	Elevator Contract.
	B. Reopening device does not stay open for at least twenty seconds.	B. (4.10.6).	Elevator Contract.
	C. Control buttons are not designated by Braille characters.	C. (4.10.12)(2).	Install as required.

BUILDING NUMBER: 4620
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Parks Field Office
507 Vine Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist by Main Entrance or in Employee parking lot.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Doors	A. Minimum clear opening is not provided at opening from Sign Stock Room into hallway leading to Garage.	A. (4.13.5).
	B. Minimum clear opening is not provided at doorway leading to Men's Rest Room.	B. (4.13.5).
	C. Minimum clear opening is not provided at doorway to Men's Rest Room.	C. (4.13.5).
	D. Minimum clear opening is not provided at doorway leading to 2nd floor Records.	D. (4.13.5).
	E. Minimum clear opening is not provided at doorway from hall to Vending Machines.	E. (4.13.5).
	F. Minimum clear opening is not provided at doorway into McGill's office.	F. (4.13.5).
	G. Minimum clear opening is not provided at doorway to George's office.	G. (4.13.5).
	H. Minimum clear opening is not provided from George's office doorway into hall.	H. (4.13.5).
	I. Minimum clear opening is not provided at doorway leading to Storage Room (by front parking).	I. (4.13.5).
	J. Threshold at door to George's office, leading to parking, is greater than 1/2".	J. (4.13.8).

BUILDING NUMBER: 4620
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Parks Field Office
507 Vine Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	K. Threshold has 2" step on outside door with Mail Container.	K. (4.13.8).
	L. 7" curb exists at doorway to Storage Room (by parking).	L. (4.7.1).
	M. Thresholds on doorways (from parking) into building have 3" steps.	M. (4.13.8). Also (4.7.1).
Drinking Fountains	A. Fountain by Rest Rooms has spout 45" from floor.	A. (4.15.2).
	B. Fountain by George's office has spout 44" from floor.	B. (4.15.2).
	C. Fountain by Rest Rooms has water flow less than 4" high.	C. (4.15.3).
	D. Both drinking fountains do not provide clear knee space and/or clear floor space.	D. (4.15.5)(1). Also (4.15.5)(2).
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are accessible.	A. (4.17.3), (4.22.4).
	B. Stall doors in Men's Rest Room (22-1/2") and Women's Rest Room (22-3/4"), do not provide minimum clear opening.	B. (4.17.5). Also (4.13.5).
	C. Stall opening to urinal does not provide minimum clear opening.	C. (4.13.5).
	D. Doorway to Women's Rest Room does not provide a minimum clear opening.	D. (4.13.5).
	E. Opening to sink in Women's Rest Room does not provide a minimum clear opening.	E. (4.13.5).

BUILDING NUMBER: 4620
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Parks Field Office
507 Vine Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	A. Grab bars do not exist in Men's or Women's Rest Rooms.	A. (4.16.4).
	B. Toilets in Men's and Women's Rest Rooms are 16-1/4" high.	B. (4.16.3).
Lavatories and Mirrors	A. Mirrors in Women's Rest Room (52") and Men's Rest Room (50"), are too high.	A. (4.19.6).
	B. Sinks in Men's and Women's Rest Rooms have exposed water pipes.	B. (4.24.6).

BUILDING NUMBER: 4625
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Phillip Jones Complex
1190 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space designated by a sign does not exist.	(4.6.2), (4.6.3), (4.6.4). Modify as required.
Accessible Route	<p>A. Does not exist from parking lot to walkway.</p> <p>B. Walkway does not exist to Rest Rooms, Snack Bar, Concession Stand, Dugouts, or Drinking Fountain.</p>	<p>A. (4.3.2). Install sidewalk.</p> <p>B. (4.3.2). See A.</p>
Assembly Area	Wheelchair locations do not exist by bleachers at Football or Baseball Fields.	(4.33.2). Designate area.
Counters	Counters at Concession Stand are 38" high.	(4.32.4). Modify section of counter.
Stairs	Stairway leading to second floor Press Box has handrail only on one side.	(4.9.4). Install handrail.
Water Fountains	<p>A. Outside fountain by Baseball Field has spout too high, and spout located in rear.</p> <p>B. Proper floor clearance is not provided at fountains.</p> <p>C. Fountain located inside Office has no clear floor space, spout is too high, and does not provide proper knee clearance.</p>	<p>A. (4.15.2). Also (4.15.3). Install Handicap fountain.</p> <p>B. (4.15.5), (4.15.2). See A.</p> <p>C. (4.15.5), (4.15.2). Staff only.</p>
Toilet Stalls	There are no stalls in Men's or Women's Rest Rooms that provide clear floor space.	(4.17.5). Modify as required.

BUILDING NUMBER: 4625
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Phillip Jones Complex
1190 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	Grab bars do not exist in Men's or Women's Rest Rooms.	(4.17.6). Install grab bars.
Lavatories/Mirrors	A. Sinks in Men's and Women's Rest Rooms have rim surface higher than 34" from floor.	A. (4.19.4). Modify as required.
	B. Sinks in Men's and Women's Rest Rooms have exposed water pipes underneath.	B. (4.19.6). Modify as required.
	C. Mirrors in both Men's and Women's Rest Rooms have bottom edge 48" from floor.	C. (4.32.4). Lower mirrors.
Doors	A. Threshold to Office is greater than 1/2".	A. (4.13.8). Staff only.
	B. Threshold to Snack Bar has 4" step.	B. (4.13.8). Staff only.
	C. Thresholds to both Rest Rooms are greater than 1/2".	C. (4.13.8). Install ramp

BUILDING NUMBER: 4630
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Pier 60
100 Gulfview Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Ramps	<p>A. Ramp leading up to Pier has a slope greater than 1:12 and a rise greater than 30".</p> <p>B. Handrails do not exist on ramp leading up to Pier.</p> <p>C. Ramp in front of gates at fishing area has a slope too great and an uneven surface.</p>	<p>NOTE: No modifications at this time; UFAS, 4.1.6, (Exceptions). A. (4.8.2).</p> <p>B. (4.8.5).</p> <p>C. (4.8.2). Also (4.5.1).</p>
Reach Ranges	<p>The four viewing machines on the Pier are not within proper reach ranges for a person in a wheelchair to operate.</p>	(4.2.5) or (4.2.6).
Telephone	<p>Public Telephone near gate to fishing area is not Hearing Aid compatible with proper volume control.</p>	(4.31.5)(1)&(2).
Counter	<p>A. Counter at gate to fishing area is not the proper height; 36" x 36" area is not provided.</p> <p>B. Counter inside Bait Shop is too high and does not provide 36" x 36" area.</p>	<p>A. (7.2).</p> <p>B. (7.2).</p>
Accessible Route	<p>A. Passage into Bait Shop does not provide 36" minimum clear width.</p> <p>B. Second floor Observation Deck is not accessible to wheelchairs.</p>	<p>A. (4.3.3).</p> <p>B. (4.3.2)(2).</p>

BUILDING NUMBER: 4630
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Pier 60
100 Gulfview Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Threshold at door to Bait Shop does not provide 32" wide opening.	A. (4.13.5).
	B. Doors to Men's and Women's Rest Rooms do not provide 32" wide opening.	B. (4.13.5).
Stairs	A. Stairs to second floor Observation Deck have open risers.	A. (4.9.2).
	B. Handrails on stairs to second floor Observation Deck are too high.	B. (4.9.4)(5).
Sinks	Sink on fishing area has rim too high from the ground.	(4.24.2).
Water Closets	Toilets in Men's and Women's Rest Rooms are not the proper height.	(4.16.3).
Toilet Stalls	A. There are no toilet stalls in Men's and Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3).
	B. Stall doors do not provide 32" wide opening.	B. (4.17.5).
	C. Grab bars do not exist in stalls of Men's or Women's Rest Rooms.	C. (4.17.6).
Urinal	Urinal in Men's Rest Room has rim too high above floor.	(4.18.2).

BUILDING NUMBER: 4630
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Pier 60
100 Gulfview Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	A. Exposed water pipes underneath sinks exist in Men's and Women's Rest Rooms.	A. (4.19.4).
	B. Mirrors in Men's and Women's Rest Rooms are too high above floor.	B. (4.19.6).
Sinks	Clear floor space is not provided in front of sinks in Men's and Women's Rest Rooms.	(4.24.5).
Accessible Route	With sink in present position, minimum clear width is not provided to stall in Men's Rest Room.	(4.3.3).

BUILDING NUMBER: 4635
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Pinellas Arts Council
402 Pierce Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space designated by a sign showing the symbol of accessibility does not exist.	NOTE: New Contract; they are responsible for all inside alterations. (4.6.2)(4.6.3)(4.6.4)(4.30).
Accessible Route	A. Parts of walkway from parking to stairs at entrance is made of brick, not providing a stable, firm surface.	A. (4.5.1).
	B. Second floor of building is not accessible for wheelchairs.	B. (4.3.2)(2).
	C. Walkway does not exist from side door (by kitchen) to an accessible walkway leading to parking.	C. (4.3.2)(2).
	D. Parking space in front of walkway from parking to entrance makes walkway not accessible when vehicle is parked in space.	D. (4.3.2)(2).
Space Allowance	Clear width for wheelchair passage between copy machine and desk is less than 32".	(4.2.1).
Handrails	A. Handrails at front entrance do not exist at both sides of stairs.	A. (4.9.4).
	B. Handrails to second floor have their top gripping surface greater or less than between 34" and 38".	B. (4.9.4)(5).
	C. Handrails of stairs at entrance have their top gripping surface less than 34".	C. (4.9.4)(5).
	D. Handrails do not exist on stairs at side door (by kitchen).	D. (4.9.4).

BUILDING NUMBER: 4635
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Pinellas Arts Council
402 Pierce Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	A. Stair treads on stairs to basement are only 8-1/2".	A. (4.9.2).
	B. Stairs to basement have no handrails.	B. (4.9.4).
Doors	A. Threshold to front door is greater than 1/2".	A. (4.13.8).
	B. Threshold at doorway leading outside (by kitchen) is greater than 1/2".	B. (4.13.8).
	C. Threshold at doorway to west porch on first floor is greater than 1/2".	C. (4.13.8).
	D. Most doorways, including rest room doorways, throughout the building have a clear opening less than 32".	D. (4.13.5).
Water Closets	A. Clear floor space in front of toilets in all three rest rooms is not adequate.	A. (4.16.2).
	B. Toilet height is 16" in all three rest rooms.	B. (4.16.3).
	C. Grab bars do not exist in any rest rooms.	C. (4.16.4).
Lavatories and Mirrors	A. Mirrors in all three rest rooms are more than 40" above floor.	A. (4.19.6).
Sinks	A. Sinks in all three rest rooms have exposed water pipes.	A. (4.24.6).
	B. Kitchen sink is 36-1/2" high.	B. (4.24.2).

BUILDING NUMBER: 4635
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Pinellas Arts Council
402 Pierce Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Bathtubs	C. Knee clearance at all sinks in all three rest rooms is less than 30" wide.	C. (4.24.3).
	D. Sink in kitchen has no knee space.	D. (4.24.3).
	Bathtubs in both rest rooms are not accessible.	(4.20).

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD	
Parking	(120 Spaces) Five accessible exist, three with signage too low. Should have two spaces with an access aisle between them by front entrance.	(4.6.4), (4.6.3).	Modify as required.
Doors	A. Doorway from Lobby into hallway leading to behind Information Counter does not provide 32" wide opening.	A. (4.13.5).	Employees only.
	B. Doorway from hall into behind Information Counter does not provide 32" wide opening.	B. (4.13.5).	Employees only.
	C. "Identification" door does not provide 32" wide opening, and has threshold exceeding 1/2".	C. (4.13.5)&(4.13.8).	Modify required.
	D. Doorway next to "Identification" does not provide 32" wide opening.	D. (4.13.5).	Employees only.
	E. Door to "Chemical Storage" by copy machines does not provide 32" wide opening.	E. (4.13.5).	Employees only.
	F. Doors at South side porch have thresholds exceeding 1/2"; (Community Relations).	F. (4.13.8).	Modify as required.
	G. Doors into Men's and Women's "Community Relations" Rest Rooms do not provide 32" wide opening.	G. (4.13.5).	Modify as required.

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	H. Double doors at south "Community Relations" porch do not provide either leaf with a 32" wide opening, and have thresholds exceeding 1/2".	H. (4.13.4)&(4.13.8). Re-evaluation; meets ADA Standard.
	I. Door with counter in hall by door leading to secure area does not provide 32" wide opening.	I. (4.13.5). Employees only.
	J. Rest Room door off Sgt.'s Offices does not provide 32" wide opening.	J. (4.13.5). Employees only.
	K. Doorway to small office within Sgt.'s Offices does not provide 32" wide opening.	K. (4.13.5). Employees only.
	L. Door between "Property Room" hallway and first floor Rest Room hallway does not provide 32" wide opening.	L. (4.13.5). Employees only.
	M. Doors into first floor Women's Locker Room do not provide 32" wide opening; (two doors).	M. (4.13.5). Employees only.
	N. At Women's first floor Locker Room, door into Toilet/Shower Room does not provide 32" wide opening.	N. (4.13.5). Employees only.
	O. Two doors into Men's Rest Room by Roll-Call Room do not provide 32" wide opening, and have thresholds greater than 1/2"/.	O. (4.13.5). Employees only.

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	P. Doorway into Chief's Office, and doorway next to Chief's Office, do not provide 32" wide opening; (wooden doors).	P. (4.13.5). Employees only.
	Q. Coffee Room doorway in hall does not provide 32" wide opening; (2nd floor).	Q. (4.13.5). Employees only.
	R. Doorway to second floor "Investigation Commander" Office does not provide 32" wide opening.	R. (4.13.5). Employees only.
	S. "Case Management Supervisor" Office does not provide 32" wide opening.	S. (4.13.5). Employees only.
	T. "Major Case Room" door does not provide 32" wide opening.	T. (4.13.5). Employees only.
	U. Door next to "Major Case Room" does not provide 32" wide opening.	U. (4.13.5). Employees only.
	V. Door leading to stairway by second floor hall Rest Rooms does not provide 32" wide opening.	V. (4.13.5). Employees only.
	W. Doorways (2) to Men's and Women's second floor hall Rest Rooms do not provide 32" wide opening.	W. (4.13.5). Employees only.
	X. Doorway to small computer room by stairway by Chief's Office does not provide 32" wide opening.	X. (4.13.5). Employees only.
	Y. Doorway to "Internal Affairs" does not provide 32" wide opening.	Y. (4.13.5). Employees only.

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	Z. Doorway to "Accreditation" does not provide 32" wide opening.	Z. (4.13.5). Employees only.
	AA Doorway next to "Accreditation" does not provide 32" wide opening.	AA (4.13.5). Employees only.
	BB Exit door in hall by red lockers does not provide 32" wide opening.	BB (4.13.5). Employees only.
	CC Two doors to Men's Lobby Rest Room do not provide 32" wide opening, nor the proper 48" minimum space between two doors in series; (Lobby).	CC (4.13.5)&(4.13.7). Modify as required.
	DD Chaplin's door off hall from Lobby does not provide 32" wide opening.	DD (4.13.5). Employees only.
Counters/Tables	A. Information Counter in Lobby is too high and does not provide 36" x 36" area.	A. (4.32.4)&(7.2). N/A; Secure Area. Staff to provide assistance as needed.
	B. Counter on door in hall by door leading to "Secure Area" is too high above floor.	B. (4.32.4). N/A; Secure Area.
	C. Tables and counters in Roll-Call Room do not provide proper knee clearance.	C. (4.32.3). Employees only.
	D. Desks throughout first floor offices do not provide proper knee clearance.	D. (4.32.3). Employees only.
	E. Main Service Counter in Lobby is too high above ground and does not provide 36" x 36" area.	E. (4.32.4)&(7.2).N/A; Secure Area.

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	A. Stairs at "Community Relations" porch do not have handrails.	A. (4.9.4). Install handrail.
	B. Outside "Secure" stairway does not have continuous proper handrails.	B. (4.9.4). Employees only.
Ramps	A. Floor level change (5-1/2 step) exists at doorways from Sgt.'s Offices.	A. (4.13.8). Employees only.
	B. Floor level change (step) exists at doorway to red locker area at second floor.	B. (4.13.8). Employees only.
	C. Second floor ramp by stairway does not have level area in front of door.	C. (4.13.6). Employees only.
	D. Second floor ramp by stairway has slope exceeding 1:12.	D. (4.8.2). Employees only.
	E. "Communications" Supervisor's Office has level change at 6" step.	E. (4.13.8). Employees only.
	F. Ramp by stairway by Chief's Office to Meeting Room has slope exceeding 1:12.	F. (4.8.2). Employees only.
	G. Level change (step) exists by Lt. Egger's Office (second floor).	G. (4.13.8). Employees only.
Curb Ramp	A. Rear outside North door does not provide curb ramp, nor is it beveled properly.	A. (4.7.1)&(4.13.8). Employees only.
	B. Does not exist at sidewalk from building to North side Police vehicle parking.	B. (4.7.1). Employees only.

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramp	C. Outside door into "Secure Area" needs curb ramp at footing of doorway.	C. (4.7.1). Employees only.
	D. Footing at bottom of outside "Secure" stairway needs curb ramp at accessible sidewalk.	D. (4.7.1). Employees only.
	E. East side door next to "Secure" area door (outside) has porch which needs curb ramp where it meets parking lot.	E. (4.7.1). Employees only.
Water Closets	A. Toilet in Sgt.'s Rest Room is not the proper height.	A. (4.15.2). Employees only.
	B. Proper clear floor space is not provided in Rest Room off Sgt.'s Office.	B. (4.16.2). See A.
	C. Grab bars are not provided in Rest Room off Sgt.'s Office.	C. (4.16.4). See A.
Toilet Stalls	A. Toilets in Men's and Women's "Community Relations" Rest Rooms, Men's and Women's first floor Locker Rooms, Men's first floor Roll-Call Rest Room, second floor Men's and Women's hallway Rest Rooms, Men's and W o m e n ' s "Communication" Rest Rooms, and Men's and Women's first floor Lobby Rest Rooms, are not the proper height.	A. (4.17.2). Replace toilets in Community Relations Rest Rooms and in 1st floor Public Rest Rooms. All others, Employees only.

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>B. There are no stalls in Men's and Women's "Community Relations" Rest Rooms, Men's and Women's first floor Locker Rooms, Men's first floor Roll-Call Rest Room, second floor Men's and Women's hallway Rest Rooms, Men's and Women's "Communications" Rest Rooms, and Men's and Women's first floor Lobby Rest Rooms, that are the proper size and arrangement.</p> <p>C. Grab bars do not exist in Men's and Women's "Community Relations" Rest Rooms, Men's and Women's first floor Locker Rooms, Men's first floor Roll-Call Rest Room, second floor Men's and Women's hallway Rest Rooms, Men's and Women's "Communications" Rest Rooms, and Men's and Women's first floor Lobby Rest Rooms.</p> <p>D. Stall doors in Men's and Women's "Community Relations" Rest Rooms, Men's and Women's first floor Locker Rooms, Men's first floor Roll-Call Rest Room, second floor Men's and Women's hallway Rest Rooms, and Men's and Women's first floor Lobby Rest Rooms, do not provide 32" wide opening.</p>	<p>B. (4.17.3). Also (4.16.2). See A.</p> <p>C. (4.17.6). See A.</p> <p>D. (4.17.5). See A.</p>

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Urinals	<p>A. Urinals in Men's first floor Locker Room, Men's first floor Roll-Call Rest Room, second floor Men's hallway Rest Room, and Men's first floor Lobby Rest Room, have rims too high above floor.</p> <p>B. Urinals in Men's second floor hallway Rest Room do not provide proper clear floor space.</p>	<p>A. (4.18.2). Replace urinal in Lobby Rest Room. Others, employees only.</p> <p>B. (4.18.3). Employees only.</p>
Mirrors	<p>Mirrors in Men's first floor Locker Room, Men's and Women's second floor hallway Rest Rooms, Men's and Women's first floor Lobby Rest Rooms, and Men's Roll-Call Rest Room, are too high above floor.</p>	<p>(4.19.6). Lower mirrors in Lobby Rest Rooms. Others, employees only.</p>
Dispensers	<p>Men's Roll-Call Rest Room, and Women's first floor Lobby Rest Room, have paper towel dispensers too high above floor.</p>	<p>(4.23.7). Lower dispensers in Lobby Rest Rooms. Other, employees only.</p>
Sinks	<p>A. Exposed pipes exist underneath sinks in Men's and Women's "Community Relations" Rest Rooms, Men's and Women's first floor Locker Rooms, Men's and Women's second floor hallway Rest Rooms, and Men's and Women's first floor Lobby Rest Rooms.</p>	<p>A. (4.19.4). Modify as required, Community Relations and Lobby Rest Rooms.</p>

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	B. Proper clear floor space is not provided in front of sinks in Men's and Women's "Community Relations" Rest Rooms, Rest Room off Sgt.'s Office, and Men's and Women's second floor hallway Rest Rooms.	B. (4.24.5). Modify as required, Community Relations Rest Rooms. Others, employees only.
	C. Proper knee clearance is not provided at sinks in Men's and Women's "Communications" Rest Rooms, and at sink in "Communications" kitchen.	C. (4.24.3). Employees only.
Shower Stalls	A. There are no shower stalls or shower rooms that provide a proper seat in Men's and Women's first floor Locker Rooms.	A. (4.21.3). Employees only.
	B. There are no grab bars in shower stalls or shower rooms in Men's and Women's first floor Locker Rooms.	B. (4.21.4). Employees only.
	C. A proper shower spray unit is not provided in any stalls or shower rooms in first floor Men's and Women's Locker Rooms.	C. (4.21.6). Employees only.
	D. A curb exists in Women's first floor Locker Room shower stall.	D. (4.21.7). Employees, only.
Water Fountain	A. Fountains in Women's first floor Locker Room lounge, first floor Roll-Call Room, second floor hallway, by second floor red lockers, and first floor Lobby, have spouts too high above floor.	A. (4.15.2). Install Handicapped fountain in Lobby. Others, employees only.

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountains	B. Fountains have water flow toward rear in Women's first floor Locker Room Lounge, second floor hallway, by second floor red lockers, in first floor Lobby, and first floor Roll-Call Room.	B. (4.15.3). See A.
	C. Proper knee clearance is not provided at fountains in Women's first floor Locker Room Lounge, second floor hallway, second floor by red lockers, and at first floor Lobby.	C. (4.15.5). See A.
	Accessible Route	A. Second floor is not accessible to persons in wheelchairs (only stairways exist).
B. Minimum clear width of 36" is not provided in between lockers of Men's first floor Locker Room.		B. (4.3.3). Employees only.
C. Red locker area on second floor does not provide minimum clear width of 36" between lockers.		C. (4.3.3). Employees only.
Alarms	A Visual Alarm System is not an integrated part of building's Alarm System.	(4.28.2), (4.28.3), (4.28.1). Install as required.

BUILDING NUMBER: 4640
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Department/Main Station
644 Pierce Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD	
Telephones	<p>A. Public telephone in Lobby (first floor) is not Hearing Aid compatible with proper volume control.</p> <p>B. The highest operable part of telephone is beyond 54" reach range.</p>	<p>A. (4.31.5)(1)&(2). Sheet.</p> <p>B. (4.31.3). See A.</p>	See Cover Sheet.

BUILDING NUMBER: 4645
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Pistol Range
2851 McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Ramps	Does not exist to Classroom (stairs exist), making Classroom not accessible to wheelchairs.	NOTE: No public access. (4.8.1)&(4.8.2).
Doors	A. Doorway to Rest Rooms in Classroom does not provide 32" wide opening.	A. (4.13.5).
	B. Threshold at Classroom double doors exceeds 1/2".	B. (4.13.8).
	C. Classroom double doors do not provide 32" wide opening.	C. (4.13.5).
	D. Threshold at door to outside Storage Shed exceeds 1/2"; (step exists).	D. (4.13.8).
Stairs	A. Stairway at rear of Classroom does not provide handrails, and has open risers.	A. (4.9.4). Also (4.9.2).
	B. Stairway at front entrance to Classroom does not provide handrails.	B. (4.9.4).
Sinks	Kitchen sink does not provide proper knee clearance.	(4.24.5).
Drinking Fountain	A. Fountain does not provide proper clear floor space.	A. (4.15.5)(2).
	B. Fountain has spout too high above floor.	B. (4.15.2).

BUILDING NUMBER: 4645
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Pistol Range
2851 McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Toilets in Men's and Women's Rest Rooms are not the proper height.	A. (4.16.3).
	B. There are no stalls in Men's and Women's Rest Rooms that are the proper size and arrangement.	B. (4.17.3).
	C. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	C. (4.17.5).
	D. Grab bars do not exist in stalls in Men's and Women's Rest Rooms.	D. (4.17.6).
Urinals	Urinal in Men's Rest Room has rim too high above floor.	(4.18.2).

BUILDING NUMBER: 4650
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Condon Gardens
2930 Sandelewood Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Sidewalk to Main Entrance does not provide minimum clear width of 36".	NOTE: Responsibility of Clearwater Housing Authority. (4.3.3).
Curb Ramp	A. Does not exist at threshold of front door.	A. (4.7.1).
	B. Does not exist at threshold of two rear double doors.	B. (4.7.1).
Telephone	Public Telephone on sidewalk is not Hearing Aid compatible with volume control.	(4.31.5)(1)&(2).

BUILDING NUMBER: 4655
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Countryside
2851 McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	<p>A. Does not exist to transportation.</p> <p>B. With barrier walls in present position in Men's and Women's Lobby Rest Rooms, minimum clear width is not provided into Rest Rooms.</p>	<p>A. (4.3.2)(1). Install sidewalk.</p> <p>B. (4.3.3). Modify as required.</p>
Parking	<p>(32 public spaces exist) One accessible space exists; two should exist.</p>	<p>(4.6.3). Also (4.1.2)(5B). Modify as required.</p>
Ramps	<p>Ramp from parking to Main Entrance walkway has slope too great.</p>	<p>(4.8.2). Install curb ramp.</p>
Doors	<p>A. Threshold at main double doors exceeds 1/2".</p> <p>B. West Employee Entrance threshold exceeds 1/2".</p> <p>C. Exit Door (outside) from Meeting Room has threshold exceeding 1/2".</p> <p>D. Door at West Employee Entrance does not provide 32" wide opening.</p> <p>E. Outside Exit Door from Meeting Room does not provide 32" wide opening.</p> <p>F. Doorway at Sally Port has threshold exceeding 1/2".</p> <p>G. Men's and Women's Lobby Rest Room doors have thresholds exceeding 1/2".</p>	<p>A. (4.13.8). Re-evaluation; meets A.D.A. standards.</p> <p>B. (4.13.8). Employees only.</p> <p>C. (4.13.8). Employees only.</p> <p>D. (4.13.5). Employees only.</p> <p>E. (4.13.5). Employees only.</p> <p>F. (4.13.8). Employees only.</p> <p>G. (4.13.8). Modify as required.</p>

BUILDING NUMBER: 4655
 TARGET DATE: 00/00/00
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Countryside
2851 McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Drinking Fountains	A. Drinking fountains in Lobby and hallway do not provide proper knee clearance.	A. (4.15.5)(1) Install paper cup dispenser for public fountain.
	B. Fountain in hallway has spout too high above ground.	B. (4.15.2). Employees only.
Counters	Main Counter in Lobby is too high above floor, and does not provide 36" x 36" section.	(4.32.4). Also (7.2). Assistance provided in lobby area as needed.
Counters/Desks	Work counters in Office are too high above ground and computer desk does not provide proper knee clearance.	(4.32.4). Also (4.32.3). Employees only.
Sinks	A. Utility sink in Storage Room off Lobby does not provide knee clearance.	A. (4.24.3). Employees only.
	B. Sink in Lounge does not provide proper knee clearance.	B. (4.24.3). Employees only.
	C. Sinks in Men's and Women's Locker Room do not provide proper knee clearance.	C. (4.24.3). Employees only.
Lavatories/Mirrors	A. Mirrors over sinks in Men's and Women's Lobby Rest Room, and Men's and Women's Locker Room, are too high above floor.	A. (4.19.6). Lower mirrors in public bathrooms.
	B. Exposed pipes under sinks exist in Men's and Women's Lobby Rest Room.	B. (4.19.4). Modify as required.

BUILDING NUMBER: 4655
 TARGET DATE: 00/00/00
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Countryside
2851 McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Toilets in Men's and Women's Locker Rooms are not the proper height.	A. (4.16.3). Employees only.
	B. There are no stalls in Women's or Men's Locker Rooms that are the proper size and arrangement.	B. (4.17.3). Employees only.
	C. Grab bars do not exist in Men's or Women's Locker Rooms.	C. (4.17.6). Employees only.
	D. Stall doors in Men's and Women's Locker Rooms do not provide 32" wide opening.	D. (4.17.5). Employees only.
Shower Stalls	A. Proper grab bars do not exist in stalls of Men's or Women's Locker Rooms.	A. (4.21.4). Employees only.
	B. Curb exists at stall entrance in Men's and Women's Locker Room.	B. (4.21.7). Employees only.
	C. Proper seat is not provided in any stall of Men's or Women's Rest Rooms.	C. (4.21.3). Employees only.
	D. Proper shower spray unit does not exist in any stall of Men's or Women's Locker Rooms.	D. (4.21.6). Employees only.

BUILDING NUMBER: 4660

BUILDING LOCATION: Police Dept./East Avenue

TARGET DATE: 1994

105 East Avenue

COMPLETED: 00/00/00

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

NOTE: No Public Access;
Employees only.

BUILDING NUMBER: 4665
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./K-9 Training Ctr.
2851 McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Ramp	Ramp to Main Entrance has slope too great.	(4.8.2). Modify as required.
Doors	A. Threshold at door to Storage exceeds 1/2".	A. (4.13.8). Employees only.
	B. Threshold at Rest Room exceeds 1/2".	B. (4.13.8). Modify as required.
Water Fountain	A. Clear floor space is not provided by fountain.	A. (4.15.5)(2). Install Handicapped fountain.
	B. Fountain has spout too high above floor.	B. (4.15.2). See A.
Accessible Route	Does not exist from walkway to Bleachers.	(4.3.2)(2). Install sidewalk.
Assembly Area (Bleachers)	Wheelchair location does not exist at Bleachers.	(4.33.3). Designate area.
Sink	Sink in Rest Room does not provide proper knee clearance.	(4.24.3). Modify as required.
Water Closets	A. Toilet in Rest Room is not the proper height.	A. (4.16.3). Replace toilet.
	B. Grab bars do not exist by toilet in Rest Room.	B. (4.16.4). Install grab bars.
Lavatories/Mirrors	A. Mirror over sink in Rest Room is too high above floor.	A. (4.19.6). Lower mirror.
	B. Exposed pipes underneath sink exist in Rest Room.	B. (4.19.4). Modify as required.

BUILDING NUMBER: 4665
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./K-9 Training Ctr.
2851 McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	A. Stall has curb ramp at stall entrance.	A. (4.21.7). Employees only.
	B. Grab bars do not exist in shower stall.	B. (4.21.4). Employees only.
	C. Proper seat in stall does not exist.	C. (4.21.3). Employees only.
	D. Proper shower spray unit does not exist.	D. (4.21.6). Employees only.
	E. Shower stall is not the proper size.	E. (4.21.2). Employees only.

BUILDING NUMBER: 4670
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Beach Station
700 Bayway

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	<p>A. Does not exist to rear dock with existing 10" step.</p> <p>B. Station, which is located on a second floor, is not accessible to wheelchairs.</p>	<p>NOTE: Relocate emergency phone to 1st level. All others, employees only. (4.3.2)(2).</p> <p>B. (4.3.2)(1)&(2).</p>
Stairs	<p>A. Handrails on stairs to rear entrance are not continuous to bottom riser.</p> <p>B. Handrails on main front stairs are not continuous on both sides, nor at the proper height.</p>	<p>A. (4.9.4)(2).</p> <p>B. (4.9.4)(1)(2)&(5).</p>
Doors	<p>Front main door has a threshold greater than 1/2".</p>	(4.13.8).
Counter	<p>Main Counter is too high and does not provide a 36" x 36" area.</p>	(7.2). Also (4.32.4).
Toilet Stalls	<p>A. There are no stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.</p> <p>B. Grab bars do not exist in any stalls in Men's or Women's Rest Rooms.</p> <p>C. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.</p>	<p>A. (4.17.3).</p> <p>B. (4.17.6).</p> <p>C. (4.17.5).</p>
Water Closets	<p>There are no toilets in Men's or Women's Rest Rooms that are the proper height.</p>	(4.16.3).

BUILDING NUMBER: 4670
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Beach Station
700 Bayway

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	(4.24.3).
Mirrors	Mirrors in Men's and Women's Rest Rooms are too high from floor.	(4.19.6).
Alarms	Visual Alarm System is not an integrated part of building's Alarm System.	(4.28.1).
Shower Stalls	A. Shower stall in Men's Rest Room is not the proper size.	A. (4.21.2).
	B. Seat is not provided in Men's Shower stall.	B. (4.21.3).
	C. Proper shower spray unit is not provided.	C. (4.21.6).

BUILDING NUMBER: 4675
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Greenwood Station
1310 N. Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space, designated by a sign showing the symbol of accessibility, does not exist.	(4 . 6 . 2) . Also (4.6.3), (4.6.4), (4.30). Modify as required.
Counter	Main Counter is too high above the ground, and does not provide 36" x 36" area.	(4.32.4). Also (7.2). Provide Handicapped accessible table in Lobby.
Doors	A. Main front double doors do not provide at least one leaf that has a 32" wide opening.	A. (4.13.4). Re-evaluation; meets ADA Standards.
	B. Doorway to Computer Room does not provide 32" wide opening.	B. (4.13.5). Employees only.
	C. Doorway between hallway and Rest Rooms does not provide 32" wide opening.	C. (4.13.5). Employees only.
	D. Rear doorway threshold has a curl and needs beveled slope.	D. (4.13.8). Employees only.
	E. Rear doorway slab in front of door is not a stable, firm surface.	E. (4.5.1). Employees only.
	F. Doorways to Men's and Women's Rest Rooms do not provide 32" wide opening.	F. (4.13.5). Employees only.
	G. Men's and Women's Rest Rooms have a floor level chan just inside doorwa	G. (4.13.8). Employees only.

BUILDING NUMBER: 4675
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Greenwood Station
1310 N. Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	A. Toilets in Men's and Women's Rest Rooms are not the proper height.	A. (4.16.3). Employees only.
	B. Grab bars do not exist in Men's or Women's Rest Rooms.	B. (4.16.4). Employees only.
Lavatories and Mirrors	A. Mirrors over sinks are too high above floor in Men's and Women's Rest Rooms.	A. (4.19.6). Employees only.
	B. Exposed water pipes underneath sinks exist in Men's and Women's Rest Rooms.	B. (4.19.4). Employees only.
Water Fountain	A. Spout on drinking fountain is too high above ground.	A. (4.15.2). Install paper cup dispenser.
	B. Water flow on fountain has water flow directed toward rear.	B. (4.15.3). See A.
	C. Proper knee clearance is not provided between apron and floor.	C. (4.15.5)(1). See A.

BUILDING NUMBER: 4800
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Admin. Building
1650 N. Arcturus Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(15 Spaces) One accessible space exists but there are 134 employee spaces for all of Public Service, and none are accessible with proper signage.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Curb Ramp	A. Does not exist where walkway to Main Entrance meets parking access aisle. B. Rear exit door of hallway has step at threshold which needs proper curb ramp.	A. (4.7.1). B. (4.7.1).
Doors	A. Swing door at main counter has neither leaf that provides 32" wide opening.	A. (4.13.4).
Water Fountain	Proper knee clearance is not provided at fountain in Lobby.	(4.15.5)(1).
Counters	A. Front counter does not provide 36"x 36" area. B. Map Room counter is too high and should have a 36" x 36" area for persons in wheelchairs.	A. (7.2). B. (4.32.4)&(7.2).
Doors	Door opening force is too great on Men's and Women's Lobby Rest Room doors.	(4.13.11).
Sinks	A. Exposed pipes exist underneath sinks in Men's and Women's Rest Rooms. B. 19" depth of knee clearance is not provided underneath sinks in Men's and Women's Rest Rooms.	A. (4.24.6). B. (4.24.3).

BUILDING NUMBER: 4800
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Admin. Building
1650 N. Arcturus Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	C. Kitchen sink in Lounge does not provide proper knee clearance.	C. (4.24.3).
Toilet Stalls	A. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	A. (4.17.5).
	B. Grab bars do not exist behind toilets in Men's and Women's Rest Rooms.	B. (4.17.6).

BUILDING NUMBER: 4810
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Motor Shop&Stor.
1650 N. Arcturus Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	No accessible space exists by an entrance.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Curb Ramp	A. Does not exist at main front entrance door.	A. (4.7.1).
	B. Curb ramp at door into main Garage is not level in front of door and thus does not provide required maneuvering clearance.	B. (4.13.6).
Doors	Doorway into main Garage has threshold exceeding 1/2".	(4.13.8).
Water Fountains	A. Fountain in Shop does not provide proper clear floor space.	A. (4.15.5)(2).
	B. Fountain in Shop has spout too high above floor.	B. (4.15.2).
Sinks	A. Sink in Shop has mirror too high above floor.	A. (4.19.6).
	B. Sink in Shop does not provide proper knee clearance.	B. (4.24.3).
	C. Exposed pipes exist underneath sink in Rest Room.	C. (4.24.6).
Water Closets	Toilet in Rest Room is not the proper height.	(4.16.3).
Toilet Stalls	A. Stall doors in Rest Room do not provide 32" wide opening.	A. (4.17.5).
	B. There is no stall in Rest Room that is the proper size and arrangement.	B. (4.17.3).

BUILDING NUMBER: 4810
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Motor Shop&Stor.
1650 N. Arcturas Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	C. Grab bars do not exist in any Rest Room stall.	C. (4.17.6).
Urinals	Urinals in Rest Room have rims too high above floor.	(4.18.2).
Shower Stalls	A. Curbs exist at Rest Room showers.	A. (4.21.7).
	B. Grab bars do not exist in Rest Room shower stalls.	B. (4.21.4).
	C. Proper seat is not provided in any stall.	C. (4.21.3).
	D. Proper shower spray unit is not provided in any stall.	D. (4.21.6).

BUILDING NUMBER: 4820
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Supervisors Bldg
1650 N. Arcturus Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(12 Spaces) No accessible space exists by an entrance, with proper signage.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Curb Ramp	At curb ramp or beveled area in front of Main Entrance double door, ground area within the required maneuvering clearance in front of door is not level.	(4.13.6).
Doors	A. Double doors at Main Entrance have threshold exceeding 1/2".	A. (4.13.8).
	B. Threshold at rear double doors exceeds 1/2".	B. (4.13.8).
	C. Door opening force of Main Entrance door is too great.	C. (4.13.11).
	D. Rest Room door opening force at Men's and Women's Rest Rooms is too great.	D. (4.13.11).
Water Fountain	Water fountain by Vending Machines has spout too high.	(4.15.2).
Toilet Stalls	Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	(4.17.5).
Shower Stalls	A. Stall doorways do not provide 32" wide opening.	A. (4.13.5).

BUILDING NUMBER: 4820
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Supervisors Bldg
1650 N. Arcturas Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	B. Proper seat is not provided in Rest Room shower stalls.	B. (4.21.3).
	C. Proper spray unit is not provided in Rest Room stalls.	C. (4.21.6).
	D. Curbs exist in Rest Room shower stalls at entrance to stalls.	D. (4.21.7).

BUILDING NUMBER: 4830
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Meter Shop
1650 N. Arcturus Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	No accessible space exists near entrance.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Doors	A. Threshold at South exit doors exceeds 1/2".	A. (4.13.8).
	B. Threshold at exit door of Paint Room exceeds 1/2".	B. (4.13.8).
	C. Main front door has threshold that exceeds 1/2" and does not provide 32" wide opening.	C. (4.13.8)&(4.13.5).
Curb Ramp	A. Does not exist where driveway and walkway to Main Entrance meet.	A. (4.7.1).
	B. Does not exist where walkway and driveway meet by Paint Room.	B. (4.7.1).
Water Fountains	A. Fountains in Shop and by Kitchen have spouts too high above ground.	A. (4.15.2).
	B. Fountains in Shop and by Kitchen do not provide proper knee clearance.	B. (4.15.5)(1).
	C. Fountain in Shop does not provide proper clear floor space.	C. (4.15.5)(2).
Sinks	A. Sink in Kitchen does not provide proper knee clearance.	A. (4.24.3).
	B. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	B. (4.24.3).

BUILDING NUMBER: 4830
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Meter Shop
1650 N. Arcturus Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Mirrors	Mirrors in Men's and Women's Rest Rooms are too high above ground.	(4.19.6).
Toilet Stalls	A. There are no stalls in Men's and Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	B. (4.17.5).
	C. There are no grab bars in stalls of Men's and Women's Rest Rooms.	C. (4.17.6).
Urinals	Urinals in Men's Rest Room have rims too high above floor.	(4.18.2).

BUILDING NUMBER: 4900
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Purchasing Building
711 Maple Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Threshold at Main Entrance has step and needs beveled slope less than 1:2.	A. (4.13.8). Install Ramp.
	B. Door to Employee Lounge (by Rest Room) does not provide 32" wide opening.	B. (4.13.5). Remodel Bathrooms.
	C. Door in rear of Garage does not provide 32" wide opening.	C. (4.13.5). Employees only.
	D. Threshold at door in rear of Garage has 3" step and needs beveled slope less than 1:2.	D. (4.13.8). Employees only.
	E. Men's and Women's Rest Room doors in Purchasing Office do not provide 32" wide opening.	E. (4.13.5). Employees only.
	F. Threshold at double doors in Graphic Communications Office exceeds 1/2".	F. (4.13.8). Employees only.
	G. Rest Room in Graphic Communications Office does not provide 32" wide opening.	G. (4.13.5). Employees only.
Accessible Route	Accessible walkway does not exist to Main Entrance, (vehicles intrude on walk), from parking and transportation.	(4.3.2)(1)&(2). Modify as required.

BUILDING NUMBER: 4900
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Purchasing Building
711 Maple Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Drinking Fountain	A. Fountain in Purchasing Office does not provide proper floor space.	A. (4.15.5)(2). Install paper cup dispenser.
	B. Fountain in Purchasing Office has spout too high off floor.	B. (4.15.2). See A.
	C. Fountain in Purchasing Office has water flow directed toward rear.	C. (4.15.3). See A.
Water Closets	A. Toilets in Men's and Women's Purchasing Rest Rooms, and Rest Room in Graphic Communications, are not the proper height.	A. (4.16.3). Employees only.
	B. Grab bars do not exist in Men's and Women's Rest Rooms, and Graphic Communications Rest Room.	B. (4.16.4). Employees only.
Sinks	Sinks in Men's and Women's Rest Rooms in Purchasing Office do not provide proper knee clearance.	(4.24.3). Employees only.
Dispensers	Paper towel dispenser in Women's Rest Room in Purchasing is too high from ground; also Rest Room in Graphic Communications.	(4.23.7). Employees only.
Lavatories and Mirrors	A. Mirrors in Men's and Women's Rest Rooms in Purchasing are too high from floor.	A. (4.19.6). Employees only.
	B. Exposed pipes under sink in Graphic Communications Rest Room exist.	B. (4.19.4). Employees only.

BUILDING NUMBER: 4900
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Purchasing Building
711 Maple Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	A. Stairs to second floor Records Center have open risers.	A. (4.9.2). Employees only.
	B. Stairs to second floor Records Center have handrails not continuous and of a proper height.	B. (4.9.4)(1-7). Employees only.
Counters and Desks	A. Counters, desks, and tables throughout Graphic Communications Office do not provide proper knee clearance (includes Bindery and Typesetting Rooms).	A. (4.32.3). Employees only.
	B. Counters in Graphic Communications Office are too high from the ground.	B. (4.32.4). Employees only.
	C. Counters, desks, and tables in Purchasing Office do not provide proper knee clearance.	C. (4.32.3). Employees only.
	D. Counters in Purchasing Office are too high from the ground.	D. (4.32.4). Employees only.
Sink	Sink (utility) in Garage does not provide proper knee clearance.	(4.24.3). Employees only.
Drinking Fountain	A. Fountain in Garage does not provide proper knee clearance.	A. (4.15.5)(1)&(2). Employees only.
	B. Fountain in Garage has spout too high from the floor.	B. (4.15.2). Employees only.

BUILDING NUMBER: 4910
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Purchasing/Storage
711 Maple Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	Threshold at double doors inside Storage exceed 1/2".	NOTE: No Public access; employees only. (4.13.8).
Stairs	Handrails on stairs to dock are not the proper height.	(4.9.4).
Accessible Route	Does not exist to dock or storage area, since no ramp exists; (only stairs).	(4.3.2)(2).

BUILDING NUMBER: 5000
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ray Green Field
801 N. Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist anywhere near Complex or by Playground.	(4.6.2). Street parking only.
Accessible Route	A. Does not exist from street to an accessible walkway (by Rest Rooms).	A. (4.3.2)(1). Install sidewalk.
	B. Walkway does not exist to Rest Room/Office Building.	B. (4.3.2)(2). Install sidewalk.
	C. Walkway does not exist to Bleachers.	C. (4.3.2)(2). Install sidewalk.
	D. Walkway does not exist to drinking fountain by Bleachers.	D. (4.3.2)(2). Install sidewalk.
	E. Walkway does not exist from sidewalk into Playground.	E. (4.3.2)(1)/(4.3.2)(2). Inst sidewalk.
	F. Walkway does not exist to Utility Building on Playground side.	F. (4.3.2)(2). Employees only.
Assembly Areas (Bleachers)	Wheelchair locations do not exist by Bleachers.	(4.33.3). Designate area.
Ground/Floor Surface	Playground surface is sand, thus making wheelchair accessibility impossible.	(4.5.1). N/A; alters original function of area.
Drinking Fountains	A. Fountain does not provide the clear floor space to allow a person in a wheelchair to make a parallel approach to the unit.	A. (4.15.5)(2). Install Handicapped fountain.
	B. Fountain has spout located at rear.	B. (4.15.3). See A.
	C. Fountain has a water flow less than 4" high.	C. (4.15.3). See A.
	D. Fountain has water flow more than 3" from the front edge of fountain.	D. (4.15.3). See A.

BUILDING NUMBER: 5000
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ray Green Field
801 N. Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	At entrance to Rest Rooms there is a 6" step up from walkway.	(4.13.8). NOTE: Structural Impracticality; USFA, 4.1.6, (Exceptions, 5A).
Toilet Stalls	A. There is no stall in Men's or Women's Rest Rooms that is accessible.	A. (4.17.3). Also (4.22.4).
	B. Grab bars do not exist in any stall.	B. (4.17.6).
Water Closet	A. Height of toilets in both Men's and Women's Rest Rooms is 16" from floor.	A. (4.16.3).
Sinks	A. Sinks in both Men's and Women's Rest Rooms have exposed water pipes.	A. (4.24.6).
	B. Sinks in both Men's and Women's Rest Rooms have rims higher than 34" above the floor; (Men's 35-1/2", Women's, 36-1/2").	B. (4.24.2).

BUILDING NUMBER: 5005
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Recreation Facilities Office
509 Pennsylvania

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space designated by a sign showing the symbol of accessibility, does not exist.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Stairs	Open risers exist on both stairways leading up to dock.	(4.9.2).
Water Fountains	A. Fountain on rear dock has 43" spout above floor.	A. (4.15.2).
	B. Water flow on inside and outside fountains has water flow directed toward back of fountain.	B. (4.15.3).
Stairs	Stairway leading into Stock Room (hoses, etc.), has handrail on one side.	(4.9.4).
Doors	A. Threshold of door (off Dock) to Supervisor's Office is greater than 1/2".	A. (4.13.8).
	B. Threshold of doorway (with gate) by Docks to Mower Storage is greater than 1/2".	B. (4.13.8).
	C. Minimum clear opening is not provided at doorway to Rest Rooms.	C. (4.13.5).
Sinks	A. Knee clearance is not provided underneath kitchen sink.	A. (4.24.3).
	B. Knee clearance is not provided underneath utility sink in "Dungeon".	B. (4.24.3).
Toilet Stalls	A. There is no stall in Rest Room that is accessible with proper floor space.	A. (4.17.3). Also (4.22.4).
	B. Stall doors (23" wide) do not provide a minimum clear opening.	B. (4.17.5). Also (4.13.5).

BUILDING NUMBER: 5005
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Recreation Facilities Office
509 Pennsylvania

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Urinal	Urinal is 20" from floor to rim.	(4.18.2).
Water Closets	A. Grab bars do not exist in Rest Room.	A. (4.16.4).
	B. Toilets are 15-1/2" from floor to top of seat.	B. (4.16.3).
Shower Stalls	A. Stall size (30" x 32") is too small to be accessible.	A. (4.21.2).
	B. 9" curb exists at stall entrance.	B. (4.21.7).
	C. Doorway to stall is 24" wide.	C. (4.13.5).
	D. Showerhead is at 73" from floor.	D. (4.21.6). Also (4.21.5).
	E. Seat is not provided in stall.	E. (4.21.3).

BUILDING NUMBER: 5010
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ross Norton Pool
1440 South Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Two accessible spaces exist but signag is too low.	(4.6.4). Modify as required.
Accessible Route	Walkway does not connect all elements of Park to Pool (Ball Fields, Playground, Basketball Courts, Main Building).	(4.3.2)(2). Install sidewalks.
Doors	A. Threshold at front double doors is greater than 1/2".	A. (4.13.8). Modify as required.
	B. Threshold at rear office door is greater than 1/2".	B. (4.13.8). Modify as required.
	C. Threshold at rear Men's Locker Room door is greater than 1/2".	C. (4.13.8). Modify as required.
	D. Threshold at rear Women's Locker Room door is greater than 1/2".	D. (4.13.8). Modify as required.
	E. Threshold at Filter Room door is greater than 1/2".	E. (4.13.8). Employee only.
	F. Threshold at Chlorine Room door is greater than 1/2".	F. (4.13.8). Employee only.
Counters	Counters on front and rear office doors are too high, (42" and 42-1/2").	(4.32.4). Modify front counter.
Sinks	A. Sink in office does not provide proper clear floor space.	A. (4.24.5). Employee only.
	B. Sink in office has exposed water pipes.	B. (4.19.4). Employee only.
	C. Sinks in Men's and Women's Rest Rooms have exposed water pipes.	C. (4.19.4). Modify as required.
Reach Limits	Paper towel dispensers in Men's and Women's Rest Rooms are too high.	(4.23.7). Lower dispensers.

BUILDING NUMBER: 5010
TARGET DATE: 1993
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ross Norton Pool
1440 South Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Toilet stall doors in Men's and Women's Rest Rooms do not provide 32" opening.	A. (4.17.5). Modify as required.
	B. Grab bars with proper positioning do not exist in Men's or Women's Rest Rooms; none exist behind toilets.	B. (4.17.6). Rearrange and install grab bars.
Shower Stalls	Showers in Men's and Women's Locker Rooms do not provide proper shower unit, with hose at least 60" long. Also does not exist at outside showers.	(4.21.6). Modify as required.

BUILDING NUMBER: 5015
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ross Norton Park
1440 South Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist from accessible parking to either Ball Field (walkway or designated area on driveway).	A. (4.3.2)(2). Modify as required.
	B. Does not exist to Bleachers at either Ball Field.	B. (4.3.2)(2). Install sidewalks.
	C. Does not exist to Scorer's Table at either Ball Field.	C. (4.3.2)(2). Install sidewalks.
	D. Does not exist to Drinking Fountain between Ball Fields.	D. (4.3.2)(2). Install sidewalks.
	E. Does not exist to Dugouts at either Ball Field.	E. (4.3.2)(2). Install sidewalks.
	F. Walkway does not connect all elements of Park (Ball Fields, Pool, Playground, Basketball Courts, Main Building).	F. (4.3.2)(2). Install sidewalk.
	G. Does not exist to Picnic Table by Playground.	G. (4.3.2)(2). Install sidewalks.
	H. Walkway from parking to Main Building has too great of a slope.	H. (4.3.7). Modify ramp.
Assembly Areas (Bleachers)	Wheelchair locations do not exist by Bleachers at either Ball Field.	(4.33.3). Designate Handicapped area.
Drinking Fountain	A. Fountain between Ball Fields does not provide clear floor space to allow a person in a wheelchair to make a parallel approach to unit.	A. (4.15.5)(2). Install Handicapped fountain.
	B. Fountain has water flow more than 3" from the front edge of fountain.	B. (4.15.3). Install Handicapped fountain.

BUILDING NUMBER: 5015
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ross Norton Park
1440 South Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Fountain has spout located at rear.	C. (4.15.3). Install Handicapped fountain.
	D. Spout is higher than 36" from ground.	D. (4.15.2). Install Handicapped fountain.
	E. Fountain has water flow less than 4" high.	E. (4.15.3). Install Handicapped fountain.
Ground Surfaces	Playground surface is sand, not a stable, firm, slip-resistant surface.	(4.5.1). N/A; changes function of area.
Doors	A. 5-1/2" step exists at North side double doors.	A. (4.13.8). Modify as required.
	B. 8" step exists at double doors by Main Entrance.	B. (4.13.8). Modify as required.
	C. 7" step exists at single door on East side.	C. (4.13.8). Employee only.
	D. Double doors on South side has entrance on a slope instead of a level surface.	D. (4.13.8). Modify as required.
	E. No doors leading outside from Main Building provide proper 32" opening. On double leaf doors, at least one leaf does not meet standard either.	E. (4.13.5). Also (4.13.4). Modify one set of doors as Handicapped accessible.
Drinking Fountain	A. Fountain in Main Building has spout 42" from floor.	A. (4.15.2). Install Handicapped fountain.
	B. Fountain in Main Building does not provide proper knee clearance or proper clear floor space.	B. (4.15.5)(1). Install Handicapped fountain.
	C. Water flow is directed toward rear.	C. (4.15.3). Install Handicapped fountain.

BUILDING NUMBER: 5015
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ross Norton Park
1440 South Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>A. There is no stall in Men's or Women's Rest Room that is the proper size and arrangement.</p> <p>B. Proper grab bars do not exist in any stall in Men's or Women's Rest Room.</p> <p>C. Toilet stall doors in Men's Rest Room do not provide 32" opening.</p> <p>D. Door leading into Rest Rooms does not provide 32" opening.</p>	<p>A. (4.17.3). Also (4.22.4). Modify as required.</p> <p>B. (4.17.6). Install grab bars.</p> <p>C. (4.17.5). Modify as required.</p> <p>D. (4.13.5). Modify as required.</p>
Lavatories and Mirrors	<p>A. Mirrors over sinks in Men's and Women's Rest Rooms are too high.</p> <p>B. Sinks in Men's and Women's Rest Rooms have exposed water pipes.</p> <p>C. Proper knee clearance is not provided under sinks in Women's Rest Room.</p>	<p>A. (4.19.6). Lower mirrors.</p> <p>B. (4.19.4). Also (4.24.3). Modify as required.</p> <p>C. (4.24.3). Modify as required.</p>
Doors	<p>Office door in Main Room does not provide 32" opening.</p>	<p>(4.13.5). Employee only.</p>
Sinks	<p>A. Kitchen sink in Main Room does not provide proper knee clearance.</p> <p>B. Utility sink in Activities Room does not provide proper knee clearance.</p>	<p>A. (4.24.3). Modify as required.</p> <p>B. (4.24.3). N/A; alters function of device.</p>
Counters	<p>A. Counters around kitchen in Main Room are 35" high.</p> <p>B. Counters in Activities Room are 36" high.</p>	<p>A. (4.32.4). Lower counter tops.</p> <p>B. (4.32.4). Employee only.</p>

BUILDING NUMBER: 5015
TARGET DATE: 1993
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Ross Norton Park
1440 South Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Accessible Route	At Main Entrance, East to West route is blocked by a pole, thus not providing 36" of minimum clear width.	(4.3.3). Modify as required.
------------------	---	------------------------------

BUILDING NUMBER: 5017
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Ross Norton/PAL Building
1440 S. Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

NOTE: No Public access;
employees only.

BUILDING NUMBER: 5020
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Safety Village
1150 Lakeview

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space designated by a sign showing the symbol of accessibility, does not exist.	(4.6.2), (4.6.3), (4.6.4). Modify as required.
Accessible Route	A. Curb ramp does not exist from parking lot to sidewalk.	A. (4.7.1). Install curb ramp.
	B. Does not exist from walkway to drinking fountain.	B. (4.3.2)(2). Install sidewalk.
	C. Accessible route along all sidewalks and streets is sometimes interrupted.	C. (4.3.2)(2). Also (4.7.1). Complete walkways.
	D. Accessible route does not exist from streets and sidewalks to Village Building, (i.e., Safety S.V. House).	D. (4.3.2)(2). Install sidewalk.
	E. Curb ramp at sidewalk to Rest Rooms does not exist.	E. (4.7.1). Also (4.3.2)(2). Install curb ramp.
	F. Curb ramps do not exist throughout Village from sidewalk to streets.	F. (4.7.1). Install as required.
Drinking Fountains	A. Higher fountain has spout 39" from floor.	A. (4.15.2). Install one Handicapped fountain.
	B. Both fountains do not provide proper clear floor space.	B. (4.15.5)(1). Install one Handicapped fountain.
	C. Both fountains do not provide proper knee clearance.	C. (4.15.5)(1). Install one Handicapped fountain.
Doors	A. Main entrance to Rest Rooms is 29" wide.	A. (4.13.5). Modify as required.
	B. Main entrance to Rest Rooms has threshold greater than 1/2".	B. (4.13.8). Modify as required.
	C. Doors to Men's Rest Room (31"), and Women's Rest Room (30"), do not provide minimum clear opening.	C. (4.13.5). Modify as required.

BUILDING NUMBER: 5020
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Safety Village
1150 Lakeview

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	Men's and Women's toilets are 15-1/2" high.	(4.16.3). Replace toilet.
Lavatories	<p>A. Water pipes are exposed under sinks in both Men's and Women's Rest Rooms.</p> <p>B. Proper knee clearance is not provided underneath sinks in Men's or Women's Rest Rooms.</p>	<p>A. (4.19.4). Modify as required.</p> <p>B. (4.19.2). Modify as required.</p>

BUILDING NUMBER: 5025BUILDING LOCATION: Sailing Center

TARGET DATE: _____

1001 Gulf BoulevardCOMPLETED DATE: July, 1992

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD	
Parking	A. (56 Spaces) Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist.	A. NOTE: Building in compliance with ADA Standards as of July, 1992.	
	B. Parking access aisles are not part of an accessible route from parking to curb ramp leading to accessible ramp to building entrance. (Aisle does not exist).	B. (4.6.3).	
Ramp	A. Ramp does not have handrails on both sides.	A. (4.8.5).	
	B. Top of handrail on ramp is 32" above ramp surface.	B. (4.8.5)(5).	
Telephone Floor)	(1st	A. Phone is not Hearing Aid compatible with volume control.	A. (4.31.5). See Cover Sheet.
		B. Highest operable part of phone is 52" above floor.	B. (4.31.3).
Stairs	Handrails on rear stairway leading to second floor are not always between 34" and 38" above riser.	(4.9.4)(5).	

BUILDING NUMBER: 5030
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sand Key/Bathroom Building
Clearwater Pass

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Walkway does not exist to Rest Rooms from sidewalk, accessible parking, Toll Booth, or from Bridge Tender Building.	(4.3.2)(1)&(2). Install sidewalk.
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are proper size and arrangement.	A. (4.17.3). Modify stalls as required.
	B. Toilet stall doors do not provide 32" wide opening.	B. (4.17.5). Modify stalls as required.
	C. Grab bars do not exist behind toilets in Men's or Women's Rest Rooms.	C. (4.17.6). Install grab bars.
Lavatories and Mirrors	A. Paper towel dispensers in Men's and Women's Rest Rooms are too high.	A. (4.23.7). Lower dispensers.
	B. Sinks in Men's and Women's Rest Rooms have exposed water pipes.	B. (4.19.4). Modify as required.

BUILDING NUMBER: 5035
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sand Key Bridge Tender
Clearwater Pass

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Curb exists between walkway and doorway to Booth.	NOTE: No Public Access. (4.3.2.)(1).
	B. Does not exist to bottom floor for a person in a wheelchair.	B. (4.3.2)(2).
Stairs	A. Stair treads are less than 11" wide. Open risers exist.	A. (4.9.2).
	B. Handrails on stairs leading to lower floor are not proper height.	B. (4.9.4)(5).
Toilet	A. Proper clear floor space in front of toilet does not exist.	A. (4.16.2).
	B. Grab bars do not exist.	B. (4.16.4). Also (4.26).
Sink	A. Exposed hot water and drain pipes exist underneath sink on lower level.	A. (4.24.6).
	B. Clear floor space in front of sink does not exist.	B. (4.24.5).
Counter (Controls)	Proper knee clearance is not provided at Bridge Control Counter.	(4.32.3).

BUILDING NUMBER: 5040
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sand Key Toll Booth
Clearwater Pass

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist from Employee Parking across island to Toll Booth.	NOTE: No Public access; employees only. A. (4.3.2)(1)(2).
	B. Does not exist from Rest Rooms across island to Toll Booth.	B. (4.3.2)(2).
Space Allowance	Proper clear floor space is not provided inside Toll Booth.	(4.2).
Doors	A. Threshold of doorway to 950 Building exceeds 1/2".	A. (4.13.8). Also (4.7.1).
	B. Doorway at entrance to Toll Booth does not provide 32" opening.	B. (4.13.5).
	C. Threshold at doorway to Toll Booth exceeds 1/2".	C. (4.13.8). Also (4.7.1).
Telephone	Public Telephone Booth is not Hearing Aid compatible with proper volume control. Also, proper clear floor space is not provided inside Booth, nor is 32" opening provided at Booth doorway.	(4.31.5)(1)(2). Also (4.31.2) and (4.13.5). See Cover Sheet.
Drinking Fountain	A. Fountain inside 950 Building has a spout 42" from ground.	A. (4.15.2).
	B. Fountain inside 950 Building does not provide clear floor space or proper knee space.	B. (4.15.5).
Water Closets	A. Toilet is not the proper height (950 Building).	A. (4.16.3).
	B. Clear floor space is not provided in front of toilet (950 Building).	B. (4.16.2).

BUILDING NUMBER: 5040
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sand Key Toll Booth
Clearwater Pass

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	Doorway to Rest Room does not provide 32" opening (950 Building).	(4.13.5).
Lavatories Mirrors	and Exposed water pipes underneath sink exist (950 Building).	(4.19.4).

BUILDING NUMBER: 5045
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Seminole Docks
End of Seminole Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(120 Spaces) Accessible parking spaces designated by a sign showing the symbol of accessibility, do not exist.	(4.6.2). See also (4.6.3), (4.6.4), (4.30). Modify as required.

BUILDING NUMBER: 5050
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Seminole Boat Ramp
W. End of Seminole Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Walkway to designated Picnic Table does not exist.	A. (4.3.2)(2). Designated table exists in new area of park.
	B. Does not exist to drinking fountain by Boat Ramp.	B. (4.3.2)(2). Install Handicapped fountain.
Drinking Fountain	Fountain does not provide proper clear floor space that allows a person in a wheelchair to make a parallel approach to the unit.	(4.15.5)(2). See B.

BUILDING NUMBER: 5055
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Shuffleboard Club
1020 Calumet Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(81 Spaces) Two accessible spaces with signage exist. Four should exist.	(4.6.2). Also (4.1.2). Modify parking area as required.
Accessible Route	Does not exist to Tournament Room, Scorer's Table; (11" step up to Scorer's Table).	(4.3.2)(2). Install ramp.
Doors	A. Door to booth (Tournament Booth), does not provide 32" opening.	A. (4.13.5). Modify door opening as required.
	B. Neither leaf on double doors at Main Entrance provide 32" opening.	B. (4.13.5). Modify as required.
	C. Doors to Women's and Men's Rest Rooms do not provide 32" opening.	C. (4.13.5). Modify as required.
	D. Neither leaf on double doors at West exit to Courts provide 32" opening.	D. (4.13.5). Modify as required.
	E. Outside door from kitchen has threshold greater than 1/2".	E. (4.13.8). Install ramp.
	F. Doors to inside Courts do not provide 32" opening.	F. (4.13.5). Modify as required.
	G. Door to players' Equipment Room has threshold greater than 1/2"; (4" step exists).	G. (4.13.8). Install ramp.
Entrances	A. Front Main Entrance has a sloped, not level area at threshold in front of door.	A. (4.13.6). Modify as required.
	B. West door to Courts has area in front of door which is sloped and not level.	B. (4.13.6). Modify as required.

BUILDING NUMBER: 5055
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Shuffleboard Club
1020 Calumet Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	A. Counters around Main Room are 42" and 37-1/2" high.	A. (4.32.4). Lower counter top.
	B. Counters in Kitchen are 36" high.	B. (4.32.4). Staff personnel only.
Sink	A. Kitchen sink does not provide proper knee clearance.	A. (4.24.3). Staff personnel only.
	B. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	B. (4.24.3). Modify as required.
Water Fountain	A. Fountain by Courts (outside), does not provide proper clear floor space.	A. (4.15.5)(1). Relocate fountain; install Handicapped type.
	B. Fountain by Courts (outside), has water flow toward rear.	B. (4.15.3). See A.
	C. Fountain by Courts (outside), has spout too high from ground.	C. (4.15.2). See A.
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are proper size or arrangement.	A. (4.17.3). Also (4.22.4). Modify as required.
	B. Doors to toilet stalls in Men's and Women's Rest Rooms are not a minimum of 32" wide.	B. (4.17.5). Modify stalls as required.
Water Closets	Grab bars are too high on the sides of Men's and Women's Rest Room stalls, and do not exist behind toilet in Men's or Women's Rest Rooms.	(4.17.6). Modify as required.

BUILDING NUMBER: 5055
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Shuffleboard Club
1020 Calumet Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	<p>A. Mirrors over sinks in Men's and Women's Rest Rooms are too high.</p> <p>B. Sinks in Men's and Women's Rest Rooms have exposed water pipes.</p> <p>C. Paper towel dispensers are too high in Men's and Women's Rest Rooms.</p>	<p>A. (4.19.6). Lower mirrors.</p> <p>B. (4.19.4). Also (4.24.6). Modify as required.</p> <p>C. (4.23.7). Also (4.2.5), (4.2.6). Lower dispensers.</p>
Tournament Booth	Door to Booth does not provide 32" wide opening.	(4.13.5). Staff personnel only.

BUILDING NUMBER: 5060
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sid Lickton Field
714 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Accessible walkway does not exist from parking to Ballfields #1, #2, #3, #6, & #7.	A. (4.3.2)(1). Install sidewalk.
	B. Walkway does not exist to Bleachers at Ballfields #1, #2, #4, #6, & #7.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist for persons in wheelchairs to Second Floor Pressbox.	C. (4.3.2)(2). Staff only.
	E. Walkway does not exist to a designated Picnic Table at Ballfield #7.	E. (4.3.2)(2). Relocate table to accessible location.
Doors	A. Threshold at doorway to Equipment Room at Ballfield #5 is 1-1/2" high.	A. (4.13.8). Employees only.
	B. Thresholds at doorways of Pressbox at Ballfield #3 are 1" high.	B. (4.13.8). Staff only.
Stairs	Handrail of stairs to Pressbox at Ballfield #3 is 30" from ground.	(4.9.4)(5). Staff only.
Assembly Areas (Bleachers)	Wheelchair locations do not exist by Bleachers at Ballfields #1, #2, #3, #4, #5, #6 & #7.	(4.33.3). Also (A4.33), (A4.33.3). Designate areas.
Water Fountains	A. Fountains at Ballfields #1, #2, #3, #4, #5, & #7, have spouts located at rear.	A. (4.15.3). Install Handicapped fountains.
	B. Fountains at Ballfields #1, #2, #3, #4, #5, & #7, have water flow less than 4" high.	B. (4.15.3). See A.

BUILDING NUMBER: 5060
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sid Lickton Field
714 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
C. Fountains at Ballfields #1,#2,#3,#4,#5, & #7, have water flow not within 3" of front edge of fountain.	C. (4.15.3). See A.	
D. Fountains at Ballfields #1,#2,#3,#4,#5, & #7, have spouts higher than 36" measured from the ground to spout outlet.	D. (4.15.2). See A.	
E. Fountains at Ballfields #1,#2,#3,#4,#5, & #7, do not provide proper clear floor space that allows a person in a wheelchair to make a parallel approach to the unit.	E. (4.15.5)(2). See A.	

BUILDING NUMBER: 5065
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sign Shop/Traffic Engineering
410 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Main Entrance door has a 6" curb and does not provide a proper curb ramp.	NOTE: No Public access; employees only. (4.13.8). Also (4.7).
	B. Door into Garage has a 2" step at threshold.	B. ((4.13.8). Also (4.5.2).
	C. Threshold at double doors between Office and Garage exceeds 1/2".	C. (4.13.8).
Sinks	Utility sink in Rest Room does not provide proper knee clearance.	(4.24.3).
Counters and Desks	Desks and counters in Office do not provide proper knee clearance.	(4.32.3).
Urinal	Urinal in Rest Room is not accessible with sink in present location.	(4.18.3).
Shower Stall	A. Shower stall in Rest Room is not the proper size.	A. (4.21.2).
	B. Curb of stall exceeds 1/2" in height.	B. (4.21.7).
	C. A proper shower spray unit is not provided.	C. (4.21.6).

BUILDING NUMBER: 5070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste/Recycle
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Does not exist into Recycle Trailer for persons in wheelchairs.	NOTE: No Public access; employees only. (4.3.2)(1)&(2).
Doors	Threshold at doorway to Recycle Trailer exceeds 1/2".	(4.13.8).
Sink	Sink in Recycle Trailer does not provide proper knee clearance.	(4.24.3).
Water Closets	Toilet in Recycle Rest Room is not the proper height.	(4.16.3)..
Doors	Rest Room door in Recycle Trailer does not provide 32" wide opening.	(4.13.5).
Toilet Stalls	A. Rest Room in Recycle Trailer does not provide proper size and arrangement.	A. (4.17.3).
	B. Grab bars do not exist in Recycle Trailer Rest Room.	(4.17.6).
Lavatories and Mirrors	A. Exposed pipes underneath sink exist in Recycle Rest Room.	A. (4.19.4).
	B. Mirror over sink in Recycle Rest Room is too high above floor.	B. (4.19.6).
Dispensers	Paper towel dispenser in Recycle Rest Room is too high above floor.	(4.23.7).

BUILDING NUMBER: 5075
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste Division
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking space, designated by a sign showing the symbol of accessibility, does not exist.	NOTE: No modifications at this time; UFAS, 4.1.6, (Exceptions). (4.6.4).
Accessible Route	Does not exist into Solid Waste Administration Trailer, for persons in wheelchairs.	(4.3.2)(1)&(2).
Water Closet	Grab bars do not exist behind toilet in Administration Trailer Rest Room.	(4.16.4).
Lavatories and Mirrors	<p>A. Exposed pipes exist underneath sink in Administration Trailer Rest Room.</p> <p>B. Mirror over sink in Administration Trailer is too high from floor.</p>	<p>A. (4.19.4).</p> <p>B. (4.19.6).</p>
Dispensers	Paper towel dispenser in Administration Trailer is too high above floor.	(4.23.7).
Drinking Fountain	<p>A. Spout on fountain in Administration Trailer is too high above floor.</p> <p>B. Water flow is directed toward rear on fountain in Administration Trailer.</p> <p>C. Clear floor space is not provided in front of fountain in Administration Trailer.</p>	<p>A. (4.15.2).</p> <p>B. (4.15.3).</p> <p>C. (4.15.5)(2).</p>

BUILDING NUMBER: 5075
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste Division
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Thresholds at doors to Operations Building are greater than 1/2".	A. (4.13.8).
	B. Thresholds at North doors of Operations Building are greater than 1/2".	B. (4.13.8).
	C. Doorway between Operations and Break Room does not provide 32" wide opening.	C. (4.13.5).
	D. Doorway of Operations Women's Rest Room does not provide 32" wide opening.	D. (4.13.5).
	E. Threshold at doorway to Administration exceeds 1/2"; (step).	E. (4.13.8).
Water Fountains	A. Fountain in Operations has spout too high above floor.	A. (4.15.2).
	B. Fountain in Operations has water directed toward rear.	B. (4.15.3).
	C. Fountain in Operations does not provide proper clear floor space.	C. (4.15.5)(2).
Fixed Tables	Tables in Operations Break Room do not provide proper knee clearance.	(4.32.3).
Stairs	Handrails on stairs to Administration Trailer are only on one side of stairs.	(4.9.4)(1).
Water Closets	Toilets in Operations Men's and Women's Rest Rooms are not the proper height.	(4.16.3).

BUILDING NUMBER: 5075
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste Division
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>A. There are no stalls in Operations Men's or Women's Rest Rooms that are the proper size and arrangement.</p> <p>B. Stall doors in Operations Men's and Women's Rest Rooms do not provide 32" wide opening.</p> <p>C. Grab bars do not exist in any stalls in Operations Men's or Women's Rest Rooms.</p>	<p>A. (4.17.3).</p> <p>B. (4.17.5).</p> <p>C. (4.17.6).</p>
Dispensers	Paper towel dispensers in Operations Men's and Women's Rest Rooms are too high above floor.	(4.23.7).
Lavatories and Mirrors	<p>A. Mirrors above sinks in Operations Men's and Women's Rest Rooms are too high above floor.</p> <p>B. Exposed pipes underneath sinks exist in Operations Men's and Women's Rest Rooms.</p>	<p>A. (4.19.6).</p> <p>B. (4.19.4).</p>
Sinks	Sinks in Operations Men's and Women's Rest Rooms do not provide proper knee clearance.	(4.24.3).
Shower Stalls	<p>A. Curbs exist at entrances to shower stalls in Operations Men's and Women's Rest Rooms.</p> <p>B. Doorways to shower stalls in Operations Men's and Women's Rest Rooms do not provide 32" wide opening.</p>	<p>A. (4.21.7).</p> <p>B. (4.13.5).</p>

BUILDING NUMBER: 5075
TARGET DATE: 1993
COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste Division
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Proper spray unit is not provided in Operations Men's and Women's Rest Room shower stalls.	C. (4.21.6).
	D. Proper seat is not provided in shower stalls of Operations Men's and Women's Rest Rooms.	D. (4.21.3).
	E. There are no shower stalls with proper size and clearances in Operations Men's and Women's Rest Rooms.	E. (4.21.2).

BUILDING NUMBER: 5080
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: South Pavilion Garage
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

NOTE: No Public access;
employees only.

BUILDING NUMBER: 5090
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Station Square Park
620 Cleveland Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Dining Areas	Outdoor dining areas, (tables and chairs), have no accessible seating for people in wheelchairs, (with proper signage).	(5.4). Provide Handicapped table with signage.
Water Fountain	<p>A. Proper clear knee space is not provided.</p> <p>B. Fountain spout is 39" measured from the floor to the spout outlet.</p> <p>C. Control button on spout is 7-1/2" from front edge of fountain.</p>	<p>A. (4.15.5)(1). Install Handicapped fountain.</p> <p>B. (4.15.2). Install Handicapped fountain.</p> <p>C. (4.15.3). Install Handicapped fountain.</p>

BUILDING NUMBER: 6005
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Tennis Complex/Beach
Mandalay and Eldorado

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	There is no accessible route from parking to entrance of Courts due to the lack of a curb ramp.	(4.6.2), also (4.7.1). Install curb ramp.
Drinking Fountain	A. Fountain by Courts does not provide proper clear floor space that allows a person in a wheelchair to make a parallel approach to the unit.	A. (4.15.5)(2). Install Handicapped fountain.
	B. Fountain has water flow less than 4" high.	B. (4.15.3). See A.

BUILDING NUMBER: 7000
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Transfer Station/Trailers
1005 Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	<p>A. Stairs into Trailer (Break Room) have open risers and non-uniform risers.</p> <p>B. Handrails on stairs are not proper height, or continuous on both sides.</p>	<p>NOTE: No Public access; employees only. A. (4.9.2).</p> <p>B. (4.9.4)(1-7).</p>
Accessible Route	<p>Without ramp to Trailer, Break Room is not accessible.</p>	(4.3.2)(2). Also (4.8).
Drinking Fountains	<p>Fountain in Break Room has spout too high.</p>	(4.15.2).
Doors	<p>Threshold at doorway to shed in Trailer area has a slope exceeding 1:2.</p>	(4.13.8). Also (4.5.2).

BUILDING NUMBER: 7010
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Transfer Station/Scalehouse
1005 Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Doorway to Rest Room does not provide 32" wide opening.	NOTE: No Public access; employees only. A. (4.13.5).
	B. Front entrance door has a 4" step.	B. (4.13.8).Also (4.5.2).
	C. Counter on office door is too high off ground.	C. (7.2).
Drinking Fountains	A. Fountain does not provide proper clear floor space with present position by doorway.	A. (4.15.5)(2).
	B. Fountain has spout too high from ground.	B. (4.15.2).
Tables	Outside Picnic Table does not provide proper knee clearance. Also desk in office.	(4.32.3).
Water Closets	A. Clear floor space is not provided for wheelchair accessibility.	A. (4.16.2).
	B. Toilet is not the proper height.	B. (4.16.3).
	C. Grab bars do not exist in Rest Room.	C. (4.16.4).
Dispensers	Paper towel dispenser is too high.	(4.23.7).

BUILDING NUMBER: 7020
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Transfer Station
1005 Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Threshold at doorway to Utility Shed has a rough-finished slope exceeding 1:2.	NOTE: No Public access; employees only. A. (4.13.8). Also (4.5.2).
	B. Threshold at Rest Room exceeds 1/2".	B. (4.13.8).
	C. Door to Operation Room has a 3" step.	C. (4.13.8).
Reach Ranges	Control Panel in Operation Room exceeds proper reach ranges.	(4.2.5).
Urinal	Urinal has rim higher than 17" above floor.	(4.18.2).
Dispensers	Paper towel dispenser in Rest Room is too high off the floor.	(4.23.7).
Toilet Stalls	A. No stalls in Rest Room provide proper size and arrangement.	A. (4.17.3).
	B. Grab bars do not exist in any stall.	B. (4.17.6).
	C. Toilets are not the proper height.	C. (4.16.3).
Lavatories and Mirrors	A. Mirror is too high from the floor.	A. (4.19.6).
	B. Exposed water pipes exist underneath sinks.	B. (4.19.4).
Drinking Fountain	A. Drinking fountain in Rest Room does not provide proper knee clearance or clear floor space.	A. (4.15.5)(1)&(2).
	B. Drinking fountain in Rest Room has a spout too high from the floor.	B. (4.15.2).

BUILDING NUMBER: 7200
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Turner Street Dock
West End of Turner Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking space designated by a sign showing the symbol of accessibility, does not exist.	NOTE: Federal Register; Section 4.1.1, (Exception 5A). (4.6.2), (4.6.3), (4.6.4), (4.30).
Accessible Route	A. Stairs make wheelchair access to Dock impossible.	A. (4.3.2)(2).
	B. Accessible walkway to at least one picnic bench (by street), does not exist.	B. (4.3.2)(2).
	C. Does not exist from street to sidewalk connecting to stairs.	C. (4.3.2)(1).
Stairs	Top of handrail of stairs is 32-1/2" above stair nosings.	(4.9.4)(5).

BUILDING NUMBER: 7215
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Island Estates Playground
Larboard Way

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces designated by a sign showing the symbol of accessibility, does not exist.	(4 . 6 . 2) . A l s o (4.6.3), (4.6.4), (4.30). Street parking only.
Accessible Route	Walkway does not exist to Playground.	(4.3.2)(2). Install sidewalk.

BUILDING NUMBER: 7220
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Utilities Building
900 Chestnut Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(60 Spaces) One accessible space exists. Three should exist. One accessible space has signage too low.	(4.6.3). Also (4.1.2)(5B). Modify as required.
Accessible Route	<p>A. Second floor is not accessible to persons in a wheelchair.</p> <p>B. Does not exist to Picnic Table in grass by East side entrance.</p> <p>C. Hallway between Finance and Customer Service does not provide minimum clear width of 36", with copier and bookcase in present location.</p> <p>D. Hallway by Drive-In Cashier does not allow minimum clear width of 36", with table in present location.</p> <p>E. Second floor Men's Rest Room does not provide minimum clear width of 36", with barrier wall in present location.</p> <p>F. Chairs (stationary) in front of Customer Service windows make wheelchair accessibility impossible.</p>	<p>A. (4.3.2)(2). Not required by A.D.A.. Services will be provided at alternate locations as needed.</p> <p>B. (4.3.2)(2). Employees only.</p> <p>C. (4.3.3). Employees only.</p> <p>D. (4.3.3). Employees only.</p> <p>E. (4.3.3). Employees only.</p> <p>F. (4.3.2)(2). Modify section of counter.</p>

BUILDING NUMBER: 7210
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: U.S. 19 Soccer Field
Frontage Rd./S.R. 60 & Dre

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	No accessible parking spaces with sign showing the symbol of accessibility exist.	(4.6.3),(4.6.4)&(4.6.2). Modify as required.
Accessible Route	Does not exist from parking to accessible walkway to Soccer Field.	(4.3.2)(1)&(2). Install sidewalk.

BUILDING NUMBER: 7220
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Utilities Building
900 Chestnut Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramp	A. Northeast sidewalks do not provide curb ramps at curb by parking.	A. (4.7.1). Install curb ramp.
	B. Does not exist at step to entrance on Prospect Street.	B. (4.7.1). East entrance designated as handicapped.
	C. Does not exist at 7" step into two offices on South side.	C. (4.7.1). Install ramp.
	D. Does not exist at threshold of Drive-In Window doorway.	D. (4.7.1). Employees only.
Alarms	Visual Alarm System is not an integral part of building's Alarm System.	(4.28.1). Install as required.
Doors	A. Threshold at double door entrance on Prospect Street exceeds 1/2".	A. (4.13.8). Not designated entrance.
	B. Threshold at double doors entrance on East side of building exceeds 1/2".	B. (4.13.8). Modify as required.
	C. Swinging door at Customer Service Counter does not provide proper 32" wide opening.	C. (4.13.5). Employees only.
	D. Doorways into first floor and second floor Men's and Women's Rest Rooms do not provide 32" wide opening.	D. (4.13.5). Modify as required.
	E. Threshold at first floor Employee Entrance exceeds 1/2".	E. (4.13.8). Employees only.

BUILDING NUMBER: 7220
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Utilities Building
900 Chestnut Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD	
Doors	F. Storage Room in first floor Finance Office has doorway that does not provide 32" wide opening.	F. (4.13.5). Employees only.	
	G. Doorway to second floor Copy Room does not allow 32" wide opening.	G. (4.13.5). Employees only.	
	H. Administration's small Conference Room doorway does not provide 32" wide opening.	H. (4.13.5). Employees only.	
	I. Doorways to Men's and Women's second floor Rest Rooms do not provide 32" wide opening.	I. (4.13.5). Employees only.	
	J. Second floor Switch Room (storage) does not provide 32" wide opening.	J. (4.13.5). Employees only.	
	K. Second floor Utility Room (off hallway) does not provide 32" wide opening.	K. (4.13.5). Employees only.	
	L. Doorway from Powder Room to stalls in Women's second floor Rest Room does not provide 32" wide opening.	L. (4.13.5). Employees only.	
	Water Fountains	A. Fountains on first floor by first floor Rest Rooms, and on second floor, have spouts too high.	A. (4.15.2). Install Handicapped fountain on first floor.
		B. Fountains on first floor, by first floor Rest Rooms, and on second floor, have water flow toward rear.	B. (4.15.3). See A.

BUILDING NUMBER: 7220
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Utilities Building
900 Chestnut Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountains	C. Fountain on first floor does not provide proper clear floor space.	C. (4.15.5)(2). See A.
Counters	A. Counter at Customer Service does not provide 36" x 36" area for persons in wheelchair.	A. (7.2). Modify Section of Counter.
	B. Counter at first floor Cashier's Office does not provide 36" x 36" area.	B. (7.2). Service area, Staff to provide assistance as needed.
	C. Meter Reader's Break Room tables do not provide proper knee clearance.	C. (4.32.3). Employees only.
Sinks	A. Second floor Utility Room sink (off hallway) does not provide proper knee clearance.	A. (4.24.3). Employees only.
	B. Kitchen sink does not provide proper knee clearance (on second floor).	B. (4.24.3). Employees only.
	C. Clear floor space in front of sink in first floor Rest Room is not provided.	C. (4.24.5). Modify as required.
Stairs	East side stairway to second floor does not provide continuous handrails at proper height.	(4.9.4)(1-7). Modify as required.
Water Closets	A. Toilets in Men's and Women's first floor Rest Rooms, Men's and Women's second floor Rest Rooms, and second floor Administration Rest Rooms, are not the proper height.	A. (4.16.3). Replace toilets in first floor Bathrooms.

BUILDING NUMBER: 7220
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Utilities Building
900 Chestnut Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	<p>B. Proper clear floor space is not provided in Men's and Women's second floor Administration Rest Rooms.</p> <p>C. Grab bars do not exist in Men's or Women's Administration Rest Rooms.</p>	<p>B. (4.16.2). Employees only.</p> <p>C. (4.16.4). Employees only.</p>
Toilet Stalls	<p>A. There are no toilet stalls in Men's and Women's first or second floor Rest Rooms that are the proper size and arrangement.</p> <p>B. Stall doors in Men's and Women's first and second floor Rest Rooms do not provide 32" wide opening.</p> <p>C. Grab bars do not exist in stalls of Men's and Women's first or second floor Rest Rooms.</p>	<p>A. (4.17.3). Modify first floor bathrooms as required.</p> <p>B. (4.17.5). See A.</p> <p>C. (4.17.6). Install grab bars in first floor bathrooms.</p>
Lavatories/Mirrors	<p>A. Mirrors in first floor Men's and Women's Rest Rooms, second floor Men's and Women's Rest Rooms, and second floor Men's and Women's Administration Rest Rooms, are too high above floor.</p> <p>B. Exposed pipes underneath sinks exist in Men's and Women's first floor, second floor, and second floor Administration Rest Rooms.</p>	<p>A. (4.19.6). Lower mirrors in first floor bathrooms.</p> <p>B. (4.19.4). Modify first floor as required.</p>

BUILDING NUMBER: 7500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Wood Valley Park
2816 Park Trail Lane

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Assembly Areas (Bleachers)	Wheelchair locations do not exist at Bleachers.	(4.33.3). Designate area.
Doors	Front doorway threshold is greater than 1/2".	(4.13.8). Install ramp.
Ground Surfaces	Playground surface is made of wood chips, not a stable, firm, slip-resistant surface.	(4.5.1). N/A; Alters original intent of area.
Water Fountain	With Vending Machine in present location, proper clear floor space is not provided.	(4.15.5)(2). Relocate vending machine.
Sinks	With sink in present location at Women's Rest Room, minimum clear width is not provided for wheelchair entry.	(4.3.3). Modify as required.
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3). Modify as required.
	B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	B. (4.17.5). Modify as required.
	C. Grab bars do not exist in stalls of Men's and Women's Rest Rooms (behind toilets).	C. (4.17.6). Install grab bars.
Urinals	Urinal in Men's Rest Room has a rim too high above floor.	(4.18.2). Replace urinal.
Lavatories	Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	(4.24.3). Modify as required.

BUILDING NUMBER: 7230
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Utilities Annex Building
401 S. Prospect Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility do not exist.	NOTE: Structural Impracticality; UFAS, 4.1.6, (Exceptions 5A). (4 . 1 . 2) . A 1 s o (4.6.2), (4.6.3), (4.6.4).
Accessible Route	Walkway on North side of building by parking is less than 36" minimum clear width.	(4.3.3).
Curb Ramp	Curb ramp is not provided at existing step where North side walkway and Prospect St. sidewalk intersect.	(4.7.1).
Doors	A. Thresholds at Main Entrance doors on Prospect Street exceed 1/2".	A. (4.13.8).
	B. Threshold at single entrance door (with stairs) exceeds 1/2" (Prospect St. side).	B. (4.13.8).
	C. One of doors on rear porch does not provide 32" wide opening.	C. (4.13.5).
	D. Rear single door (with ramp) does not provide 32" wide opening.	D. (4.13.5).
	E. Eight inside doorways throughout building do not provide 32" wide opening.	E. (4.13.5).
	F. Three Rest Room doors do not provide 32" opening.	F. (4.13.5).

BUILDING NUMBER: 7240
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Valencia Park
2100 N. Hercules Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking space designated by a sign of accessibility, does not exist.	(4 . 6 . 2) . A l s o (4.6.3),(4.6.4),(4.30). Modify as required.
Accessible Route	A. Does not exist from parking lot to accessible walkway.	A. (4.3.2). Install sidewalk.
	B. Does not exist from walkway to Basketball Courts.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist from walkway to Tennis Courts.	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist from walkway into Playground areas.	D. (4.3.2)(2). Install sidewalk.

BUILDING NUMBER: 7230
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Utilities Annex Building
401 S. Prospect Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	<p>A. Mirrors in all three Rest Rooms are too high from the floor.</p> <p>B. Exposed water pipes exist underneath sinks in the three Rest Rooms.</p>	<p>A. (4.19.6).</p> <p>B. (4.19.4).</p>
Bathtubs	<p>There are no accessible bathtubs in any of the three Rest Rooms.</p>	

BUILDING NUMBER: 7230
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Utilities Annex Building
401 S. Prospect Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	A. Stairs at single door (with stairs) on Prospect St. side, have handrails on only one side.	A. (4.9.4)(1).
	B. Stairs in rear at porch have no handrails.	B. (4.9.4)(1-7).
Curb Ramp	Curb ramp is not provided from parking, (where there should be double spaces with access aisle at curb ramp), to walkway leading to an accessible entrance.	(4.7.1).
Ramp	A. Ramp at rear single door does not provide proper slope and rise.	A. (4.8.2).
	B. Ramp at rear single door does not provide a level landing by door.	B. (4.8.4). Also (4.13.6).
Sinks	Kitchen sink does not provide proper knee clearance.	(4.24.3).
Water Closets	A. Toilets in three Rest Rooms are not the proper height.	A. (4.16.3).
	B. Proper clear floor space is not provided in any Rest Room.	B. (4.16.2).
	C. Grab bars do not exist in any Rest Room.	C. (4.16.4).

BUILDING NUMBER: 7500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Wood Valley Park
2816 Park Trail Lane

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space does not exist near entrance walkway or by Ball Field.	(4.6.3),(4.6.4)&(4.6.2). Street parking only.
Curb Ramp	A. Does not exist where street and walkway to entrance meet.	A. (4.7.1). Install curb ramp.
	B. Does not exist at rear double doors leading outside from Ping Pong Room (step exists).	B. (4.7.1). Install curb ramp.
	C. Does not exist by rear door of Pool Room leading to Patio (step exists).	C. (4.7.1). Install curb ramp.
	D. Does not exist where patio and sidewalk meet by rear Pool Room door (step exists).	D. (4.7.1). Install curb ramp.
Accessible Route	A. Does not exist from main walkway to Tennis Courts.	A. (4.3.2)(2). Install sidewalk.
	B. Does not exist from main walkway to Basketball Courts.	B. (4.3.2)(2). Install sidewalk.
	C. Does not exist from main walkway to Playground.	C. (4.3.2)(2). Install sidewalk.
	D. Does not exist from main walkway to Ball Field.	D. (4.3.2)(2). Install sidewalk.
	E. Does not exist from street to Ball Field.	E. (4.3.2)(2). Install sidewalk.
	F. Min m clear width of 36" is not provided on sidewalk around building.	F. (4.3.3). Widen walkway.

BUILDING NUMBER: 7220
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Utilities Building
900 Chestnut Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Dispensers	Paper towel dispensers in Men's and Women's first floor, second floor, and second floor Administration Rest Rooms, are too high above floor.	(4.23.7). Lower dispensers in first floor bathrooms.
Urinals	Urinals in Men's first and second floor Rest Rooms have rims too high from floor.	(4.18.2). Replace urinals in first floor bathrooms.

BUILDING NUMBER: 7510
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Woodgate Park
2495 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking space, designated by a sign showing the symbol of accessibility, does not exist.	(4 . 6 . 2) . A l s o (4.6.3), (4.6.4), (4.30). Install as required.
Accessible Route	<p>A. Does not exist from walkway to Basketball Courts.</p> <p>B. Walkway into parking lot is not accessible without curb ramp.</p>	<p>A. (4.3.2)(2). Install sidewalk.</p> <p>B. (4.7.1). Install curb ramp.</p>
Doors	<p>A. Threshold to Women's Rest Room is 1-1/2".</p> <p>B. Threshold to Men's Rest Room is 2".</p> <p>C. Threshold to drinking fountain is 2".</p>	<p>A. (4.13.8). Install ramp.</p> <p>B. (4.13.8). Install ramp.</p> <p>C. (4.13.8). Install ramp.</p>
Drinking Fountain	Fountain is not accessible in its present location, nor is the proper clear floor space present.	(4.15.5)(1). Install Handicap fountain.
Toilet Stalls	<p>A. There is no stall in Men's or Women's Rest Rooms that is accessible. Now 51" by 36" is the largest stall.</p> <p>B. Grab bars in Men's and Women's Rest Room stalls do not exist.</p>	<p>A. (4.17.3). Also (4.22.4). Modify stall as required.</p> <p>B. (4.17.6). Install grab bars.</p>
Water Closets	Water closets in both Men's and Women's Rest Rooms are 16" in height.	(4.16.3). Install Handicapped type.

BUILDING NUMBER: 7510
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Woodgate Park
2495 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	A. Sinks in both Men's and Women's Rest Rooms have exposed water pipes.	A. (4.24.6). Modify as required.
	B. Knee clearance underneath sinks in both Men's and Women's Rest Rooms is 22-1/2".	B. (4.24.3). Modify as required.

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Pier 60 Pavilion
10 Bay Esplanade

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Ramps	Ramps at entrance to Men's and Women's Rest Rooms do not provide level area in front of doorway.	NOTE: Lessee responsible for ADA compliance. (4.8.4)(4). Also (4.13.6).
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3).
	B. Grab bars do not exist in Men's or Women's Rest Room stalls.	B. (4.17.6).
	C. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	C. (4.17.5).
Water Closets	Toilets in Men's and Women's Rest Rooms are not the proper height.	(4.16.3).
Lavatories	A. Sinks in Men's and Women's Rest Rooms have exposed water pipes underneath.	A. (4.19.4).
	B. Sinks in Men's and Women's Rest Rooms do not provide proper clear floor space.	B. (4.24.5).
Drinking Fountains	A. Fountain by Women's Rest Room has spout too high from floor.	A. (4.15.2).
	B. Proper knee clearance is not provided at fountain by Women's Rest Room, and water flow is not within 3" of the front of fountain.	B. (4.15.5)(1)&(2). Also (4.15.3).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Pier 60 Pavilion
10 Bay Esplanade

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramp	A. Proper curb ramp does not exist up to Dairy Bar.	A. (4.7.1).
	B. Sidewalk in front of Gift Shop does not provide proper curb ramp (step exists).	B. (4.7.1).
Doors	A. Single North side door of Dairy Bar has a threshold greater than 1/2"; (step exists).	A. (4.13.8).
	B. Single North side door does not provide 32" wide opening.	B. (4.13.5).
	C. Door to Gift Shop has threshold greater than 1/2".	C. (4.13.8).
	D. Door to Gift Shop does not provide 32" wide opening.	D. (4.13.5).
	E. Doorway between Gift Shop and Concession Area has threshold greater than 1/2".	E. (4.13.8).
	F. Doorway between Gift Shop and Concession Area does not provide 32" wide opening.	F. (4.13.5).
	G. Doorway from behind Concession Stand leading to pool area has threshold greater than 1/2".	G. (4.13.8).
	H. Threshold at South door from behind Concession Stand has threshold greater than 1/2".	H. (4.13.8).
	I. Door by Time Clock (behind Concession Stand) does not provide 32" wide opening.	I. (4.13.5).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Pier 60 Pavilion
10 Bay Esplanade

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	J. Thresholds at both doorways to "Beachwear Shop" exceed 1/2".	J. (4.13.8).
	K. Doors to Fitting Rooms in "Beachwear Shop" do not provide 32" wide opening.	K. (4.13.5). Also (4.35.3).
	L. Door to Employee Rest Room does not provide 32" wide opening; (Beachwear Shop).	L. (4.13.5).
	M. Office door of "Beachwear Shop" does not provide 32" wide opening.	M. (4.13.5).
Fitting Room	A. Fitting Rooms of "Beachwear Shop" do not provide proper clear floor space.	A. (4.35.2).
	B. Fitting Rooms of "Beachwear Shop" do not provide proper bench.	B. (4.35.4).
Telephones	Three Public Telephones exist at Concession Stand, but none provide volume control nor are they Hearing Aid compatible.	(4.31.5)(1)&(2).
Counters	A. Counter around Dairy Bar is too high from the ground.	A. (4.32.4).
	B. Counter at Gift Shop is too high and does not provide 36" x 36" area for wheelchair accessibility.	B. (4.32.4). Also (7.2).
	C. Concession Counters are too high from the ground.	C. (4.32.4).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Pier 60 Pavilion
10 Bay Esplanade

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	D. Counters behind Concession Stand (Employee area), are too high from the ground.	D. (4.32.4).
	E. Counter at "Beachwear Shop" is too high and does not provide 36" x 36" area for wheelchair accessibility.	E. (4.32.4). Also (7.2).
Accessible Route	A. 36" aisle space is not always provided throughout Dairy Bar.	A. (4.3.3).
	B. 36" aisle space is not provided behind counter in Gift Shop.	B. (4.3.3).
	C. 36" aisle space is not always provided behind Concession Stand; (Employee area).	C. (4.3.3).
Water Closets	A. Toilet in Employee Rest Room of "Beachwear Shop" is not the proper height.	A. (4.16.3).
	B. Clear floor space in Employee Rest Room of "Beachwear Shop" is not provided.	B. (4.16.2).
	C. Grab bars do not exist in Employee Rest Room of "Beachwear Shop".	C. (4.16.4).

BUILDING NUMBER: _____
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Pier 60 Pavilion
10 Bay Esplanade

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	A. Sink in Employee Rest Room of "Beachwear Shop" does not provide the proper clear floor space.	A. (4.24.5).
	B. Sink in Employee Rest Room of "Beachwear Shop" has exposed water pipes underneath.	B. (4.24.6).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Beach Diner
56 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(45 Spaces) Two accessible spaces exist, but one has signage too low and the other has no signage.	NOTE: Lessee responsible for ADA compliance. (4.6.4).
Doors	A. Rear doorway has curb at threshold.	A. (4.7.1).
	B. Front double doors do not have at least one leaf that provides 32" wide opening (with bar).	B. (4.13.4).
	C. Doors to Men's and Women's Rest Rooms do not provide 32" wide opening.	C. (4.13.5).
	D. Door opening force on doors to Men's and Women's Rest Rooms is greater than 5 LBF.	D. (4.13.11)(2).
	E. Doorway into "Information Center" does not provide 32" wide opening.	E. (4.13.5).
	F. Two doorways to Kitchen do not provide 32" wide opening.	F. (4.13.5).
	G. Doorway to Kitchen Office does not provide 32" wide opening.	G. (4.13.5).
Curb Ramps	Curb ramp does not exist where parking and walkway to Main Entrance connect.	(4.7.1).
Ramps	Ramp at rear door does not have a level landing at top by door, and has uneven surface.	(4.8.4)(1-4). Also (4.5).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Beach Diner
56 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counters	<p>A. Main Counter with stools is too high and does not provide accessible area.</p> <p>B. Counters and tables in Kitchen are too high from the floor.</p> <p>C. Counters in "Information Center" are too high from the floor.</p>	<p>A. (4.32.4). Also (5.2).</p> <p>B. (4.32.4).</p> <p>C. (4.32.4).</p>
Built - In Seating/Tables	<p>Tables at booths do not provide proper knee clearance.</p>	(4.32.3).
Telephones	<p>Public Telephone does not provide volume controls, nor is it Hearing Aid compatible, nor is proper clear floor space provided, with chairs in present location.</p>	(4.31.5)(1)&(2). Also (4.31.
Accessible Route	<p>A. Minimum clear width is not provided at passage to Men's and Women's Rest Rooms.</p> <p>B. With pamphlet rack in present location in "Information Center", minimum clear width is not provided for accessibility.</p>	<p>A. (4.3.3).</p> <p>B. (4.3.3).</p>
Toilet Stalls	<p>A. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening, with latch in present location.</p> <p>B. There is one stall in Men's and Women's Rest Rooms that is the proper size and arrangement, and one stall in both Men's and Women's Rest Rooms that is not.</p>	<p>A. (4.17.5).</p> <p>B. (4.17.3).</p>

BUILDING NUMBER: _____
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Beach Diner
56 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	C. Grab bars do not exist behind toilets in Men's and Women's Rest Rooms.	C. (4.17.6).
Mirrors	Mirrors in Men's and Women's Rest Rooms are too high above the floor.	(4.19.6).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Clearwater Seafood Restaurant
37 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces are not located close to Restaurant entrances.	NOTE: Lessee responsible for ADA compliance. (4.6.2).
Accessible Route	Second floor is accessible only by stairway, thus is not accessible to persons in wheelchairs.	(4.3.2)(2).
Doors	A. Doors to Men's and Women's Rest Rooms on first and second floors, do not provide 32" wide opening.	A. (4.13.5).
	B. Threshold of doorway to Market exceeds 1/2".	B. (4.13.8).
	C. Double door gate on South side has a floor level change (step) that is not properly beveled with a slope less than 1:2.	C. (4.13.8). Also (4.5.2).
Ramps	Ramp in front of doorway to Market does not provide a level landing at top by door.	(4.8.4)(1-4). Also (4.13.6).
Stairs	Stairway on second floor leading to Bar, has handrails on only one side.	(4.9.4)(1-7).
Accessible Route	Minimum clear width of 36" is not provided at all aisles in second floor Kitchen.	(4.3.3).
Stairs	Handrails on stairs to second floor are not between 34" and 38" above floor.	(4.9.4)(5).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Clearwater Seafood Restaurant
37 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Stalls in Men's and Women's second floor Rest Rooms are not the proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Men's and Women's second floor, and Men's first floor Rest Rooms, do not provide 32" wide opening.	B. (4.17.5).
	C. Stall in Men's first floor Rest Room is not the proper size and arrangement.	C. (4.17.3).
	D. Grab bars behind toilets do not exist in first floor Men's and Women's Rest Rooms, and grab bars do not exist at all in Men's and Women's second floor Rest Rooms.	D. (4.17.6).
Water Closets	Toilets in Men's and Women's second floor Rest Rooms are not the proper height.	(4.16.3).
Urinals	Urinal in Men's second floor Rest Room has rim too high above floor.	(4.18.2).
Lavatories and Mirrors	A. Mirrors in second floor Men's and Women's Rest Rooms, and first floor Men's Rest Room, are too high above floor.	A. (4.19.6).
	B. Exposed pipes underneath sinks exist in Men's and Women's first and second floor Rest Rooms.	B. (4.19.4).
Dispensers	Paper towel dispensers in Men's and Women's Rest Rooms are too high above floor.	(4.23.7).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Clearwater Seafood Restaurant
37 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	A. Sinks in Men's and Women's second floor Rest Rooms do not provide proper knee clearance.	A. (4.24.3).
	B. Sink in Men's first floor Rest Room does not provide proper clear floor space.	B. (4.24.5).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Condon Gardens Recreation Ctr.
2930 Sandalwood Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(25 Spaces) An accessible space, with a sign showing the symbol of accessibility, does not exist.	NOTE: Responsibility of the Clearwater Housing Authority. (4.6.2), (4.6.3), (4.6.4).
Accessible Route	A. Does not exist from one Basketball Court to the other.	A. (4.3.2)(2).
	B. Does not exist to Playground.	B. (4.3.2)(2).
	C. Does not exist to Picnic Table with proper clear floor space.	C. (4.3.2)(2).
	D. Surface of Playground is wood chips.	D. (4.5.1).
	E. Walkway does not connect sidewalk to one of South side doorways.	E. (4.5.1).
Doors	A. Double outside doors at Library threshold exceed 1/2".	A. (4.13.8).
	B. East side door to Library threshold exceeds 1/2" (Exit from Pool Room).	B. (4.13.8).
	C. Threshold at Main Entrance door exceeds 1/2".	C. (4.13.8).
	D. Two doorways at Office do not provide 32" wide opening.	D. (4.13.5).
	E. Threshold at Exit Door from Meeting Room exceeds 1/2".	E. (4.13.8).
Curb Ramps	A. Does not exist from parking to sidewalk leading to Library.	A. (4.7.1).
	B. Does not exist at outside door to Basketball Courts.	B. (4.7.1).

BUILDING NUMBER: _____
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Condon Gardens Recreation Ctr.
2930 Sandalwood Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sink	Kitchen sink does not provide proper knee clearance, or proper clear floor space.	(4.24.3)&(4.24.5).
Drinking Fountain	A. Fountain in Pool Room has spout too high above floor.	A. (4.15.2).
	B. Fountain in Pool Room does not provide proper clear floor space, with portable steps in front of fountain.	B. (4.15.5(2)).
Doors	Doors to Men's and Women's Rest Rooms do not provide 32" wide opening.	(4.13.5).
Water Closets	Toilets in Men's and Women's Rest Rooms are not the proper height.	(4.16.3).
Toilet Stalls	A. Stalls in Men's and Women's Rest Rooms are not the proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	B. (4.17.5).
	C. Grab bars do not exist in Men's or Women's Rest Room stalls.	C. (4.17.6).
Dispensers	Paper towel dispensers in Men's and Women's Rest Rooms are too high above floor.	(4.23.7).
Lavatories	Sinks in Men's and Women's Rest Rooms do not provide proper clear floor space and knee clearance.	(4.24.5)&(4.24.3).

ESTIMATE SHEETS

A.D.A. Compliance Cost Estimates

Building Number	Building Name	Cost Estimate
1000	Armory	\$ 8,591
1010	Bayfront Tennis	\$ 6,981
1030	Beach Showers	\$ 0
1040	Beach Bathrooms	\$ 1,700
1050	Belmont Park	\$ 8,383
1060	Bombers Stadium	\$23,352
1080	Carpenter Field	\$31,977
1090	Cemetery Building	\$ 70
1100	Chesapeake Park	\$ 7,695
1400	Civic Center	\$32,799
1410	Clearwater Airpark	\$ 0
1420	Cliff Stephens Park	\$11,440
1430	Clw. Beach Rec. Center	\$19,445
1440	Coachman Park Bandshell	\$ 2,069
1450	Coachman Ridge Park	\$ 650
1460	Community Relations	\$ 1,327
1470	Country Hollow Park	\$ 5,790
1480	Countryside Comm. Park	\$55,050
1490	Countryside Sports Plex	\$ 5,125
1500	Crest Lake Park	\$64,006
1510	Cultural Arts	\$ 195
1520	David Martin Soccer	\$ 5,965
1540	Del Oro Park	\$ 8,015
1560	W.P.C./East Plant	\$ 0
1600	Ed Wright Park	\$22,896
1610	E.C. Moore Complex	\$ 8,635
1620	Ervins Youth Center	\$ 5,470
1700	Fire Station #45	\$ 6,490
1710	Fire Station #46	\$ 0
1715	Fire Station #47	\$ 0

A.D.A. Compliance Cost Estimates

1720	Fire Station #48/Train	\$ 0
1730	Fire Station #48	\$ 0
1735	Fire Station #49	\$ 0
1740	Fire Station #50	\$ 0
1810	Fleet Maintenance	\$ 5,226
1820	Fleet Radio Tower	\$ 0
1830	Fleet Radio Tower	\$ 0
1835	Fleet Fuel Site/Fire 6	\$ 0
1840	Fleet Fuel Site/Annex	\$ 0
1900	Forest Run Park	\$ 2,450
1920	Frank Tack Park	\$ 6,315
1930	Fred Cournoyer	\$ 6,390
1950	Garden Ave. Garage	\$20,010
2000	Gas Division/2nd Floor	\$ 0
2010	Gas Division/Welding	\$ 0
2020	Gas Division/West Bldg.	\$ 0
2030	Glen Oaks Golf Club	\$ 9,685
2040	Holt Street Pool	\$11,787
2045	Jack Russell Stadium	\$19,068
2055	Kings Highway Rec.	\$ 4,920
2060	lawn Bowling Club	\$16,180
2065	Clw. Beach Library	\$ 6,298
2070	Library Main	\$22,590
2075	East Library	\$ 9,280
2080	Countryside Library	\$ 6,168
2085	Greenwood Library	\$ 9,085
2090	Life Guard Building	\$ 1,048
4010	Magnolia Street Park	\$ 70
4020	Mandalay Pier	\$ 5,720
4030	Mandalay Park	\$11,000
4040	Marina Building	\$83,935

A.D.A. Compliance Cost Estimates

4050	Marina Post Office	\$ 9,572
4070	Marina Maintenance	\$ 1,200
4080	Marina Fuel Dock	\$ 2,188
4090	Marshall Street Park	\$ 9,150
4200	W.P.C. Marshall Street	\$ 0
4300	M.L. King Rec. Center	\$16,100
4305	Marymont Park	\$14,575
4310	McKay Field	\$ 4,500
4315	McMullen Tennis	\$13,447
4330	Moccasin Lake Park	\$ 5,850
4335	Montclair Park	\$ 4,500
4340	Morningside Handball	\$ 1,050
4345	Morningside Pool	\$15,372
4350	Morningside Tennis	\$14,072
4355	Morningside Rec. Center	\$ 5,675
4500	W.P.C. Northeast	\$ 0
4600	Nursery	\$ 0
4605	Nursery/Chemical Bldg.	\$ 0
4615	Park Street Garage	\$11,320
4620	Parks Field Office	\$ 8,447
4625	Phillip Jones Field	\$10,396
4630	Pier 60	\$ 0
4635	Pinellas Arts Center	\$13,961
4640	Police Department/Main	\$11,600
4645	Police Pistol Range	\$ 0
4655	Police/Countryside	\$12,155
4665	Police/K-9	\$ 4,825
4670	Police/Beach Station	\$ 400
4675	Police/Greenwood	\$ 3,135
4800	Public Service/Admin.	\$ 0
4810	Public Svc./Motor Shop	\$ 0

A.D.A. Compliance Cost Estimates

4820	Public Svc./Super. Bldg	\$ 0
4830	Public Svc./Meter Shop	\$ 0
4900	Purchasing Bldg.	\$17,200
4910	Purchasing/Storage	\$ 0
5000	Ray Green Field	\$11,950
5005	Rec. Facilities Office	\$ 0
5010	Ross Norton Pool	\$ 2,987
5015	Ross Norton Park	\$24,083
5020	Safety Village	\$ 2,548
5030	Sand Key Bathrooms	\$ 3,695
5035	Sand Key Bridge Tender	\$ 0
5040	Sand Key Toll Booth	\$10,566
5045	Seminole Docks	\$ 350
5050	Seminole Boat Ramp	\$ 1,204
5055	Shuffleboard Clubs	\$13,046
5060	Sid Lickton Field	\$34,900
5065	Sign Shop/Traffic Eng.	\$ 0
5070	Solid Waste/Recycle	\$ 0
5075	Solid Waste Division	\$ 0
5090	Station Square Park	\$ 1,072
6005	Tennis Complex/Beach	\$ 497
7000	Transfer Sta./Trailers	\$ 0
7010	Transfer Sta./Scales	\$ 0
7020	Transfer Station	\$ 0
7200	Turner Street Dock	\$ 70
7210	U.S. 19 Soccer	\$ 3,640
7220	Utilities Building	\$13,935
7230	Utilities Annex	\$17,079
7240	Valencia Park	\$11,140
7500	Wood Valley Park	\$ 8,225
7510	Woodgate Park	\$ 5,817

A.D.A. Compliance Cost Estimates

City Hall Annex/1st Fl	\$36,398
City Hall Annex/2nd Fl	\$ 450
City Hall/1st Floor	\$32,109
City Hall/2nd Floor	\$ 7,400
City Hall/3rd Floor	\$ 4,445
Island Est. Playground	\$ 1,500
Cypress Point Park	\$ 4,125
Condon Gardens Rec.	\$15,075
Pier 60 Pavilion	\$ 0
Beach Diner	\$ 0
Clw. Seafood Rest.	\$ 0

TOTAL \$747,661

BUILDING NUMBER: 1000BUILDING LOCATION: Armory Bldg.
706 N. Missouri Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide a ramp for the front entrance.	\$ 300	\$ 1200	\$ 1500
Counters:	Lower counters at the Ticket Booth and Kitchen.	\$ 400	\$ 850	\$ 1250
Lavatories and Mirrors:	Lower mirrors in both rest rooms.	\$0000000	\$ 75	\$ 75
	Relocate exposed water pipes located under rest room sinks.	\$ 150	\$ 340	\$ 490
Toilet Stalls:	Widen rest room stalls.	\$ 2000	\$ 1500	\$ 3500
	Provide 32" wide toilet stall doors.			
Water Closet:	Install new toilets in both rest rooms.	\$ 250	\$ 150	\$ 400
	Install grab bars in both rest rooms.	\$ 90	\$ 150	\$ 240
Urinal:	Lower urinal.	\$ 100	\$ 204	\$ 304
Drinking Fountains:	Install 1 new fountain.	\$ 450	\$ 102	\$ 552
Bleachers:	Provide location for wheel chairs.	\$0000000	\$ 140	\$ 140
Telephone:	Provide hearing aid compatible public telephone and clear area around telephone.	\$0000000	\$000000	\$000000
Doors:	Lower Kitchen door threshold.	MILITARY EXCLUSION		
Sinks:	Lower Kitchen sink.	"		
	Provide knee clearance at Kitchen sink.	"		
	Relocate exposed water pipes under utility sink.	"		
	Totals	\$ 3740	\$ 4851	\$ 8591

BUILDING NUMBER: 1010BUILDING LOCATION: Bayfront Tennis Complex
303 Cleveland Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$ 210	\$ 18	\$ 228
Accessible Route:	Lower level at entrance to north courts.	\$ 10	\$ 205	\$ 215
Counters:	Lower counters at the concession stands.	\$ 450	\$ 1364	\$ 1814
Doors:	Lower threshold for rest rooms and office.	\$ 140	\$ 310	\$ 450
Drinking Fountains:	Lower fountain.	\$ 500	\$ 136	\$ 636
Rest Rooms:	Provide ramp at the entrance.	\$ 900	\$ 2738	\$ 3638
Shower Stalls:	Provide larger stall.	STRUCTURALLY IMPRACTICAL		
	Provide seats and grab bars in stalls.		"	
	Lower water controls and provide shower unit with hose.		"	
Sinks:	Provide knee clearance at Kitchen sink.		"	
	Relocate exposed water pipes under rest room sinks.		"	
Dressing Rooms:	Widen dressing rooms and passageway to dressing rooms.		"	
Water Closet:	Install new toilets in both rest rooms.		"	
	Relocate toilet paper dispenser.		"	
Toilet Stalls:	Widen rest room stalls.		"	
	Provide 32" wide toilet stall doors.		"	
Mirrors:	Lower mirrors in both rest rooms.		"	
Totals		\$ 2210	\$ 4771	\$ 6981

BUILDING NUMBER: 1030BUILDING LOCATION: Beach Showers/Fountains
Clearwater Beach

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Water Fountains:	Provide clear floor space for units 1 - 10.	\$0000000	\$0000000	\$0000000
	Adjust water flow height on units 1 and 2.	\$0000000	\$0000000	\$0000000
	Lower fountain required at unit 3.	\$0000000	\$0000000	\$0000000
Showers:	Lower shower controls for units 1 - 10.	\$0000000	\$0000000	\$0000000
	Lower shower heads at units 1 - 10.	\$0000000	\$0000000	\$0000000
	Provide clear floor space for units 1 - 10.	\$0000000	\$0000000	\$0000000
Accessible Route:	Provide ramp for path to shower/fountain units 1,2,4,5,6,8 & 10.	\$0000000	\$0000000	\$0000000
	Provide 36" wide path to shower/fountain units 3,5, & 7.	\$0000000	\$0000000	\$0000000
Totals		\$0000000	\$0000000	\$0000000
(Renovations Completed)				

BUILDING NUMBER: 1040BUILDING LOCATION: Beach Bathrooms
Clearwater Beach

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Sinks:	Reposition 6 sinks in rest rooms.	\$0000000	\$ 600	\$ 600
Water Closet:	Install new toilet in rest room by lifeguard Bldg.	\$0000000	\$ 400	\$ 400
	Provide grab bars in all accessible stalls.	\$0000000	\$ 150	\$ 150
Toilet Stalls:	Provide toe clearance of 9" at toilet stalls for rest rooms near lifeguard bldg. and north of Pier Pavilion.	\$0000000	\$000000	\$000000
Sinage:	Provide sinage for acces. stall doors for rest room north of Pier Pavilion.	\$0000000	\$ 50	\$ 50
Accessible Route:	Provide walkway from parking to rest room north of Pier Pavilion.	\$0000000	\$000000	\$000000
Toilet Stalls:	Expand toilet stalls in rest rooms by life guard bldg. and north of Pier Pavilion.	\$0000000	\$ 500	\$ 500
	Totals	\$0000000	\$ 1700	\$ 1700

BUILDING NUMBER: 1042

BUILDING LOCATION: Beach Attendent Booth
Clearwater Beach

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
---------	---------------------	----------------	-------------	-------------

Totals		\$000000	\$000000	\$000000
	(Employees Only - No Public Access.)			

BUILDING NUMBER: 1043

BUILDING LOCATION: Beach Attendent Booth
Clearwater Beach

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
---------	---------------------	----------------	-------------	-------------

Totals		\$000000	\$000000	\$000000
		(Employees Only - No Public Access.)		

BUILDING NUMBER: 1050BUILDING LOCATION: Belmont Park
1535 S. Greenwood Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Walkway from parking to bleachers.	\$0000000	\$ 2590	\$ 2590
	Walkway from bleachers to rest rooms.			
Drinking Fountains:	Install 1 new fountain.	\$ 450	\$ 204	\$ 654
Toilet Stalls:	Widen 1 stall in each of the rest rooms.	\$0000000	\$ 5000	\$ 5000
	Install 2 sets of grab bars.			
Water Closet:	Install new toilet in men's rest room.			
	Relocate toilet paper dispenser.			
Doors:	Install new 32" exterior doors for each rest room.			
	Install new 32" doors on the new wider stalls.			
Sinks:	Relocate sinks in both rest rooms.			
	Totals	\$ 450	\$ 7934	\$ 8384

BUILDING NUMBER: 1060BUILDING LOCATION: Bombers Stadium
651 Old Coachman Rd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide 3 accessible spaces and signs.	\$0000000	\$ 315	\$ 315
Accessible Route:	Provide a walkway from the Bus Stop to the front entrance.	\$0000000	\$ 825	\$ 825
	Provide walkways to the picnic tables, dugouts, press boxes and supply room.	\$0000000	\$ 16670	\$ 16670
Bleachers:	Provide locations for wheelchairs.	\$0000000	\$ 732	\$ 732
Counters:	Lower counters at the Concession stands.	\$0000000	\$ 1365	\$ 1365
Stairs:	Provide handrail for press box stairs.	\$ 300	\$ 273	\$ 573
Drinking Fountains:	Raise water fountains near rest rooms.		FOR CHILDRENS USE N/A	
	Lower dugout fountains and clear proper floor space.	\$ 100	\$ 272	\$ 372
Toilet Stalls:	Widen rest room stalls.	\$0000000	\$ 2500	\$ 2500
	Provide 32" wide toilet stall doors.			
Water Closet:	Install grab bars in both rest rooms.			
Lavatories & Mirrors:	Lower mirrors in both rest rooms.			
	Relocate exposed water pipes located under rest room sinks.			
	Lower sinks in both rest rooms.			
	Totals	\$ 400	\$ 22952	\$ 23352

BUILDING NUMBER: 1080BUILDING LOCATION: Carpenter Ball Field
951 old coachman Rd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 5136	\$ 5136
Accessible Route:	Provide walkway from bus stop to main entrance.	\$0000000	\$ 825	\$ 825
	Provide walkways to the batting cages and field five.	\$0000000	\$ 2925	\$ 2925
Telephone:	Provide hearing aid compatible public telephone with volume control. Lower height of telephone unit.	\$0000000	\$000000	\$000000
Assembly Areas:	Provide locations for wheelchairs at all ballfield bleachers.	\$0000000	\$ 1400	\$ 1400
Counters:	Lower counters at the concession stands.	STAND REMOVED		
Stairway:	Replace stairs to observation deck.	DECK REMOVED		
Doors:	Lower threshold to the umpire's room.	\$0000000	\$000000	\$000000
	Provide 32" wide doors for both rest rooms.	\$0000000	\$000000	\$000000
	Level slope at threshold of both rest rooms.	\$0000000	\$000000	\$000000
Drinking Fountains:	Replace fountain near fields and the two fountains in the locker room.	\$ 1350	\$ 341	\$ 1691
Toilet Stalls:	Provide accessible stalls in public rest rooms, umpires's rest room and the rest rooms in the locker rooms.	\$0000000	\$ 20000	\$ 20000
	Provide 32" wide toilet stall doors in all rest rooms.	(TOTAL REMODEL)		
	Provide grab bars in all rest rooms.			

BUILDING NUMBER: 1080BUILDING LOCATION: Carpenter Ball Field
951 old coachman Rd.

Water Closet: Install new toilets in public rest rooms and umpire's rest room.

Urinal: Lower urinal.

Lavatories and Mirrors: Lower mirrors in all rest rooms.
Relocate exposed water pipes under all rest room sinks.

Counters: Lower counters in locker room, equipment room and sink area of locker room.

Shower Stalls: Provide chairs in shower stalls.
Provide shower heads with 60" long hose in shower stalls.
Provide 32" wide shower stall door in umpire's locker room.
Remove curb to shower stall in locker room.

Totals \$ 1350 \$ 30627 \$ 31977

BUILDING NUMBER: 1090BUILDING LOCATION: Cemetery Building
300 S. Myrtle Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible space and sign.	\$ 35	\$ 35	\$ 70
Doors:	Lower threshold and install wider door.	STRUCTURALLY IMPRACTICAL		
	Totals	\$ 35	\$ 35	\$ 70

BUILDING NUMBER: 1100BUILDING LOCATION: Chesapeake Park
3070 Chesapeake Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide walkway to bleachers.	\$0000000	\$ 1000	\$ 1000
	Provide walkway to rest rooms.	\$0000000	\$ 1660	\$ 1660
	Provide walkway from street to existing walkway.	\$0000000	\$ 1500	\$ 1500
	Provide walkway to water fountain.	\$0000000	\$ 800	\$ 800
Bleachers:	Provide location for wheel chairs.	\$0000000	\$ 250	\$ 250
Drinking Fountains:	Install 1 new fountain.	\$ 500	\$ 150	\$ 650
Doors:	Lower thresholds at main doors of rest rooms.	\$0000000	\$ 150	\$ 150
	Lower threshold at the utility room.	\$0000000	\$000000	\$000000
Sinks:	Relocate exposed water pipes under rest room sinks.	\$0000000	\$ 50	\$ 50
Toilet Stalls:	Widen 1 stall in each of the rest rooms.	\$ 800	\$ 120	\$ 920
	Install 2 sets of grab bars.	\$ 180	\$ 150	\$ 330
Water Closet:	Install new toilet in men's rest room.	\$ 100	\$ 120	\$ 220
	Relocate toilet paper dispenser.	\$0000000	\$ 25	\$ 25
Totals		\$ 1580	\$ 6115	\$ 7695

BUILDING NUMBER: 1400BUILDING LOCATION: Civic Center
40 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide fifteen 32" wide doors at main entrance, auditorium, lobby, rest rooms, kitchen, storage room, right stage exit, meeting room and rear stage door.	\$0000000	\$ 17000	\$ 17000
	Lower thresholds on rear double doors to lobby, auditorium doors, exterior door of storage room and meeting room.	\$0000000	\$ 500	\$ 500
	Provide ramps for the exit near the left side of the stage.	\$0000000	\$ 1000	\$ 1000
	Adjust doors throughout the center to have an opening force of less than 5 IBF.	\$0000000	\$ 650	\$ 650
Accessible Routes:	Provide a walkway to exit door located near the right side of the stage.	\$0000000	\$ 1600	\$ 1600
Alarms:	Provide a visual alarm system.	\$0000000	\$ 4500	\$ 4500
Telephone:	Provide 32" wide door to phone booth near rest rooms.	\$0000000	\$ 1000	\$ 1000
	Provide volume control and hearing aid compatibility to existing phone.			
	Lower existing phone.			
Drinking Fountains:	Replace fountain in main lobby.	\$ 450	\$ 120	\$ 570
Sinks:	Provide proper knee clearance under kitchen sink.	\$0000000	\$ 1500	\$ 1500
Stairs:	Provide handrails for stairs to stage.	\$ 176	\$ 545	\$ 721
Accessible Route:	Provide ramp for stage.	\$0000000	\$ 1450	\$ 1450

BUILDING NUMBER: 1400BUILDING LOCATION: Civic Center
40 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Toilet Stalls:	Provide 32" wide doors for stalls in all rest rooms.	\$0000000	\$ 1100	\$ 1100
	Provide grab bars behind toilets in rest rooms.	\$ 180	\$ 136	\$ 316
	Lower existing grab bars in men's rest rooms.	\$0000000	\$ 136	\$ 136
Lavatories and Mirrors:	Lower mirror in men's rest room.	\$0000000	\$ 56	\$ 56
	Relocate exposed water pipes in both rest rooms.	\$0000000	\$ 200	\$ 200
	Provide knee clearance under counter in women's rest room.	\$0000000	\$ 500	\$ 500
Totals		\$ 806	\$ 31993	\$ 32799

BUILDING NUMBER: 1410BUILDING LOCATION: Clearwater Airpark
1000 N. Hercules Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Emergency Telephone:	Lower emergency phones at main building and at maintenance building.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide 36" wide access in hallway to main entrance	\$0000000	\$000000	\$000000
	Provide walkways to the grass parking areas, maintenance building, fuel station and picnic table.	\$0000000	\$000000	\$000000
Doors:	Lower threshold at main entrance.	\$0000000	\$000000	\$000000
	Level area in front of main entrance.	\$0000000	\$000000	\$000000
	Provide 32" wide doors for the main entrance, offices, rest rooms, exit to fuel station and exit to the patio.	\$0000000	\$000000	\$000000
	Provide ramps for exits to the fuel station and the patio.	\$0000000	\$000000	\$000000
Toilet stalls: (Main Bldg.)	Provide accessible stalls for both rest rooms.	\$0000000	\$000000	\$000000
Water Closets: (Main Bldg.)	Replace toilets in both rest rooms and install grab bars.	\$0000000	\$000000	\$000000
Urinals: (Main Bldg.)	Lower urinal in men's rest room.	\$0000000	\$000000	\$000000
Lavatories and Mirrors: (Main Bldg.)	Lower mirrors in both rest rooms.	\$0000000	\$000000	\$000000
	Lower paper towel dispenser in men's rest room.	\$0000000	\$000000	\$000000
	Provide proper Knee clearance under sinks.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes in the rest rooms.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 1410BUILDING LOCATION: Clearwater Airpark
1000 N. Hercules Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Service Counter:	Lower main service counter and provide a 36" x 36" area.	\$0000000	\$000000	\$000000
Seating:	Provide desks and tables that provide proper knee clearance.	\$0000000	\$000000	\$000000
Parts Counter: (Maint. Bldg.)	Provide a 36" x 36" space at parts service counter.	\$0000000	\$000000	\$000000
Water Fountains:	Replace existing fountain.	\$0000000	\$000000	\$000000
Emergency Telephone:	Provide walkway at emergency phone at the maintenance building.	\$0000000	\$000000	\$000000
Doors:	Provide ramp to parts room and rest rooms.	\$0000000	\$000000	\$000000
	Provide 32" wide door at top of stairs.	\$0000000	\$000000	\$000000
Stairs:	Replace stairs and handrails.	\$0000000	\$000000	\$000000
Toilet Stalls: (Maint. Bldg.)	Provide grab Bars.	\$0000000	\$000000	\$000000
Water Closets: (Maint. Bldg.)	Replace toilet.	\$0000000	\$000000	\$000000
Lavatories and Mirrors: (Maint. Bldg.)	Lower mirror and paper towel dispenser in rest room.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under sink in the rest room.	\$0000000	\$000000	\$000000
Shower Stalls: (Maint. Bldg.)	Provide ramp at door to shower stalls.	\$0000000	\$000000	\$000000
	Provide a 32" wide door for the stall room.	\$0000000	\$000000	\$000000
	Replace shower stall and provide seat, grab bars and proper controls.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Rental Property - City Not Responsible For Costs)

BUILDING NUMBER: 1420BUILDING LOCATION: Cliff Stephens Park
801 Fairwood Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide walkway to picnic table area.	\$0000000	\$ 500	\$ 500
	Provide walkway to dock on the far west side.	\$0000000	\$000000	\$000000
	Provide level rest areas for walkways on the east side.	\$0000000	\$ 1300	\$ 1300
	Provide level access to east dock.	\$0000000	\$ 2600	\$ 2600
Ground and Floor Surfaces:	Provide slip resistant treads for bridges and docks.	\$0000000	\$ 750	\$ 750
Handrails:	Provide taller handrails on docks.	\$0000000	\$ 1500	\$ 1500
Drinking Fountains:	Provide walkway to at least one fountain.	\$0000000	\$ 250	\$ 250
	Provide floor clearance for fountains.	\$0000000	\$ 2000	\$ 2000
	Replace fountains to provide proper water flow and spout location.	\$ 1600	\$ 800	\$ 2400
Totals		\$ 1600	\$ 9840	\$ 11440

BUILDING NUMBER: 1430BUILDING LOCATION: Clwr. Beach Rec. Center
69 Bay Esplanade

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Routes:	Provide walkway from parking to basketball courts.	\$0000000	\$ 100	\$ 100
	Provide walkway to picnic tables.	\$0000000	\$ 4468	\$ 4468
Drinking Fountains:	Replace fountains inside and at basketball courts.	\$ 900	\$ 210	\$ 1110
Doors:	Lower threshold for pool room and meeting room.	\$ 10	\$ 169	\$ 179
	Provide wider doors for main entrance, meeting room, weight room and rest rooms.	\$ 910	\$ 1969	\$ 2879
Counters:	Lower counters at the office.	\$ 300	\$ 409	\$ 709
Lavatories and: Mirrors	Provide proper leg clearance under sinks in both rest rooms.	\$0000000	\$ 10000	\$ 10000
	Lower mirrors in both rest rooms.		"	
Toilet Stalls:	Widen rest room stalls.		"	
	Provide 32" wide toilet stall doors.		"	
Urinals:	Lower urinal and provide proper floor clearance.		"	
Water Closet:	Install new toilets in both rest rooms.		"	
	Provide grab bars in both rest rooms.		"	
Totals		\$ 2120	\$ 17325	\$ 19445

BUILDING NUMBER: 1440BUILDING LOCATION: Coachman Park/Bandshell
100 N. Osceola Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkway from existing walkway to stairs at front of the stage.	\$0000000	\$ 729	\$ 729
Assembly Area:	Provide wheelchair location.	\$0000000	\$ 275	\$ 275
Doors:	Provide ramp over threshold of rear doors.	\$0000000	\$ 150	\$ 150
Water Fountains:	Adjust water flow and provide floor clearance.	\$0000000	\$ 68	\$ 68
Ramps:	Replace ramp to provide a smaller rise.	\$0000000	\$ 275	\$ 275
	Provide handrails of proper height.	\$0000000	\$ 150	\$ 150
Stairs:	Provide handrail for stairs at the front of the stage.	\$ 150	\$ 272	\$ 422
	Totals	\$ 150	\$ 1919	\$ 2069

BUILDING NUMBER: 1450BUILDING LOCATION: Coachman Ridge Park
1400 Old Coachman Rd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkway to the handball courts, playground, picnic tables and basketball courts.	\$000000	\$000000	\$000000
	Slope of walkway to tennis courts is to great.	\$000000	\$000000	\$000000
Water Fountains:	Replace fountain.	\$ 500	\$ 150	\$ 650
	Totals	\$ 500	\$ 150	\$ 650

BUILDING NUMBER: 1460BUILDING LOCATION: Community Relations
400 N. Myrtle Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible space and signs.	\$ 10	\$ 18	\$ 28
Doors:	Lower main entrance door threshold.	\$ 6	\$ 35	\$ 41
Ramps:	Provide higher Handrail.	\$ 10	\$ 100	\$ 110
Water Closet:	Provide grab bars in rest rooms.	\$ 60	\$ 35	\$ 95
Sinks:	Lower kitchen sink and provide proper knee clearance.	\$ 200	\$ 853	\$ 1053
	Totals	\$ 286	\$ 1041	\$ 1327

BUILDING NUMBER: 1470BUILDING LOCATION: Country Hollow Park
2724 Brattle Lane

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide a walkway from the parking area to the existing walkway.	\$0000000	\$ 4000	\$ 4000
	Provide walkways to the playground and to field level.	\$0000000	\$000000	\$000000
Drinking Fountains:	Replace fountain.	\$ 500	\$ 150	\$ 650
	Provide walkway to the fountain.	\$0000000	\$ 1000	\$ 1000
Totals		\$ 500	\$ 5290	\$ 5790

BUILDING NUMBER: 1480BUILDING LOCATION: Countryside Comm. Park
2640 Sabal Springs Dr.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide 5 accessible spaces and signs.	\$0000000	\$ 550	\$ 550
Accessible Route:	Provide a walkway to field #1, picnic area and playground.	\$0000000	\$ 50000	\$ 50000
Assembly Areas:	Provide wheelchair areas for fields 1 - 5.	\$0000000	\$ 800	\$ 800
Doors:	Provide ramps for the utility buildings entrances.	\$0000000	\$000000	\$000000
Counters:	Lower counters at the utility building.	\$0000000	\$ 1300	\$ 1300
Drinking Fountains:	Replace fountains near the basketball courts and between fields #1 and #2.	\$0000000	\$ 1200	\$ 1200
	Provide walkways to the fountains located near the basketball courts and between fields #1 and #2.	\$0000000	\$ 1200	\$ 1200
Totals		\$0000000	\$ 55050	\$ 55050

BUILDING NUMBER: 1490BUILDING LOCATION: Countryside Sports Complex
3080 McMullin Booth Rd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 300	\$ 300
Accessible Route:	Provide walkways to the fields.	\$0000000	\$ 2000	\$ 2000
Stairs:	Lower press box handrail.	\$0000000	\$ 400	\$ 400
Counters:	Lower counters at the snack bar.	\$0000000	\$ 550	\$ 550
Telephone:	Provide public telephone that is hearing aid compatible and has volume control.	\$0000000	\$000000	\$000000
Assembly Areas:	Provide wheelchair areas at the fields.	\$0000000	\$ 275	\$ 275
Sinks:	Relocate exposed water pipes under the rest room sinks.	\$0000000	\$ 50	\$ 50
Water Closets:	Replace grab Bars in both rest rooms with larger sizes.	\$0000000	\$ 400	\$ 400
Toilet Stalls:	Provide accessible stall in each of the rest rooms.	\$0000000	\$ 800	\$ 800
Doors:	Lower thresholds of doors on the service building. sizes.	\$0000000	\$ 150	\$ 150
Drinking Fountains:	Lower Fountain.	\$0000000	\$ 200	\$ 200
	Totals	\$0000000	\$ 5125	\$ 5125

BUILDING NUMBER: 1500BUILDING LOCATION: Crest lake Park
201 Glenwood Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible space and sign near playground.	\$0000000	\$ 70	\$ 70
Accessible Route:	Provide walkway from parking to playground and "PAR" exercise elements. Provide accessible surface within playground. Provide walkway to picnic tables near playground and rest rooms. Provide walkways to rest rooms and portable toilets.	\$0000000	\$ 59187	\$ 59187
Water Fountains:	Replace fountains near playground and rest rooms.	\$ 500	\$ 209	\$ 709
Toilet Stalls:	Provide proper floor and door clearance for stalls in women's rest room.	\$0000000	\$ 1000	\$ 1000
Water Closets:	Provide grab bars in woman's rest room.	\$ 90	\$ 100	\$ 190
Lavatories:	Relocate exposed water pipes under rest room sinks. Lower paper towel dispenser.	\$ 100	\$ 200	\$ 300
Men's Rest Room:	Open mens rest rooms.	\$0000000	\$ 2500	\$ 2500
	Totals	\$ 690	\$ 63316	\$ 64006

BUILDING NUMBER: 1510BUILDING LOCATION: Cultural Arts Building
1776 Drew Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 70	\$ 70
Accessible Route:	Provide walkway to the door on the east side.	\$0000000	\$000000	\$000000
Ramps:	Raise handrail on ramp.	\$0000000	\$ 125	\$ 125
Drinking Fountains:	Replace fountain.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under kitchen sink.	\$0000000	\$000000	\$000000
Counters:	Lower counters in the kitchen.	\$0000000	\$000000	\$000000
Doors:	Lower threshold to the back office.	\$0000000	\$000000	\$000000
	Provide 32" doors throughout building.	\$0000000	\$000000	\$000000
	Provide ramps for doorway on the east side of the building, to the compressor room and the hallway to the rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide wider stall and stall door.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets and provide clear floor space around toilet area near the compressor room.	\$0000000	\$000000	\$000000
Lavatories and Mirrors:	Lower mirrors in rest rooms.	\$0000000	\$000000	\$000000
	Relocate exposed hot water pipes under the sinks in both rest rooms.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace with larger stalls that provide seats, lower controls and lower shower heads.	\$0000000	\$000000	\$000000
	Totals	\$0000000	\$ 195	\$ 195

BUILDING NUMBER: 1520BUILDING LOCATION: David Martin Soccer Field
1345 Court Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide walkway to the soccer fields.	\$0000000	\$ 4500	\$ 4500
Assembly Areas:	Provide wheelchair locations for each field.	\$0000000	\$ 400	\$ 400
Drinking Fountains:	Replace Fountain.	\$ 500	\$ 150	\$ 650
	Provide walkway to the fountain.	\$0000000	\$ 275	\$ 275
Totals		\$ 500	\$ 5465	\$ 5965

BUILDING NUMBER: 1525BUILDING LOCATION: Cypress Point Park
Cypress Point Dr. West

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkways to the existing walkway, the playground and the picnic benches.	\$0000000	\$ 4125	\$ 4125
	Totals	\$0000000	\$ 4125	\$ 4125

BUILDING NUMBER: 1540BUILDING LOCATION: Del Oro Park
401 McMullen Booth Rd. N.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide walkways to the basketball courts, fitness court, playground, picnic shelter and horseshoe area.	\$0000000	\$ 1300	\$ 1300
	Provide access route to mens rest room.	\$0000000	\$ 300	\$ 300
Ground Surface:	Surface of fitness court needs to be wheelchair accessible.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide accessible stalls in both rest rooms and install grab bars.	\$0000000	\$ 5000	\$ 5000
Water Closet:	Install new toilets in both rest rooms.	\$0000000	\$000000	\$000000
Doors:	Lower threshold for rest rooms and water fountain.	\$0000000	\$ 250	\$ 250
	Provide more clearance for maneuvering wheelchairs in front of men's rest room.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under rest room sinks.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under rest room sinks.	\$0000000	\$000000	\$000000
Drinking Fountains:	Replace Fountain.	\$ 500	\$ 150	\$ 650
Assembly Areas:	Provide wheelchair areas near bleachers.	\$0000000	\$ 250	\$ 250
	Provide walkway to bleachers.	\$0000000	\$ 125	\$ 125
	Totals	\$ 500	\$ 7515	\$ 8015

BUILDING NUMBER: 1560BUILDING LOCATION: W.P.C./East Plant
3141 Gulf-To-Bay Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Raise existing signs.	\$0000000	\$000000	\$000000
Accessible Route:	Provide access to the second floor for a person in a wheelchair.	\$0000000	\$000000	\$000000
Stairs:	Provide handrail for stairs near main entrance, lobby stairs and stairs from the east double doors.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds and provide 32" wide door openings for main entrance and hallway.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sinks in the lounge and laboratory.	\$0000000	\$000000	\$000000
Water Fountains:	Replace hallway fountain.	\$0000000	\$000000	\$000000
Tables:	Provide knee clearance under tables in labs and offices.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in each rest room.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility.	\$0000000	\$000000	\$000000
Urinals:	Lower urinals in each men's rest room.	\$0000000	\$000000	\$000000
Lavatories:	Relocate exposed water pipes under rest room sinks.	\$0000000	\$000000	\$000000
Shower Stalls:	Provide accessible stalls with proper grab bars, seats and controls in the shower/rest room and the lieutenants bathroom.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 1600BUILDING LOCATION: Ed Wright Park
1300 S. Greenwood Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 70	\$ 70
Accessible Route:	Provide walkways to picnic areas, rest rooms, playground, water fountains, shuffleboard courts, horseshoe club and horseshoe pits.	\$0000000	\$ 13000	\$ 13000
Drinking Fountains:	Replace fountains near rest rooms and horseshoe club.	\$ 1000	\$ 262	\$ 1262
Doors:	Lower thresholds to rest (Included in Accessible Route Cost) rooms.			
	Provide ramp for doorways to rest rooms.		"	
Water Closet:	Provide grab bars in both rest rooms	\$0000000	\$ 5000	\$ 5000
	Lower toilet paper dispensers in both rest rooms.		(Complete Remodel)	
Toilet Stalls:	Provide wheelchair accessible stalls and both rest rooms.			
Sinks:	Provide wider doorways to sinks in both rest rooms.			
	Relocate exposed water pipes under the sinks in both rest rooms.			
Assembly Area:	Provide wheelchair area at bleachers near horseshoe club.	\$0000000	\$ 3564	\$ 3564
Totals		\$ 1000	\$ 21896	\$ 22896

BUILDING NUMBER: 1610BUILDING LOCATION: E.C. Moore Complex
200 McMullen Booth Rd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs near soccer fields and raise level of signs by the entrance to the baseball fields.	\$0000000	\$ 2500	\$ 2500
Accessible Route:	Provide walkways to picnic areas and soccer fields.	\$0000000	\$ 35	\$ 35
	Provide walkways to water fountains.	\$0000000	\$ 150	\$ 150
Drinking Fountains:	Replace fountains and provide proper clearance.	\$ 500	\$ 100	\$ 600
Bleachers:	Provide location for wheelchairs at all soccer and baseball fields.	\$0000000	\$ 1200	\$ 1200
Counters:	Lower counters at the concession stand and one charger place.	\$0000000	\$ 1000	\$ 1000
Doors:	Lower thresholds at one charger place.	\$0000000	\$000000	\$000000
	Provide ramp for doorways of the baseball building.	\$0000000	\$000000	\$000000
Scorers Tables	Provide ramps for access to scorers tables at all fields.	\$0000000	\$000000	\$000000
Telephone:	Lower and add volume to the telephone at the baseball building.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide wheelchair accessible stalls and grab bars in the rest rooms of one charger place and the baseball bldg.	\$0000000	\$ 2000	\$ 2000
Water Closet:	Install new toilet in men's room of the baseball building.	\$0000000	\$ 250	\$ 250
Mirrors:	Lower mirrors in both rest rooms in the baseball building.	\$0000000	\$ 50	\$ 50
Paper Towel Dispenser:	Lower dispensers in the rest rooms of the baseball building.	\$0000000	\$ 50	\$ 50

BUILDING NUMBER: 1610BUILDING LOCATION: E.C. Moore Complex
200 McMullen Booth Rd.

Sinks:	Provide knee clearance under the sinks in the baseball building rest rooms.	\$0000000	\$ 500	\$ 500
	Relocate exposed water pipes under the sinks in the baseball building rest rooms.	\$0000000	\$ 300	\$ 300
	Totals	\$ 500	\$ 8135	\$ 8635

BUILDING NUMBER: 1620BUILDING LOCATION: Ervin's Youth Center
1250 Holt Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 70	\$ 70
Accessible Route:	Provide walkways to tennis courts, picnic table, playground, water fountains, shuffleboard courts and horseshoe pits.	\$0000000	\$ 36000	\$ 36000
Ground Surfaces:	Provide accessible surfaces for the playground, fitness court and volleyball courts.	\$0000000	\$000000	\$000000
Drinking Fountains:	Replace fountains near basketball and tennis courts and in the main and weight rooms.	\$ 950	\$ 300	\$ 1250
Doors:	Lower thresholds to front and rear entrances.	\$0000000	\$ 250	\$ 250
	Provide wider door to stereo equipment room and kitchen.	\$0000000	\$000000	\$000000
Counters:	Lower counters in kitchen and on doors to the kitchen and stereo equipment room.	\$0000000	\$000000	\$000000
Sinks:	Provide proper knee clearance under sinks in kitchen and main room.	\$0000000	\$000000	\$000000
Rest Rooms:	Provide wheelchair accessible sign on rest room door in weight room.	\$0000000	\$ 150	\$ 150
Water Closet:	Provide grab bars in rest room off the weight room.	\$0000000	\$ 100	\$ 100
Lavatories:	Provide knee clearance and relocate exposed pipes under the sink in the weight room's rest room.	\$0000000	\$ 50	\$ 50
	Totals	\$ 950	\$ 4520	\$ 5470

BUILDING NUMBER: 1700BUILDING LOCATION: Fire Station #45/Main
610 Franklin Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Curb Ramps:	Provide curb ramps from parking to the south side entrance, from parking to north entrance, to double doors to administration, west side door, driveway on south side, north walkway at driveway, along truck bay, northeast door and southwest entrance.	\$0000000	\$ 1200	\$ 1200
Accessible Routes:	Provide wheelchair access to second floor.	\$0000000	\$000000	\$000000
	Provide walkways to the picnic table on the west side and from the stairs on the side to parking.	\$0000000	\$000000	\$000000
	Provide level area in front of the northwest door to the truck bay.	\$0000000	\$000000	\$000000
	Provide 36" wide clear passage between sink area and stalls in the women's administration rest room.	\$0000000	\$ 800	\$ 800
Doors:	Adjust door opening force on door to roof, door at top of inside stairway and door to rest rooms off the second floor hallway.	\$0000000	\$000000	\$000000
	Lower thresholds to door at top of east side stairway, southwest door by truck bay, Lieutenants office, Deputy Chiefs door, from truck bay to administration, and door off stairway leading to roof.	\$0000000	\$ 150	\$ 150
	Provide 32" wide door openings for southwest door by truck bay, Lieutenants office, Deputy Chiefs door, from Deputy Chiefs Office to dorm, administration rest rooms, stairway door by classroom, door to rest room off hall, door to toilet room near dorms, pantry doors and rest rooms near truck bay.	\$0000000	\$ 1000	\$ 1000

BUILDING NUMBER: 1700BUILDING LOCATION: Fire Station #45/Main
610 Franklin Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Stairs:	Provide handrails for stairs on east side.	\$0000000	\$000000	\$000000
Water Fountains:	Replace fountains in truck bay, administration and second floor hallway.	\$ 500	\$ 150	\$ 650
Counters:	Provide knee clearance under computer table in lieutenants office.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance and clear floor space for sinks in all rest rooms, the kitchen and the storage room.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under the sinks in the truck bay rest rooms.	\$0000000	\$ 1000	\$ 1000
Water Closets:	Replace toilets in each rest room.	\$0000000	\$ 350	\$ 350
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and proper grab bars.	\$ 800	\$ 200	\$ 1000
Mirrors:	Lower mirrors in truck bay rest room.	\$0000000	\$000000	\$000000
Urinals:	Lower urinals in all men's rest rooms.	\$0000000	\$ 150	\$ 150
Dispensers:	Lower paper towel dispensers in the administration rest rooms.	\$0000000	\$ 50	\$ 50
Shower Stalls:	Provide accessible stalls with proper seats grab bars and controls in the second floor shower room.	\$0000000	\$000000	\$000000
	Totals	\$ 1100	\$ 5390	\$ 6490

BUILDING NUMBER: 1705BUILDING LOCATION: Fire Station #45/Maint.
610 Franklin Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Curb Ramps:	Provide ramps for the south entrance, south walkway and between parking and east-west walkway.	\$0000000	\$000000	\$000000
Accessible Routes:	Widen walkway on south side of building.	\$0000000	\$000000	\$000000
Doors:	Lower threshold on north side door.	\$0000000	\$000000	\$000000
	Provide ramps for three doors on the west side.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 1710BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide 32" wide door openings for rear west side entrance, north side entrance, 13 interior doors, employee's rest rooms and rest rooms by truck bay.	\$0000000	\$000000	\$000000
	Lower thresholds or provide ramps at north side entrance, front entrance, rest rooms by truck bay, utility room, east side door, kitchen door, rear west side door, north side door and various interior doors.	\$0000000	\$000000	\$000000
Stairs:	Replace stairs outside on the south side.	\$0000000	\$000000	\$000000
	Replace handrails on the inside stairs.	\$0000000	\$000000	\$000000
Curb Ramp:	Provide ramps on both sides of the truck bay.	\$0000000	\$000000	\$000000
Sinks:	Provide clear floor space around sinks in employee rest room, shower and in men's rest room by truck bay.	\$0000000	\$000000	\$000000
	Provide knee clearance under sink in kitchen.	\$0000000	\$000000	\$000000
Counters:	Adjust height of counters in the kitchen.	\$0000000	\$000000	\$000000
Ground Surfaces:	Repair walkway on the north side.	\$0000000	\$000000	\$000000
Drinking Fountains:	Replace fountains in the truck bay.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in each rest room .	\$0000000	\$000000	\$000000
	Provide proper floor space in employees room.	\$0000000	\$000000	\$000000
	Provide proper grab bars in all rest rooms.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 1710BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

Toilet Stalls:	Replace stalls in each rest room to provide accessibility and proper grab bars.	\$0000000	\$000000	\$000000
Lavatories & Mirrors:	Lower mirrors in all rest rooms.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under sinks in all rest rooms.	\$0000000	\$000000	\$000000
Urinals:	Lower urinal in men's rest room by truck bay.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispensers in rest rooms by truck bay.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace shower stalls in shower room to provide proper accessibility, chairs and controls.	\$0000000	\$000000	\$000000
Accessible Route:	Provide clear passage in front of stalls in women's rest room by truck bay.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 1715 BUILDING LOCATION: Fire Station #47
1460 Lakeview Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs near entrance.	\$0000000	\$000000	\$000000
Curb Ramps:	Provide ramps for front entrance, walkway, truck bay, patio doors, rear sidewalk and from driveway to patio.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds to main entrances, inside doors to truck bay and rear door to truck bay.	\$0000000	\$000000	\$000000
	Provide 32" wide door openings for office near front entrance, rest rooms, computer rooms, Lieutenants dorm and shower room.	\$0000000	\$000000	\$000000
Water Fountains:	Replace two fountains.	\$0000000	\$000000	\$000000
Counters:	Lower kitchen counter.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sinks in the kitchen and rest rooms.	\$0000000	\$000000	\$000000
Accessible Route:	Relocate rest room sink.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in each rest room and provide grab bars.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility.	\$0000000	\$000000	\$000000
Urinals:	Lower urinals in all men's rest rooms.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispensers in rest rooms.	\$0000000	\$000000	\$000000
Mirrors:	Lower mirrors in rest rooms.	\$0000000	\$000000	\$000000
Shower Stalls:	Provide Accessible shower stalls with proper grab bars seats and controls in the shower rest room and lieutenants bath room.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 1720BUILDING LOCATION: Fire Station #48/Training
1700 Belcher Road

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Curb Ramps:	Provide ramps from parking and for front and rear entrances.	\$0000000	\$000000	\$000000
Ramps:	Level ramp at east office entrance and provide handrails.	\$0000000	\$000000	\$000000
Water Fountains:	Lower fountain and clear area around fountain.	\$0000000	\$000000	\$000000
Accessible Routes:	Relocate lockers in women rest room.	\$0000000	\$000000	\$000000
	Provide walkway to rear door.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in the rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls to provide accessibility and proper grab bars.	\$0000000	\$000000	\$000000
Urinals:	Lower urinals in the men's rest room.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under rest room sinks.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 1730BUILDING LOCATION: Fire Station #48
1700 Belcher Road

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkway to transportation and from patio to training center and parking.	\$0000000	\$000000	\$000000
Curb Ramps:	Provide ramps for the rear porch, truck bay and from lounge to patio.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds to the rear truck bay, front entrance, between lounge and truck bay and between the hall and rest rooms.	\$0000000	\$000000	\$000000
	Provide 32" wide door openings for the radio room, lieutenants office, rest rooms and lieutenants dorm.	\$0000000	\$000000	\$000000
Water Fountains:	Replace two fountains.	\$0000000	\$000000	\$000000
Counters:	Lower kitchen counter.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under kitchen sink.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in each rest room and install grab bars.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility.	\$0000000	\$000000	\$000000
Lavatories:	Provide knee clearance under rest room sinks and provide clear floor space in front of sinks.	\$0000000	\$000000	\$000000
Urinals:	Lower urinals in all men's rest rooms.	\$0000000	\$000000	\$000000
Shower Stalls:	Provide accessible stalls with proper grab bars, seats and controls in the shower/rest room and the lieutenants bathroom.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 1735BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$0000000	\$0000000
Accessible Route:	Provide 36" wide walkway to Fire Education Building, from parking, on east side of building, to flag pole and to transportation stop.	\$0000000	\$0000000	\$0000000
Doors:	Lower thresholds to fire training building and main entrance.	\$0000000	\$0000000	\$0000000
	Provide 32" wide door openings for fire education rest room and storage room, main entrance, between rest room and Lieutenants office, Lieutenants dorm, Lieutenants bath room and the utility closet.	\$0000000	\$0000000	\$0000000
Curb Ramps:	Provide ramps for south entrances, main entrance and between radio room and truck bay.	\$0000000	\$0000000	\$0000000
Counters:	Lower kitchen counter.	\$0000000	\$0000000	\$0000000
Sinks:	Provide knee clearance under kitchen sink.	\$0000000	\$0000000	\$0000000
Water Fountains:	Replace three fountains.	\$0000000	\$0000000	\$0000000
Water Closets:	Replace toilets in each rest room and provide clear floor space.	\$0000000	\$0000000	\$0000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility.	\$0000000	\$0000000	\$0000000
Urinals:	Lower urinals in all men's rest rooms.	\$0000000	\$0000000	\$0000000
Lavatories and Mirrors:	Lower mirrors in rest rooms.	\$0000000	\$0000000	\$0000000
Urinals:	Relocate exposed water pipes under rest room sinks.	\$0000000	\$0000000	\$0000000
Dispensers:	Lower paper towel dispensers in rest rooms.	\$0000000	\$0000000	\$0000000
Sinks:	Provide clear floor space in front of rest room sinks in the education building.	\$0000000	\$0000000	\$0000000

BUILDING NUMBER: 1735BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Shower Stalls:	Provide Accessible shower stalls with proper grab bars seats and controls in the shower rest room.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
		(Employees Only - No Public Access)		

BUILDING NUMBER: 1740BUILDING LOCATION: Fire Station #50
2681 Countryside Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Curb Ramps:	Provide ramps for front entrance walkway, truck bay and patio doors.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds to main entrances, rear door of truck bay and doorway between lounge and truck bay.	\$0000000	\$000000	\$000000
	Provide 32" wide door openings for radio room, Lieutenants office, rest rooms, Lieutenants dorm, rest rooms, Lieutenants bathroom and doorway to shower stalls.	\$0000000	\$000000	\$000000
Water Fountains:	Replace two fountains.	\$0000000	\$000000	\$000000
Counters:	Lower kitchen counter.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sink in the kitchen.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in each rest room and provide grab bars.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility.	\$0000000	\$000000	\$000000
Lavatories:	Provide clear floor space in front of rest room sinks.	\$0000000	\$000000	\$000000
Urinals:	Lower urinals in all men's rest rooms.	\$0000000	\$000000	\$000000
Mirrors:	Lower mirrors in rest room near lieutenants office.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispenser in rest room near the lieutenants office.	\$0000000	\$000000	\$000000
Shower Stalls:	Provide Accessible shower stalls with proper grab bars seats and controls in the shower rest room and lieutenants bath room.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 1810BUILDING LOCATION: Fleet Maintenance
1900 Grand Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Relocate spaces and signs.	\$0000000	\$ 150	\$ 150
Accessible Routes:	Provide wheelchair access to the second floor.	\$0000000	\$000000	\$000000
	Lower thresholds to doors at the main entrance, radio shop and east side entrance.	\$0000000	\$ 350	\$ 350
	Provide a ramp to the main entrance from parking.	\$0000000	\$ 450	\$ 450
	Provide a walkway to the picnic tables.	\$0000000	\$000000	\$000000
Counters:	Lower counters in waiting area and break room.	\$0000000	\$000000	\$000000
Water Fountains:	Replace fountains near employee sink.	\$ 450	\$ 100	\$ 550
Water Closets:	Replace toilets in the rest rooms.	\$ 200	\$ 136	\$ 336
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and grab bars.	\$ 800	\$ 200	\$ 1000
Urinals:	Lower urinals in the men's rest rooms.	\$0000000	\$ 140	\$ 140
Sinks:	Provide knee clearance under sinks in the rest rooms and the break room.	\$0000000	\$ 1000	\$ 1000
Shower Stalls:	Provide proper control unit for stall in men's rest room.	\$0000000	\$ 450	\$ 450
Alarm:	Provide visual alarm system.	\$0000000	\$ 800	\$ 800
	Totals	\$ 1450	\$ 3776	\$ 5226

BUILDING NUMBER: 1820BUILDING LOCATION: Fleet Radio Tower
Lakeview & Missouri

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide a walkway from the parking area to the main entrance.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
		(Employees Only - No Public Access)		

BUILDING NUMBER: 1830BUILDING LOCATION: Fleet Radio Tower
S.R. 580 & McMullen

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide a walkway to the main entrance.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 1835BUILDING LOCATION: Fleet Fuel Site/Fire 6
2681 Countryside Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Curb Ramp:	Provide curb ramps at fuel island.	\$0000000	\$000000	\$000000
Reach Ranges:	Provide access to card operated fuel system and emergency shut-off.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
		(Employees Only - No Public Access)		

BUILDING NUMBER: 1840BUILDING LOCATION: Fleet Fuel Site/Annex
10 S. Missouri Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Curb Ramp:	Provide curb ramps at fuel island.	\$000000	\$000000	\$000000
Reach Ranges:	Provide access to card operated fuel system and emergency shut-off.	\$000000	\$000000	\$000000

Totals \$000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 1900BUILDING LOCATION: Forest Run Park
3450 Landmark Drive

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkway to basketball courts and water fountains.	\$0000000	\$ 1000	\$ 1000
Drinking Fountains:	Replace fountains near basketball and tennis courts.	\$0000000	\$ 1300	\$ 1300
Ground Surfaces:	Provide non-slip surface on bridge.	\$0000000	\$ 150	\$ 150
	Totals	\$0000000	\$ 2450	\$ 2450

BUILDING NUMBER: 1920BUILDING LOCATION: Frank Tack Park
1667 N. Hercules Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 150	\$ 150
Accessible Routes:	Provide walkways to parking lot and baseball fields.	\$0000000	\$ 3000	\$ 3000
Assembly Areas:	Provide wheelchair areas at all ballfields.	\$0000000	\$ 275	\$ 275
Drinking Fountains:	Replace 2 fountains and provide walkways to each.	\$0000000	\$ 1300	\$ 1300
Rest Rooms:	Provide walkways to rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide accessible stalls in both rest rooms and install grab bars.	\$0000000	\$ 500	\$ 500
Water Closets:	Replace toilets in both rest rooms.	\$ 200	\$ 240	\$ 440
Doors:	Lower threshold to both rest rooms.	\$0000000	\$ 350	\$ 350
Sinks:	Provide knee clearance under sinks in both rest rooms.	\$0000000	\$ 150	\$ 150
	Relocate exposed water pipes under sinks in both rest rooms.	\$0000000	\$ 150	\$ 150
	Totals	\$ 200	\$ 6115	\$ 6315

BUILDING NUMBER: 1930BUILDING LOCATION: Fred Cournoyer
714 N. Saturn Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide access aisle by spaces near entrance.	\$0000000	\$ 140	\$ 140
Accessible Route:	Trim back bushes near walkway to entrance.	\$0000000	\$ 50	\$ 50
Counters:	Lower counters at the refreshment stand.	\$0000000	\$ 450	\$ 450
Doors:	Provide ramps to east and west side doors.	\$0000000	\$ 500	\$ 500
	Lower threshold on east and west side entrances and concession stand door.	\$0000000	\$000000	\$000000
	Provide wider doors to all rest rooms.	\$0000000	\$ 1200	\$ 1200
Toilet Stalls:	Widen rest room stalls and provide grab bars.	\$0000000	\$ 4000	\$ 4000
	Provide 32" wide toilet stall doors.			
Water Closet:	Install new toilets in both rest rooms.			
Lavatories and Mirrors:	Lower mirrors in women's rest room.			
	Relocate exposed water pipes located under rest room sinks and provide knee clearance.			
Drinking Fountains:	Install 1 new fountain.	\$0000000	\$ 50	\$ 50
	Totals	\$0000000	\$ 6390	\$ 6390

BUILDING NUMBER: 1950BUILDING LOCATION: Garden Avenue Garage
28 N. Garden Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide 3 more accessible spaces and signs. Raise existing signs.	\$0000000	\$ 210	\$ 210
Accessible Route:	Provide accessible route to ticket booth.	\$0000000	\$000000	\$000000
Doors:	Lower threshold to door leading to elevator on level 4.	\$0000000	\$ 100	\$ 100
	Lower threshold at stairways on all levels.	\$0000000	\$ 400	\$ 400
Stairs:	Adjust height of handrails.	\$0000000	\$ 300	\$ 300
Door Opening Force:	Adjust tension on door leading to elevator on level 4.	\$0000000	\$000000	\$000000
Elevators:	Provide hall lanterns on levels 2,3 and 4.	\$0000000	\$ 10000	\$ 10000
	Adjust reopening devise to exceed 20 seconds.			
	Totals	\$0000000	\$ 20010	\$ 20010

BUILDING NUMBER: 2000BUILDING LOCATION: Gas Division/2nd Floor
400 N. Myrtle Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide 36" wide aisle space throughout offices.	\$0000000	\$0000000	\$0000000
Counters:	Provide desks and counters with proper knee clearance throughout the offices.	\$0000000	\$0000000	\$0000000
Curb Ramps:	Provide no parking space in front of the ramp.	\$0000000	\$0000000	\$0000000
Drinking Fountain:	Lower fountain in the garage area and clear floor space around fountain.	\$0000000	\$0000000	\$0000000
Sinks:	Provide knee clearance under the kitchen sink.	\$0000000	\$0000000	\$0000000
Doors:	Lower threshold at rear door leading to stairway, main entrance and rear garage door.	\$0000000	\$0000000	\$0000000
	Provide 32" wide doors for the main entrance and rear door leading to the stairway.	\$0000000	\$0000000	\$0000000
Stairs:	Replace rear and garage stairs and handrails.	\$0000000	\$0000000	\$0000000
	Lower handrails at front entrance.	\$0000000	\$0000000	\$0000000
Water Closets:	Replace toilets in both rest rooms and install grab bars.	\$0000000	\$0000000	\$0000000
Lavatories and Mirrors:	Lower mirrors in both rest rooms.	\$0000000	\$0000000	\$0000000
	Relocate exposed water pipes under the sinks in both rest rooms.	\$0000000	\$0000000	\$0000000

Totals \$0000000 \$0000000 \$0000000
(Employees Only - No Public Access)

BUILDING NUMBER: 2010BUILDING LOCATION: Gas Division/Welding
400 N. Myrtle Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Lower threshold for rear garage door.	\$0000000	\$000000	\$000000
	Provide a ramp for the main entrance.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
		(Employees Only - No Public Access)		

BUILDING NUMBER: 2020BUILDING LOCATION: Gas Division/West Bldg
400 N. Myrtle Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Lower threshold at main entrance.	\$0000000	\$000000	\$000000
	Provide 32" wide doors for the storage room near the lounge and the rest room near the locker room.	\$0000000	\$000000	\$000000
Stairs:	Raise handrails at front entrance.	\$0000000	\$000000	\$000000
Counters, Tables:	Provide desks and counters with proper knee clearance throughout the offices and lounge.	\$0000000	\$000000	\$000000
	Lower the counter in the supervisor's office.	\$0000000	\$000000	\$000000
Drinking Fountain:	Replace fountain in the employee lounge.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under the sinks in the kitchen, employee rest room, men's rest room and women's rest room.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace shower stall and controls in the employee rest room.	\$0000000	\$000000	\$000000
Urinals:	Lower urinal in employee rest room.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in all rest rooms and install grab bars.	\$0000000	\$000000	\$000000
Mirrors:	Lower mirrors in both rest rooms.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispensers in rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stall in employee rest room.	\$0000000	\$000000	\$000000
Accessible Route:	Move file cabinet in women's rest room.	\$0000000	\$000000	\$000000
	Relocate sink in men's rest room.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 2030BUILDING LOCATION: Glen Oaks Golf Club
1345 Court Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 70	\$ 70
Accessible Routes:	Provide a smooth surface where sidewalk and parking lot meet.	\$0000000	\$ 400	\$ 400
	Provide walkways to the bus stop and flower factory.	\$0000000	\$ 800	\$ 800
	Provide a ramp for the entrance to the pro shop. factory.	\$0000000	\$ 375	\$ 375
Telephone:	Provide volume control and hearing aid compatibility for public telephone.	\$0000000	\$000000	\$000000
	Provide clear floor space in the phone booth.	\$0000000	\$000000	\$000000
	Provide a ramp for the entrance to the phone booth or relocate.	\$0000000	\$000000	\$000000
Stairs:	Adjust height of handrail for front entrance.	\$0000000	\$ 120	\$ 120
	Provide handrails on stairs located on the south side and the entrance facing S.R. 60.	\$0000000	\$ 120	\$ 120
Doors:	Provide a ramp for door near practice green.	\$0000000	\$000000	\$000000
	Lower thresholds for main entrance, S.R. 60 door, south door and door at practice green.	\$0000000	\$ 150	\$ 150
	Provide 32" wide doors for the main entrance, offices, rest rooms and storage room.	\$0000000	\$ 2500	\$ 2500

BUILDING NUMBER: 2030BUILDING LOCATION: Glen Oaks Golf Club
1345 Court Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Tables & Counters:	Provide a 36" x 36" area at the main counter.	\$0000000	\$000000	\$000000
	Provide tables in the pro shop that provide proper knee clearance.	\$0000000	\$ 150	\$ 150
	Lower counter on door to storage area.	\$0000000	\$000000	\$000000
Accessible Routes:	Relocate barrier wall near men's rest room.	\$0000000	\$ 5000	\$ 5000
	Relocate sink in women's rest room.			
Toilet Stalls:	Provide accessible stalls in both rest rooms.			
Water Closets:	Replace toilets in both rest rooms.			
Sinks:	Provide proper knee clearance under sinks in pro shop and rest rooms.			
Totals		\$0000000	\$ 9685	\$ 9685

BUILDING NUMBER: 2040BUILDING LOCATION: Holt Street Pool
1259 Holt Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 70	\$ 70
Accessible Route:	Provide ramps from parking to entrance and from lockers to pool.	\$0000000	\$ 6290	\$ 6290
	Relocate water fountain on walkway from women's lockers to pool.	\$ 50	\$ 136	\$ 186
Doors:	Provide wider doors at front office and dressing rooms.	\$0000000	\$ 500	\$ 500
Counters:	Lower counters at front office doors.	\$0000000	\$000000	\$000000
Water Fountains:	Replace fountain behind women's locker room.	\$ 450	\$ 136	\$ 586
Lavatories and Mirrors:	Lower mirrors in both rest rooms.	\$0000000	\$ 150	\$ 150
	Relocate exposed water pipes under sinks in both rest rooms and provide proper knee clearance.	\$0000000	\$ 100	\$ 100
Toilet Stalls:	Provide accessible stalls in both rest rooms.	\$ 400	\$ 200	\$ 600
Water Closets:	Provide grab bars in both rest rooms.	\$ 180	\$ 136	\$ 326
	Lower paper towel dispensers in women's rest room.	\$ 45	\$ 20	\$ 65
Urinals:	Provide accessible urinal.	\$0000000	\$ 250	\$ 250
Shower Stalls: Mirrors:	Provide accessible stalls in both locker rooms.	\$0000000	\$ 1682	\$ 1682
	Provide seats, grab bars and proper controls in the new stalls.	\$0000000	\$ 300	\$ 300
Dressing Rooms:	Provide clear floor space in dressing room stalls.	\$0000000	\$ 682	\$ 682
	Totals	\$ 1125	\$ 10662	\$ 11787

BUILDING NUMBER: 2045BUILDING LOCATION: Jack Russell Stadium
801 Phillies Drive

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide stable surface and walkway for existing spaces.	\$0000000	\$ 2400	\$ 2400
Ticket Counter:	Provide a 36" x 36" area at the ticket counters.	\$0000000	\$ 2500	\$ 2500
Concession Counter:	Lower counters at the concession stands.	\$0000000	\$ 1000	\$ 1000
Accessible Routes:	Provide walkways from parking to astroturf field.	\$0000000	\$000000	\$000000
	Provide walkway to the batting cages.	\$0000000	\$ 1000	\$ 1000
	Provide walkways and ramps to the dugouts.	\$0000000	\$000000	\$000000
Ramps:	Replace ramps to the grandstand.	\$0000000	\$000000	\$000000
Assembly Area:	Provide wheelchair area for the bleachers at the astroturf field.	\$0000000	\$ 1000	\$ 1000
Stairs:	Replace stairs and handrails to second floor offices at the rear of the complex.	\$0000000	\$000000	\$000000
	Replace stairs and handrails to second floor offices over the locker rooms.	\$0000000	\$000000	\$000000
	Replace stairs to the stands on the third base side.	\$0000000	\$ 800	\$ 800
Telephones:	Provide phones with volume control and that are hearing aid compatible.	\$0000000	\$000000	\$000000
Doors:	Level area in front of rest rooms behind home plate, by souvenir stands and by third base stands.	\$0000000	\$ 950	\$ 950
	Lower threshold or provide ramps for doors to ticket office, laundry room, locker rooms, media room and film room.	\$0000000	\$ 350	\$ 350

BUILDING NUMBER: 2045BUILDING LOCATION: Jack Russell Stadium
801 Phillies Drive

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Toilet Stalls:	Provide accessible stalls and doors for rest rooms near first base side, behind home plate and near the third base stands.	\$0000000	\$ 9000	\$ 9000
Water Closets:	Replace toilet in men's rest room behind home plate.	\$0000000	\$ 150	\$ 150
Urinals:	Lower urinal in rest room behind home plate.	\$0000000	\$ 450	\$ 450
Lavatories and Mirrors:	Relocate exposed water pipes in all rest rooms.	\$0000000	\$ 150	\$ 150
Sinks:	Lower sinks in rest rooms behind home plate.	\$0000000	\$ 168	\$ 168
Doors:	Adjust door opening force for rest rooms located on the first base side.	\$0000000	\$ 68	\$ 68
Totals		\$0000000	\$ 19068	\$ 19068

BUILDING NUMBER: 2055BUILDING LOCATION: Kings Highway Rec. Ctr.
1751 Kings Highway

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide 1 additional accessible space and sign.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide walkways from parking and building to playground. Provide walkway to picnic tables.	\$0000000	\$ 1800	\$ 1800
Doors:	Provide wider doors to main entrance, ping pong room, rear exit and rest rooms.	\$0000000	\$000000	\$000000
Sinks:	Provide proper knee clearance under sink in kitchen.	\$0000000	\$ 300	\$ 300
Drinking Fountains:	Replace fountains near front entrance.	\$ 450	\$ 130	\$ 180
Toilet Stalls:	Provide accessible stalls and grab bars in both rest rooms.	\$0000000	\$ 2000	\$ 2000
Lavatories and Mirrors:	Lower mirrors in both rest rooms.	\$0000000	\$ 50	\$ 50
	Relocate exposed water pipes under sinks in both rest rooms.	\$0000000	\$ 50	\$ 50
	Totals	\$ 450	\$ 4470	\$ 4920

BUILDING NUMBER: 2060BUILDING LOCATION: Lawn Bowling Club
1040 Calumet Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide 32" wide doors for the main entrance, meeting room, rest rooms, and office.	\$0000000	\$ 5700	\$ 5700
	Lower threshold on front doors.	\$0000000	\$ 150	\$ 150
	level areas in front of rear and south side doors.	\$0000000	\$ 536	\$ 536
Counters:	Lower counter.	\$0000000	\$ 2400	\$ 2400
Raised Platform:	Provide ramp for access to speakers lectern.	\$0000000	\$ 300	\$ 300
Sinks:	Provide knee clearance at Kitchen sink.	\$0000000	\$ 1600	\$ 1600
Toilet Stalls:	Provide accessible stalls in both rest rooms.	\$0000000	\$ 2500	\$ 2500
	Provide 32" wide toilet stall doors.	\$0000000	\$ 300	\$ 300
Water Closet:	Install new toilets in both rest rooms.	\$0000000	\$ 350	\$ 350
	Install grab bars in both rest rooms.	\$ 200	\$ 130	\$ 330
Urinal:	Lower urinal.	\$0000000	\$ 68	\$ 68
Lavatories and Mirrors:	Provide proper knee clearance and relocate exposed water pipes under rest room sinks.	\$0000000	\$ 1600	\$ 1600
	Lower mirrors in both rest rooms.	\$0000000	\$ 150	\$ 150
	Lower paper towel dispensers in both rest rooms.	\$0000000	\$ 60	\$ 60
Accessible Route:	Relocate lockers in men's rest room to provide proper access.	\$0000000	\$ 136	\$ 136
Totals		\$ 200	\$ 15980	\$ 16180

BUILDING NUMBER: 2065BUILDING LOCATION: Clearwater Beach Library
40 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide 32" wide doors for main entrance , rest rooms and office and lower thresholds.	\$0000000	\$ 1497	\$ 1497
Space Allowance:	Provide clear floor space in front of change machine.	\$0000000	\$ 17	\$ 17
Reading/Study Area:	Provide proper knee clearance at card catalog computer and reading tables.	\$ 1550	\$ 875	\$ 2425
Alarms:	Provide visual alarm system.	\$0000000	\$ 1000	\$ 1000
Counters:	Lower a portion of the main counter.	\$ 450	\$ 975	\$ 1325
Accessible routes:	Provide clear aisle space around book carrousel.	\$0000000	\$ 34	\$ 34
Water Closets:	Provide grab bars in rest room near office.	Private Rest Room	N/A	
	Provide clear floor space in rest room near office.		"	
Sink:	Provide clear floor space in front of sink in rest room near office.		"	
Lavatories and Mirrors:	Lower mirror in rest room near office.		"	
	Relocate exposed water pipes under sink in rest room near office.		"	
Totals		\$ 2000	\$ 4398	\$ 6298

BUILDING NUMBER: 2070BUILDING LOCATION: Library/Main
100 N. Osceola Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Raise existing signs.	\$0000000	\$ 140	\$ 140
Curb Ramps:	Provide ramp from south walkway to driveway and for south staff entrance.	\$0000000	\$000000	\$000000
	Replace ramp to book deposit box.	\$0000000	\$ 800	\$ 800
Ramps:	Replace ramp from circulation room to Acquisition room.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds to east stairway, northwest doors, east side door, south door, stairway door near book deposit, third floor emergency exit and third floor rest rooms.	\$0000000	\$000000	\$000000
	Provide 32" wide door openings for the auditorium, lobby doors, first floor custodians room, supply room off acquisition room, lounge rest rooms, supply room near lounge, passageway to lounge, childrens rest rooms, audio room, second floor custodians room, second floor storage, administration and second floor emergency room.	\$0000000	\$ 1000	\$ 1000
	Adjust the opening force for the rest room doors.	\$0000000	\$ 100	\$ 100
Stairs:	Install handrails for east outside stairs, south outside stairs, lobby stairs, acquisition room stairs and stairs in staff storage.	\$0000000	\$ 300	\$ 300
Alarms:	Provide a visual alarm system.	\$0000000	\$ 2400	\$ 2400
Accessible Routes:	Provide walkway from northwest doors to chamber parking lot.	\$0000000	\$000000	\$000000
	Lower book deposit box.	\$0000000	\$ 1000	\$ 1000
	Level passage to first floor lounge.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 2070BUILDING LOCATION: Library/Main
100 N. Osceola Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Routes:	Provide ramp for passage to stairs near the acquisition room.	\$0000000	\$000000	\$000000
	Provide clear passage of 36" in the second floor staff storage room.	\$0000000	\$000000	\$000000
Drinking Fountains:	Replace fountains in the lobby and by second floor rest rooms.	\$0000000	\$ 650	\$ 650
Telephone:	Provide a hearing aid compatible public telephone.	\$0000000	\$000000	\$000000
Book Stacks:	Provide clear aisle space between stacks on both floors.	\$0000000	\$000000	\$000000
Reading and Study Areas:	Provide knee clearance under tables on both floors.	\$0000000	\$ 500	\$ 500
	Provide clear passage of 36" between book carrousel by the book check-out.	\$0000000	\$000000	\$000000
Card Catalogs:	Lower desks for computer card catalogs.	\$0000000	\$ 500	\$ 500
Counters/Tables:	Provide knee clearance under tables and counters on both floors.	\$0000000	\$ 1500	\$ 1500
Sinks:	Relocate exposed water pipes under rest room sinks.	\$0000000	\$ 150	\$ 150
	Provide knee clearance under sinks in the rest rooms and kitchen.	\$0000000	\$000000	\$000000
	Provide clear floor space in front of sinks in the childrens and third floor rest rooms.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in the childrens, first floor, third floor and lounge rest rooms.	\$0000000	\$000000	\$000000
	Clear floor space and provide grab bars for third floor and childrens rest rooms.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 2070BUILDING LOCATION: Library/Main
100 N. Osceola Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Toilet Stalls:	Replace stalls in first floor, second floor and lounge rest rooms to provide accessibility and proper grab bars.	\$0000000	\$ 2000	\$ 2000
Urinals:	Lower urinal in first floor and second floor men's rest rooms.	\$0000000	\$ 200	\$ 200
Dispensers:	Lower paper towel dispensers in lounge rest rooms.	\$0000000	\$000000	\$000000
Mirrors:	Lower mirrors in childrens rest room.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace shower stall in lounge to provide accessibility and proper seats, controls and grab bars.	\$0000000	\$000000	\$000000
Elevators:	Provide raised star for call button on main floor.	\$0000000	\$ 12000	\$ 12000
	Provide hall lanterns with visual and audible signals.	\$0000000	\$000000	\$000000
	Provide raised and braille characters on hoistway entrance.	\$0000000	\$000000	\$000000
	Replace reopening device.	\$0000000	\$000000	\$000000
	Totals	\$0000000	\$ 22590	\$ 22590

BUILDING NUMBER: 2075BUILDING LOCATION: East Library
2250 Drew Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Raise existing signs and provide access aisles between accessible spaces.	\$0000000	\$ 280	\$ 280
Alarms:	Provide visual alarm.	\$0000000	\$ 1500	\$ 1500
Telephone:	Provide hearing aid compatible public telephone and clear area around telephone.	\$0000000	\$000000	\$000000
Accessible Route:	Provide walkway to exterior door of meeting room "B".	\$0000000	\$ 300	\$ 300
	Provide curb ramp for access to rear book drop.	\$0000000	\$ 480	\$ 480
Reach Ranges:	Lower book deposit drop.	\$0000000	\$ 500	\$ 500
Passenger Loading Zones:	Provide curb ramp and access aisles for main entrance.	\$0000000	\$ 300	\$ 300
Drinking Fountains:	Replace small fountain in lobby.	\$0000000	\$000000	\$000000
Doors:	Provide 32" wide doors for meeting room "A", west side emergency door and emergency exit in meeting room "B".	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sinks in meeting room "A", rest rooms, work room and employee lounge.	\$0000000	\$000000	\$000000
Reading Tables:	Provide knee clearance under tables in meeting room "A" and the youth section.	\$0000000	\$ 300	\$ 300
Aisles:	Provide 36" wide openings between book stacks.	\$0000000	\$000000	\$000000
Counters:	Provide 36" X 36" counter space at check out counter.	\$0000000	\$ 1000	\$ 1000
	Provide proper knee clearance under workroom counter.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 2075BUILDING LOCATION: East Library
2250 Drew Street

Tables and Desks:	Provide knee clearance under tables for magazine index, microfilm reader and computer desk.	\$0000000	\$ 1500	\$ 1500
	Lower card catalog computer desk.	\$0000000	\$ 500	\$ 500
Toilet Stalls:	Provide 32" wide toilet stall doors in rest rooms.	\$0000000	\$000000	\$000000
Urinals:	Lower urinal in men's public rest room.	\$0000000	\$ 120	\$ 120
	Provide 36" wide passage in front of urinal in men's public rest room.	\$0000000	\$ 2500	\$ 2500
Water Closets:	Provide grab bars in employees rest rooms.	\$0000000	\$000000	\$000000
	Lower toilets in employees rest rooms.	\$0000000	\$000000	\$000000
Lavatories and Mirrors:	Lower mirrors in employees rest rooms.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under employees rest room sinks.	\$0000000	\$000000	\$000000
	Totals	\$0000000	\$ 9280	\$ 9280

BUILDING NUMBER: 2080BUILDING LOCATION: Countryside Library
2742 S.R. 580

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide Aisles between existing accessible spaces.	\$0000000	\$ 150	\$ 150
Reach Ranges:	Lower book deposit drop.	\$ 50	\$ 545	\$ 595
	Level area in front of the book deposit drop.	\$0000000	\$ 137	\$ 137
Telephone:	Provide volume control and hearing aid compatibility.	\$0000000	\$000000	\$000000
Drinking Fountains:	Raise small fountain in the lobby.	\$ 450	\$ 210	\$ 670
Doors:	Provide 32" wide doors for meeting rooms.	\$0000000	\$000000	\$000000
	Lower threshold to workroom.	\$ 20	\$ 68	\$ 88
	Provide ramp for exit of meeting room "B".	\$0000000	\$ 68	\$ 68
Alarms:	Provide a visual alarm system.	\$0000000	\$ 2000	\$ 2000
Sinks:	Lower sink in lounge and workroom.	\$0000000	\$000000	\$000000
	Provide knee clearance under sink in workroom.	\$0000000	\$000000	\$000000
Reading Tables:	Provide tables in children's section with proper knee clearance.	\$0000000	\$000000	\$000000
Tables and Desks:	Provide desks for magazine index, application, periodical index, and work room with proper knee clearance.	\$0000000	\$ 1500	\$ 1500
Counters:	Provide 36" x 36" area at check-out counter.	\$0000000	\$ 500	\$ 500
	Lower counters behind check-out, at check-out and in workroom.	\$0000000	\$000000	\$000000
	Provide knee clearance under counters in workroom and under tables in lounge area.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 2080BUILDING LOCATION: Countryside Library
2742 S.R. 580

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Aisles:	Provide 36" wide clearance between shelves and book carrousel.	\$000000	\$000000	\$000000
Toilet Stalls:	Provide 32" wide stall doors in rest rooms.	\$000000	\$000000	\$000000
Doors:	Provide 32" wide doors to rest rooms.	\$000000	\$000000	\$000000
Water Closets:	Lower toilets in employee rest rooms.	\$000000	\$000000	\$000000
	Provide clear floor space in employee rest rooms.	\$000000	\$000000	\$000000
	Provide grab bars in employee rest rooms.	\$000000	\$000000	\$000000
Lavatories and Mirrors:	Relocate exposed water pipes under sinks in the rest rooms.	\$000000	\$000000	\$000000
	Lower mirrors in the rest rooms.	\$000000	\$ 100	\$ 100
	Provide knee clearance under rest room sinks.	\$000000	\$ 300	\$ 300
	Lower paper towel dispensers in the public rest rooms.	\$000000	\$ 70	\$ 70
	Totals	\$ 520	\$ 5648	\$ 6168

BUILDING NUMBER: 2085BUILDING LOCATION: Greenwood Library
1250 Palmetto Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible space and signs.	\$0000000	\$ 70	\$ 70
Telephone:	Provide hearing aid compatible public telephone and clear area around telephone.	\$0000000	\$000000	\$000000
Alarms:	Provide visual alarm.	\$0000000	\$ 1500	\$ 1500
Reach Ranges:	Lower book deposit drop.	\$0000000	\$ 600	\$ 600
Accessible Route:	Provide 36" wide clearance behind main counter.	\$0000000	\$000000	\$000000
	Provide walkways to rear emergency exit and exit near kitchen.	\$0000000	\$ 3300	\$ 3300
Drinking Fountains:	Replace fountain.	\$ 500	\$ 150	\$ 650
Reading/Study Area:	Provide proper knee clearance for the study tables, computerized card catalog and wall study units.	\$0000000	\$ 1200	\$ 1200
	Widen aisles between book stacks on the north side.	\$0000000	\$000000	\$000000
Doors:	Provide 32" wide doors for the emergency exit, workroom and rest rooms near kitchen.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance at utility and kitchen sinks.	\$0000000	\$000000	\$000000
	Lower kitchen and rest room sinks.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under rest room sinks.	\$0000000	\$000000	\$000000
	Lower mirror over sink in rest room near kitchen.	\$0000000	\$000000	\$000000
Urinal:	Lower urinal.	\$0000000	\$ 150	\$ 150

BUILDING NUMBER: 2085BUILDING LOCATION: Greenwood Library
1250 Palmetto Street

Toilet Stalls:	Lower grab bars in the public rest rooms. Add grab bars behind toilets.	\$ 60	\$ 140	\$ 200
	Provide 32" wide toilet stall doors in public rest rooms.	\$ 800	\$ 200	\$ 1000
Lavatories and Mirrors:	Lower mirrors in public rest rooms.	\$0000000	\$ 75	\$ 75
	Relocate exposed water pipes under public rest room sinks.	\$0000000	\$ 100	\$ 100
	Lower sinks in women's rest room.	\$0000000	\$ 240	\$ 240
	Totals	\$ 1360	\$ 7725	\$ 9085

BUILDING NUMBER: 2090BUILDING LOCATION: Life Guard Building
Pier 60 Parking Lot

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Curb Ramps:	Provide ramps at entrance and rest rooms.	\$ 44	\$ 409	\$ 453
Drinking Fountains:	Replace fountain and provide clear floor space.	\$ 425	\$ 170	\$ 595
Doors:	Provide wider doors to rest rooms and shower.	STRUCTURALLY IMPRACTICAL		
Lavatories and Mirrors:	Lower mirrors in both rest rooms.		"	
	Relocate exposed water pipes under sinks, provide knee and floor clearance in both rest rooms.		"	
Toilet Stalls:	Provide accessible stalls and grab bars in both rest rooms.		"	
Water Closets:	Replace toilets in both rest rooms and provide grab bars.		"	
Urinal:	Lower urinal and provide clear floor space in front of fixture.		"	
Shower Stall:	Lower curb at shower entrance. Provide a seat, grab bars and proper controls.		"	
Totals		\$ 469	\$ 579	\$ 1048

BUILDING NUMBER: 4010BUILDING LOCATION: Magnolia Street Park
West End of Magnolia St.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 70	\$ 70
	Totals	\$0000000	\$ 70	\$ 70

BUILDING NUMBER: 4020BUILDING LOCATION: Mandalay Pier
Eldorado St./West End

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkways through park from parking and sidewalk.	\$0000000	\$ 5000	\$ 5000
	Provide walkway to picnic bench.	\$0000000	\$000000	\$000000
Ramp:	Replace ramp to pier and provide handrails.	\$0000000	\$000000	\$000000
Assembly Area:	Provide wheelchair areas at walkway next to pier.	\$0000000	\$000000	\$000000
Drinking Fountain:	Replace 4 fountains and provide walkways for access.	\$0000000	\$000000	\$000000
Showers:	Provide walkways to showers	\$0000000	\$000000	\$000000
	Provide lower controls and shower heads.	\$0000000	\$000000	\$000000
	Provide clear floor area around showers.	\$0000000	\$000000	\$000000
Handrails:	Lower handrails on walkway next to pier.	\$0000000	\$000000	\$000000
Toilet Stalls:	Enlarge toilet stalls at rest room on east side of parking lot #36 and install grab bars.	\$0000000	\$ 500	\$ 500
Water Closets:	Lower toilet paper dispensers.	\$0000000	\$ 70	\$ 70
Sinks:	Provide knee clearance under sinks in rest rooms.	\$0000000	\$ 150	\$ 150
Totals		\$0000000	\$ 5720	\$ 5720

BUILDING NUMBER: 4030BUILDING LOCATION: Mandalay Park
Mandalay Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkways to playground elements and horseshoe pit.	\$0000000	\$ 11000	\$ 11000
	Totals	\$0000000	\$ 11000	\$ 11000

BUILDING NUMBER: 4040BUILDING LOCATION: Marina Building
25 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide fifteen 32" wide doors throughout the marina building.	\$0000000	\$ 26132	\$ 26132
	Lower thresholds on all front and rear entrance doors.	\$0000000	\$ 408	\$ 408
	Provide ramps for the roof exit on the second floor and the dinner boat ticket office.	\$0000000	\$ 160	\$ 160
	Adjust doors throughout the marina to have an opening force of less than 5 IBF.	\$0000000	\$ 478	\$ 478
Accessible Routes:	Relocate stairway handrail to provide access to second floor rest rooms.	\$0000000	\$ 37000	\$ 37000
Parking:	Widen access aisle for accessible spaces located by the double eagle dock.	\$0000000	\$ 150	\$ 150
Alarms:	Provide a visual alarm system.	\$0000000	\$ 3000	\$ 3000
Counters:	Provide 36" x 36" space for the counters located at the dinner boat ticket office, beach views office and harbormaster's office.	\$0000000	\$ 6480	\$ 6480
	Lower counter in the second floor rest room.	\$0000000	\$ 50	\$ 50
	Provide new counter for snack bar in main lobby.	\$0000000	\$ 100	\$ 100
Telephone:	Provide two hearing aid compatible public telephones in lobby.	\$0000000	\$000000	\$000000
Stairs:	Install handrails for stairs by docks leading to the second floor, from lobby to second floor and on east side doors leading to the second floor.	\$ 300	\$ 244	\$ 544
Fitting Room:	Enlarge fitting room.	\$0000000	\$ 680	\$ 680

BUILDING NUMBER: 4040BUILDING LOCATION: Marina Building
25 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Drinking Fountains:	Replace fountains on second floor and in the lobby.	\$ 900	\$ 204	\$ 1104
Sinks:	Provide knee clearance under sinks in room 27, conference room, second floor rest rooms and first floor rest rooms.	\$0000000	\$ 3457	\$ 3457
Water Closets:	Replace toilets in second floor rest rooms.	\$ 400	\$ 409	\$ 809
Lavatories and Mirrors:	Lower mirrors in all rest rooms.	\$0000000	\$ 136	\$ 136
	Relocate exposed water pipes in the second floor rest rooms.	\$0000000	\$ 150	\$ 190
Urinals:	Lower urinal in first floor men's room.	\$0000000	\$ 85	\$ 85
Grab Bars:	Provide grab bars in second floor rest room.	\$ 180	\$ 136	\$ 316
Operating Mechanisms:	Lower paper towel dispenser in second floor rest room.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide 32" wide doors for stalls in all rest rooms.	\$0000000	\$ 1460	\$ 1460
	Provide accessible stalls in second floor rest rooms.	\$0000000	\$ 460	\$ 460
	Provide grab bars for first floor rest rooms.	\$ 180	\$ 136	\$ 316
	Provide accessible stalls in first floor rest rooms.	\$0000000	\$ 460	\$ 460
	Totals	\$ 1960	\$ 81975	\$ 83935

BUILDING NUMBER: 4050BUILDING LOCATION: Marina Post Office
25 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Counter:	Provide 36" x 36" areas at main and zip code counters.	\$ 700	\$ 1636	\$ 2336
Drinking Fountains:	Lower fountain in mail room and provide clear floor space.	\$000000	\$ 656	\$ 656
Doors:	Provide 32" wide doors to rest room, locker room and exit to parking.	\$000000	\$ 6450	\$ 6450
	Lower threshold at main entrance.	\$000000	\$ 130	\$ 130
Toilet Stalls:	Replace stall in rest room near mail room.		(Included in Door Price)	
Sinks:	Relocate exposed water pipes under sinks in the rest room and locker room.		"	
	Provide knee clearance under sink in locker room.		"	
Mirrors:	Lower mirror in the rest room.		"	
Water Closets:	Provide grab bars in rest room.		"	
	Totals	\$ 700	\$ 8872	\$ 9572

BUILDING NUMBER: 4070BUILDING LOCATION: Marina/Maintenance Bldg.
25 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide ramp for entrance to building.	\$0000000	\$ 1200	\$ 1200
	Totals	\$0000000	\$ 1200	\$ 1200

BUILDING NUMBER: 4080BUILDING LOCATION: Marina/Fuel Dock
25 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Lower threshold at main entrance of office.	\$ 10	\$ 68	\$ 78
Counters:	Provide a 36" x 36" area for office counter.	\$ 750	\$ 1360	\$ 2110
Accessible Route:	Provide clear aisle space around and behind office counters.	\$000000	\$000000	\$000000
Telephone:	Provide volume control and hearing aid compatibility for the public phone.	\$000000	\$000000	\$000000
	Totals	\$000000	\$ 2188	\$ 2188

BUILDING NUMBER: 4090BUILDING LOCATION: Marshall Street Park
1141 Beckett Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Accessible Route:	Provide walkways to the utility building, water fountains, picnic shelter and playground.	\$0000000	\$ 8500	\$ 8500
Surface Area:	Provide accessible surface in playground.	\$0000000	\$000000	\$000000
Drinking Fountains:	Install 3 new fountains.	\$ 500	\$ 150	\$ 650
	Totals	\$ 500	\$ 8650	\$ 9150

BUILDING NUMBER: 4200BUILDING LOCATION: W.P.C./Marshall Street
1605 Harbor Drive

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Lower thresholds and provide 32" wide door openings for main entrance, outside stairway and superintendents rest room.	\$0000000	\$000000	\$000000
Water Fountains:	Replace fountain on the second floor.	\$0000000	\$000000	\$000000
Stairs:	Provide handrail for stairs on the east and west sides and replace stairs on the east side.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under kitchen sink.	\$0000000	\$000000	\$000000
	Provide clear floor space in front of sinks in the rest rooms.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under rest room sinks.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in each rest room, install grab bars and clear floor space in stalls.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility.	\$0000000	\$000000	\$000000
Mirrors:	Lower mirrors in each rest room.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispensers in the rest rooms.	\$0000000	\$000000	\$000000
Elevators:	Provide hall lantern with visual and audial signal.	\$0000000	\$000000	\$000000
	Provide car position indicators and raised star for call button.	\$0000000	\$000000	\$000000
	Replace reopening device and provide proper braille characters.	\$0000000	\$000000	\$000000
Counters:	Lower counters throughout the labs and provide knee clearance under control room counters.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 4300BUILDING LOCATION: M. L. King Center
1201 M.L. King Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 125	\$ 125
Alarms:	Provide visual alarm system.	\$0000000	\$ 1200	\$ 1200
Curb Ramps:	Replace ramps on the north side of the bldg. and from the street to the entrance walkway.	\$0000000	\$ 1600	\$ 1600
	Provide ramps for the main entrance and from parking to the north side entrance.	\$0000000	\$ 2000	\$ 2000
Doors:	Lower thresholds to the game room, south exit doors and double inside doors.	\$0000000	\$ 400	\$ 400
	Provide 32" wide door openings for main entrance, offices #2-#8, exit from game room, between hall and game room, south side exits and rest rooms.	\$0000000	\$ 2000	\$ 2000
Accessible Route:	Provide walkway from rear game room door to parking and from south double doors to parking.	\$0000000	\$ 4400	\$ 4400
Telephone:	Replace public phone with unit that has volume control and is hearing aid compatible.	\$0000000	\$000000	\$000000
Counters:	Lower main counter and provide a 36" X 36" area.	\$0000000	\$ 450	\$ 450
	Lower counters in women's rest room, kitchen and game room.	\$0000000	\$ 650	\$ 650
Sinks:	Provide knee clearance under sinks in the game room and kitchen.	\$0000000	\$ 100	\$ 100
Water Fountains:	Replace two fountains.	\$0000000	\$ 1200	\$ 1200
Water Closets:	Replace toilets in each rest room.	\$ 200	\$ 150	\$ 350
Toilet Stalls:	Replace stalls in each rest room to provide accessibility.	\$ 800	\$ 200	\$ 1000

BUILDING NUMBER: 4300BUILDING LOCATION: M. L. King Center
1201 M.L. King Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Urinals:	Lower urinals in all men's rest rooms.	\$0000000	\$ 300	\$ 300
Lavatories and Mirrors:	Lower mirrors in rest rooms.	\$0000000	\$ 150	\$ 150
	Relocate exposed water pipes under rest room sinks.	\$0000000	\$ 100	\$ 100
Dispensers:	Lower paper towel dispensers in rest rooms.	\$0000000	\$ 75	\$ 75
Totals		\$ 1000	\$ 15100	\$ 16100

BUILDING NUMBER: 4305BUILDING LOCATION: Marymont Park
1900 Gilbert Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 150	\$ 150
Accessible Route:	Provide walkways to the building, basketball court, bleachers, picnic shelter and playground.	\$0000000	\$ 8500	\$ 8500
Assembly Area:	Provide location for wheelchairs.	\$0000000	\$ 275	\$ 275
Drinking Fountains:	Install 1 new fountain.	\$ 500	\$ 150	\$ 650
Rest Rooms:	Provide walkway to the rest rooms.	\$0000000	\$ 5000	\$ 5000
Toilet Stalls:	Provide accessible stalls and grab bars in both rest rooms.			
Water Closet:	Install new toilets in both rest rooms.			
Doors:	Provide wider doors to both rest rooms. Provide wider clearance between stall door and wall.			
Sinks:	Relocate exposed water pipes under sinks in both rest rooms.			
Totals		\$ 500	\$ 14075	\$ 14575

BUILDING NUMBER: 4310BUILDING LOCATION: McKay Field
615 Mandalay Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkways to field and lawn bowling court.	\$0000000	\$ 4500	\$ 4500
	Totals	\$0000000	\$ 4500	\$ 4500

BUILDING NUMBER: 4315BUILDING LOCATION: McMullen Tennis Park
1000 Edenville Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Routes:	Provide walkways to the fitness course and picnic tables throughout the park.	\$0000000	\$ 2887	\$ 2887
Counters:	Provide proper knee clearance and a 36" x 36" area for the office counter.	\$0000000	\$ 225	\$ 225
Water Fountains:	Replace fountain by main entrance and concession stand.	\$ 500	\$ 150	\$ 650
Telephone:	Make phone hearing aid compatible and provide volume control. Provide proper floor clearance around phone.	\$0000000	\$000000	\$000000
Doors:	Lower threshold at main entrance and locker rooms.	\$0000000	\$ 75	\$ 75
Tables:	Provide tables at the concession stand that provide proper knee clearance.	\$0000000	\$ 150	\$ 150
Accessible Route:	Provide walkways to the west court bleachers, the walled practice area and the utility building.	\$0000000	\$ 1000	\$ 1000
Assembly Areas:	Provide wheelchair areas for both bleachers.	\$0000000	\$ 250	\$ 250
Water Closets:	Replace toilets in both locker rooms.	\$ 200	\$ 120	\$ 320
Toilet stalls:	Provide accessible stalls for both locker rooms.	\$ 800	\$ 260	\$ 1060
Urinals:	Lower urinal in men's locker room.	\$0000000	\$ 140	\$ 140
Sinks:	Provide proper Knee clearance under sinks in the men's locker room.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 4315BUILDING LOCATION: McMullen Tennis Park
1000 Edinville Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Lavatories and Mirrors:	Lower mirrors in both Locker rooms.	\$0000000	\$ 150	\$ 150
	Relocate exposed water pipes under the sinks in both locker rooms.	\$0000000	\$ 200	\$ 200
Accessible Routes:	Relocate barrier wall at entrance to women's locker room.	\$0000000	\$ 1200	\$ 1200
Shower Stalls:	Provide ramp at door to shower rooms in both locker rooms.	\$0000000	\$ 5000	\$ 5000
	Replace shower stall and provide seat, grab bars and proper controls in women's locker room.			
	Provide seats in shower stalls of both locker rooms.			
	Provide proper shower spray unit in men's locker room building.			
	Totals	\$ 1000	\$ 12447	\$ 13447

BUILDING NUMBER: 4330BUILDING LOCATION: Moccasin Lake Park
2750 Park Trail Lane

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Raise level of sign.	\$0000000	\$ 150	\$ 150
Accessible Route:	Provide curb ramps and widen walkway around main building.	\$0000000	\$000000	\$000000
	Provide walkways to the picnic grill area, water tower exhibit, camp fire site and recyclable bins.	\$0000000	\$000000	\$000000
Counters:	Lower counters at main entrance.	\$0000000	\$ 500	\$ 500
Drinking Fountains:	Replace fountain on path and provide proper clear floor space.	\$0000000	\$ 650	\$ 650
Assembly Areas:	Provide locations for wheelchairs at the camp fire site.	\$0000000	\$ 200	\$ 200
Sink:	Replace sink in animal diet preparation room to provide proper knee clearance and height.	\$0000000	\$000000	\$000000
Ground and Floor Surfaces:	Provide slip resistance strips on ramp to rest rooms.	\$0000000	\$ 200	\$ 200
	Provide firm slip resistant material for trails.	\$0000000	\$000000	\$000000
Stairs:	Replace stairs to rest rooms and lower handrails.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds of doors in the main building.	\$0000000	\$ 1000	\$ 1000
	Provide 32" wide doors in the main building.	\$0000000	\$000000	\$000000
	Provide ramp at entrance to park supervisors office.	\$0000000	\$000000	\$000000
Handrails:	Lower handrail on ramp to rest rooms.	\$0000000	\$ 600	\$ 600

BUILDING NUMBER: 4330BUILDING LOCATION: Moccasin Lake Park
2750 Park Trail Lane

Lavatories and Mirrors:	Lower mirrors in all rest rooms.	\$0000000	\$ 50	\$ 50
	Relocate exposed water pipes under all rest room sinks.	\$0000000	\$ 100	\$ 100
	Provide proper knee clearance under rest room sinks.	\$0000000	\$ 700	\$ 700
Toilet Stalls:	Install grab bars in toilet stalls of both rest rooms.	\$0000000	\$ 200	\$ 200
	Provide accessible stalls in both rest rooms.	\$0000000	\$ 1500	\$ 1500
	Provide clear floor space in front of stalls in both rest rooms.	\$0000000	\$000000	\$000000
Boardwalk:	Provide handrails for boardwalks and bridges on trails.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$ 5850	\$ 5850

BUILDING NUMBER: 4340BUILDING LOCATION: Morningside\Handball Courts
2400 Harn Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Drinking Fountain:	Replace fountain.	\$ 500	\$ 150	\$ 650
Accessible Routes:	Provide walkway from courts to water fountain.	\$0000000	\$ 400	\$ 400
	Provide walkways to other facilities in the complex.	\$0000000	\$000000	\$000000
	Totals	\$ 500	\$ 550	\$ 1050

BUILDING NUMBER: 4345BUILDING LOCATION: Morningside Center/Pool
2400 Harn Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide access aisle between existing spaces and raise signs.	\$0000000	\$ 150	\$ 150
Ramps:	Provide ramps from parking to building and from building to pool.	\$0000000	\$ 400	\$ 400
Curb Ramps:	Provide ramps for office doors and east side doors.	\$0000000	\$ 612	\$ 612
Counters:	Lower main counter and provide a 36" X 36" area.	\$0000000	\$ 500	\$ 500
Water Fountains:	replace outside fountains.	\$0000000	\$ 650	\$ 650
Doors:	Lower thresholds to the rest rooms.	\$0000000	\$000000	\$000000
Accessible Route:	Provide walkways to the volleyball courts, basketball courts, playground, swing and slide area, handball courts, tennis courts and picnic tables.	\$0000000	\$ 6885	\$ 6885
Ground Surfaces:	Provide stable surface for swing and slide area, volleyball courts and playground.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under rest room sinks. Relocate exposed water pipes under rest room sinks.	\$0000000	\$ 6000	\$ 6000
Water Closets:	Replace toilets in each rest room.			
Toilet Stalls:	Replace stalls in each rest room to provide accessibility.			
Mirrors:	Lower mirrors in each rest room.			
Shower Stalls:	Provide accessible stalls with proper grab bars, seats and controls in the shower/rest room and the lieutenants bathroom.			
Fixed Seating:	Provide knee clearance under picnic tables.	\$0000000	\$ 175	\$ 175
	Totals	\$0000000	\$ 15372	\$ 15372

BUILDING NUMBER: 4350BUILDING LOCATION: Morningside\Tennis Courts
2400 Harn Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Drinking Fountain:	Replace fountain.	\$ 500	\$ 150	\$ 650
Accessible Routes:	Provide walkway from courts to water fountain.	\$0000000	\$ 222	\$ 222
	Provide walkways to other facilities in the complex.	\$0000000	\$ 13200	\$ 13200
	Level walkway from parking to courts.	\$0000000	\$000000	\$000000
	Totals	\$ 500	\$ 13572	\$ 14072

BUILDING NUMBER: 4355BUILDING LOCATION: Morningside Rec Center
2400 Harn Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Relocate existing spaces and provide access aisles.	\$0000000	\$ 140	\$ 140
Curb Ramps:	Level area where access aisle and walkway meet.	\$0000000	\$ 850	\$ 850
Ramps:	Provide ramp from parking to outside terrace.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds to main entrance, pottery room off of dock, dock doors, north exit, west exit, door at bottom of southeast stair, meeting rooms and four exits from the meeting rooms.	\$0000000	\$000000	\$000000
	Provide 32" wide door openings for the pottery room, rest rooms, art room, north exit, west exit, door at bottom of southeast stairs, entrance to meeting rooms, lobby, kitchen and meeting room exits.	\$0000000	\$000000	\$000000
	Provide level area in front of main entrance.	\$0000000	\$ 800	\$ 800
Drinking Fountains:	Replace fountains in the lobby and by the north exit.	\$0000000	\$ 200	\$ 200
Counters/Tables:	Lower counter in the lobby.	\$0000000	\$ 500	\$ 500
	Provide knee clearance under terrace tables.	\$0000000	\$ 125	\$ 125
Stairs:	Install handrails for dock stairs, north exit stairs, west exit stairs and southeast stairs.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide clear passage to rest rooms by the north exit.	\$0000000	\$000000	\$000000
Ramp:	Provide a ramp to the north exit.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 4355BUILDING LOCATION: Morningside Rec Center
2400 Harn Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Sinks:	Provide clear floor space in front of sinks in the rest rooms off the pottery and art rooms.	\$0000000	\$000000	\$000000
	Provide knee clearance under sinks in the lobby rest room, kitchen rest room, kitchen and meeting room.	\$0000000	\$ 500	\$ 500
	Relocate exposed water pipes under rest room sinks near the art and pottery rooms.	\$0000000	\$000000	\$000000
Mirrors:	Lower mirrors in lobby rest rooms.	\$0000000	\$ 100	\$ 100
Water Closets:	Replace toilets in all the rest rooms and install grab bars.	\$0000000	\$ 300	\$ 300
Toilet Stalls:	Replace stalls in all rest rooms to provide accessibility and grab bars.	\$0000000	\$ 1300	\$ 1300
Dispensers:	Lower paper towel dispensers in lobby rest rooms.	\$0000000	\$ 100	\$ 100
Shower Stalls:	Replace shower stall in rest room by kitchen to provide accessibility and proper seats, controls and grab bars.	\$0000000	\$000000	\$000000
Alarms:	Provide a visual alarm system.	\$0000000	\$ 800	\$ 800
Totals		\$0000000	\$ 5675	\$ 5675

BUILDING NUMBER: 4500BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide access aisle between existing spaces and raise signs.	\$0000000	\$0000000	\$0000000
Curb Ramps:	Provide ramps to front entrance walkway and rear exit near rest rooms.	\$0000000	\$0000000	\$0000000
Doors:	Lower thresholds to main entrance.	\$0000000	\$0000000	\$0000000
	Provide 32" wide door openings for main entrance, first floor doorway to rest rooms, rear exit door near rest rooms, second floor rest rooms and bacteria room.	\$0000000	\$0000000	\$0000000
Sinks:	Provide knee clearance under sinks in the second floor rest rooms and the sink in the AAGC room.	\$0000000	\$0000000	\$0000000
Stairs:	Provide handrails for the north and south stairs that are continuous and of the proper height.	\$0000000	\$0000000	\$0000000
Doors:	Provide 32" wide door openings at the top of both stairways.	\$0000000	\$0000000	\$0000000
Water Fountains:	Replace fountains on both floors.	\$0000000	\$0000000	\$0000000
Water Closets:	Replace toilets in each rest room.	\$0000000	\$0000000	\$0000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and proper grab bars.	\$0000000	\$0000000	\$0000000
Urinals:	Lower urinals in first floor men's rest room.	\$0000000	\$0000000	\$0000000
Lavatories & Mirrors:	Lower mirrors in all rest rooms.	\$0000000	\$0000000	\$0000000
	Relocate exposed water pipes under sinks in all rest rooms.	\$0000000	\$0000000	\$0000000

BUILDING NUMBER: 4500BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Shower Stalls:	Provide Accessible shower stalls with proper grab bars seats and controls in the first floor rest rooms.	\$0000000	\$0000000	\$0000000
Accessible Routes:	Provide 36" wide access for door to women's shower stall.	\$0000000	\$0000000	\$0000000
Elevators:	Provide hall lantern and visible and audible alarms.	\$0000000	\$0000000	\$0000000
	Provide car position indicators.	\$0000000	\$0000000	\$0000000
	Provide raised star indicator for the first floor call button.	\$0000000	\$0000000	\$0000000
	Replace reopening device.	\$0000000	\$0000000	\$0000000
	Provide 2" high braille characters.	\$0000000	\$0000000	\$0000000
Totals		\$0000000	\$0000000	\$0000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 4600BUILDING LOCATION: Nursery Building
901 N. Saturn Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Doors:	Provide 32" wide door for men's rest room. Clear area in front of women's rest room.	\$0000000	\$000000	\$000000
Accessible Route:	Refinish walkway to east entrance.	\$0000000	\$000000	\$000000
Drinking Fountains:	Install 1 new fountain.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide proper clear floor space in front of stalls in both rest rooms.	\$0000000	\$000000	\$000000
	Replace toilets in both rest rooms and install grab bars.	\$0000000	\$000000	\$000000
Urinal:	Lower urinal.	\$0000000	\$000000	\$000000
Lavatories and Mirrors:	Provide proper knee clearance under rest room sinks.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes located under rest room sinks.	\$0000000	\$000000	\$000000
Sinks:	Replace utility sink.	\$0000000	\$000000	\$000000
Reach Ranges:	Relocate towel dispenser next to utility sink.	\$0000000	\$000000	\$000000
Shower Stall:	Lower curb into stall.	\$0000000	\$000000	\$000000
	Provide shower spray unit with 60" hose.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 4605

BUILDING LOCATION: Nursery/Chemical Storage
901 N. Saturn Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkways to building and bus stop.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 4615BUILDING LOCATION: Park Street Garage
613 Park Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide 3 more accessible spaces and signs. Raise existing signs.	\$0000000	\$ 420	\$ 420
Accessible Route:	Provide accessible route to ticket booth.	\$0000000	\$000000	\$000000
Door Opening Force:	Adjust tension on door leading to elevator on level 4.	\$0000000	\$000000	\$000000
Doors:	Lower threshold to door leading to elevator on level 4.	\$0000000	\$ 150	\$ 150
Stairs:	Adjust height of handrails.	\$0000000	\$ 750	\$ 750
Elevators:	Provide hall lanterns on all levels.	\$0000000	\$ 10000	\$ 10000
	Adjust reopening devise to exceed 20 seconds.			
	Provide Braille labels for control buttons.			
	Totals	\$0000000	\$ 11320	\$ 11320

BUILDING NUMBER: 4620BUILDING LOCATION: Parks Field Office
507 Vine Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs by main entrance and employee parking lot.	\$0000000	\$ 210	\$ 210
Doors:	Provide minimum Clear door openings of 32" for stock room, men's rest room, 2nd floor records room, vending machine room, Mr. McGill's office, Mr. George's office and the storage room.	\$0000000	\$ 3563	\$ 3563
	Lower threshold to Mr. George's office.	\$0000000	\$ 100	\$ 100
	Provide ramps for outside door with mail container, storage room door and entrances from parking area.	\$0000000	\$ 600	\$ 600
Drinking Fountains:	Replace 2 fountains.	\$ 900	\$ 204	\$ 1104
Toilet Stalls:	Provide accessible stalls in both rest rooms.	\$ 600	\$ 168	\$ 768
	Provide wider stall for urinal.	\$ 600	\$ 100	\$ 700
	Provide wider doorway to women's rest room and wider access to sink.	\$0000000	\$ 600	\$ 600
Water Closets:	Replace toilets in both rest rooms and provide grab bars.	\$ 480	\$ 204	\$ 684
Lavatories and Mirrors:	Lower mirrors in both rest rooms.	\$0000000	\$ 68	\$ 68
	Relocate exposed water pipes in both rest rooms.	\$0000000	\$ 50	\$ 50
	Totals	\$ 2580	\$ 5867	\$ 8447

BUILDING NUMBER: 4625BUILDING LOCATION: Phillip Jones Complex
1190 Russell Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 150	\$ 150
Accessible Routes:	Provide walkway to parking, rest rooms, snack bar, concession stand, dugouts and drinking fountain.	\$0000000	\$ 6050	\$ 6050
Assembly Area:	Provide wheelchair areas by bleachers for football and baseball fields.	\$0000000	\$ 325	\$ 325
Counters:	Lower concession stand counters.	\$0000000	\$000000	\$000000
Stairs:	Provide handrail for stairs to the press box.	\$0000000	\$ 450	\$ 450
Water Fountains:	Replace fountains in office and near baseball field.	\$0000000	\$ 650	\$ 650
Toilet Stalls:	Replace stalls in each rest room to provide accessibility.	\$0000000	\$ 1600	\$ 1600
Water Closets:	Provide grab bars in the rest rooms.	\$ 180	\$ 136	\$ 316
Lavatories and Mirrors:	Lower mirrors in the rest rooms.	\$0000000	\$ 50	\$ 50
	Relocate exposed water pipes under the sinks in the rest room.	\$0000000	\$ 100	\$ 100
	Lower sinks in the rest rooms.	\$0000000	\$ 130	\$ 130
Doors:	Lower thresholds to doors in office and rest rooms.	\$0000000	\$ 575	\$ 575
	Provide a ramp to the entrance of the snack bar.	\$0000000	\$000000	\$000000
Totals		\$ 180	\$ 10216	\$ 10396

BUILDING NUMBER: 4630BUILDING LOCATION: Pier 60
100 Gulfview Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Ramps:	Replace or level ramps leading up to pier and in front of gates to fishing area.	\$0000000	\$000000	\$000000
	Provide handrails for ramp leading up to pier.	\$0000000	\$000000	\$000000
Reach Ranges:	Lower viewing machines.	\$0000000	\$000000	\$000000
Telephone:	Replace public phone with one that has volume control and is hearing aid compatible.	\$0000000	\$000000	\$000000
Counter:	Counters at gate to fishing area and inside bait shop need to be lowered and have 36" X 36" areas provided.	\$0000000	\$000000	\$000000
Accessible Routes:	Widen entrance to bait shop.	\$0000000	\$000000	\$000000
	Provide access to observation deck.	\$0000000	\$000000	\$000000
Doors:	Provide 32" wide door openings for entrance to bait shop and rest rooms.	\$0000000	\$000000	\$000000
Stairs:	Replace stairs to observation deck and lower handrails.	\$0000000	\$000000	\$000000
Sinks:	Lower sink on fishing area.	\$0000000	\$000000	\$000000
Water Closet:	Install new toilets in the rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide an accessible stall with proper clearance and grab bars in each of the rest rooms.	\$0000000	\$000000	\$000000
Urinals:	Lower urinal.	\$0000000	\$000000	\$000000
Lavatories and Mirrors:	Relocate exposed water pipes under sinks in both rest rooms.	\$0000000	\$000000	\$000000
	Lower mirrors in both rest rooms.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 4630

BUILDING LOCATION: Pier 60
100 Gulfview Blvd.

Sinks: Provide clear floor space \$0000000 \$000000 \$000000
in front of sinks in both
rest rooms.

Accessible Routes: Relocate sink in men's \$0000000 \$000000 \$000000
rest room.

Totals \$0000000 \$000000 \$000000
(Scheduled for Replacement)

BUILDING NUMBER: 4635BUILDING LOCATION: Pinellas Arts Center
402 Pierce Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible space and signs.	\$0000000	\$ 70	\$ 70
Accessible Route:	Provide stable walkway from parking to stairs.	\$0000000	\$ 2257	\$ 2257
	Provide wheelchair access to second floor.	\$0000000	\$000000	\$000000
	Provide walkway from side entrance to parking.	\$0000000	\$ 2300	\$ 2300
	Make parking space in front of entrance walkway a no parking area.	\$0000000	\$ 70	\$ 70
Space Allowance:	Provide wheelchair clearance in hallway with copy machine.	\$0000000	\$000000	\$000000
Handrails:	Provide handrails on both sides of front and side entrance stairs.	\$ 270	\$ 272	\$ 542
	Adjust height of handrails on second floor entrance stairs.	\$ 150	\$ 272	\$ 422
Stairs:	Replace stairs to basement and install handrails.	\$ 1000	\$ 1364	\$ 2364
Doors:	Lower threshold to front, side and west porch doors.	\$ 50	\$ 200	\$ 250
	Replace doors with new 32" wide doors.	\$ 1000	\$ 800	\$ 1800
Water Closet:	Install new toilets in both rest rooms and install grab bars.	\$ 250	\$ 136	\$ 386
	Provide clear floor space in front of toilets in all rest rooms.	\$0000000	\$ 3500	\$ 3500
Lavatories and Mirrors:	Lower mirrors in all rest rooms.		"	

(Complete Remodel)

BUILDING NUMBER: 4635BUILDING LOCATION: Pinellas Arts Center
402 Pierce Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Sinks:	Lower Kitchen sink.		(Complete Remodel)	
	Provide knee clearance at Kitchen and rest room sinks.		"	
	Relocate exposed water pipes under rest room sinks.		"	
Bathtubs:	Provide accessibility to bathtubs in both rest rooms.		"	
	Totals	\$ 2720	\$ 11241	\$ 13961

BUILDING NUMBER: 4640 BUILDING LOCATION: Police Dept.\Main
644 Pierce Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide access aisle by front entrance and raise signs.	\$0000000	\$ 200	\$ 200
Doors:	Lower thresholds to identification, community relations, community relations porch and rest rooms near roll call.	\$0000000	\$ 200	\$ 200
	Provide 32" wide door openings for doorway to lobby, information counter, identification, door next to identification, chemical storage room, community relations rest rooms, community relations porch, counter door to secure area, rest rooms near sergeants office, small sergeants office, property room hallway, first floor women's locker room, first floor women's shower room, rest rooms near roll call, chiefs office, coffee room, investigation commander, case management supervisors office, major case room, door next to major case room, door to stairway, second floor rest rooms, computer room, internal affairs, accreditation, exit door near lockers, lobby rest rooms and chaplin's door.	\$0000000	\$ 2000	\$ 2000
Counters/Tables:	Lower counters in lobby and on door to secure area.	\$0000000	\$000000	\$000000
	Provide knee clearance under the tables in roll call and offices throughout the first floor.	\$0000000	\$000000	\$000000
	Provide 36" x 36" areas at counters in the lobby.	\$0000000	\$000000	\$000000
Stairs:	Provide handrails for the community relations and outside secure stairs.	\$0000000	\$ 450	\$ 450
Ramps:	Provide ramps to Sgt.'s office, second floor locker area, communications super. office and Lt. Eggers Office.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 4640BUILDING LOCATION: Police Dept. \Main
644 Pierce Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Ramps:	Replace ramps at second floor stairway and ramp by the Chief's Office.	\$0000000	\$000000	\$000000
Curb Ramps:	Provide ramp at north door, sidewalk to north parking, door to secure area and east door.	\$0000000	\$ 1400	\$ 1400
Water Closets:	Replace toilets in the Sgt.'s rest room, install grab bars and clear floor for accessibility.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and proper grab bars.	\$ 1600	\$ 250	\$ 1850
	Replace toilets in each rest room.	\$ 400	\$ 250	\$ 650
Urinals:	Lower urinals in all men's rest rooms and clear floor area around urinals in the second floor hallway rest room.	\$0000000	\$ 600	\$ 600
Mirrors:	Lower mirrors in all rest rooms and locker rooms.	\$0000000	\$ 200	\$ 200
Dispensers:	Lower paper towel dispensers in roll call and lobby rest rooms.	\$0000000	\$ 50	\$ 50
Sinks:	Relocate exposed water pipes under sinks in all rest rooms.	\$0000000	\$ 200	\$ 200
	Provide knee clearance under sinks in the communications rest rooms and kitchen.	\$0000000	\$000000	\$000000
	Provide clear floor space in front of the sinks in the rest rooms.	\$0000000	\$ 1000	\$ 1000
Shower Stalls:	Replace stalls in locker rooms to provide accessibility and proper seats, grab bars and controls.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 4640BUILDING LOCATION: Police Dept. \Main
644 Pierce Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Water Fountains:	Replace 6 fountains.	\$0000000	\$ 1200	\$ 1200
Accessible Routes:	Provide wheelchair access to the second floor.	\$0000000	\$000000	\$000000
	Provide 36" clear access between lockers in the first floor locker room and the red locker room.	\$0000000	\$000000	\$000000
Alarms:	Provide a visual alarm system.	\$0000000	\$ 1000	\$ 1000
Telephones:	Replace public phone in the lobby to provide volume control and hearing aid compatibility.	\$0000000	\$000000	\$000000
Totals		\$ 2000	\$ 9600	\$ 11600

BUILDING NUMBER: 4645BUILDING LOCATION: Police Dept./Pistol Range
2851 McMullen Booth Road

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Ramp:	Provide ramp to the classroom.	\$0000000	\$000000	\$000000
Doors:	Lower threshold at the classroom and shed doors.	\$0000000	\$000000	\$000000
	Provide 32" wide door openings to the classroom and rest rooms.	\$0000000	\$000000	\$000000
Stairs:	Provide handrails for front and rear stairs of the classroom.	\$0000000	\$000000	\$000000
	Replace rear stairs to the classroom.	\$0000000	\$000000	\$000000
Sink:	Provide knee clearance under the kitchen sink.	\$0000000	\$000000	\$000000
Water Fountains:	Lower fountain and clear the space around the fountain.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in the rest rooms to provide accessibility and grab bars.	\$0000000	\$000000	\$000000
Urinals: Area:	Lower urinals in the men's rest room.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
		(Employees Only - No Public Acces)		

BUILDING NUMBER: 4655 BUILDING LOCATION: Police Dept./Countryside
2851 McMullen Booth Road

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Routes:	Provide walkway to transportation.	\$0000000	\$ 5500	\$ 5500
	Provide clear access to the lobby rest rooms.	\$0000000	\$ 3000	\$ 3000
Parking:	Provide one more accessible space and sign.	\$0000000	\$ 75	\$ 75
Ramps:	Level ramp from parking to the main entrance.	\$0000000	\$ 450	\$ 450
Doors:	Lower thresholds to doors at main entrance, west employee entrance, sally port doorway and lobby rest room.	\$0000000	\$ 200	\$ 200
	Provide 32" wide door openings for employee entrance and meeting room exit.	\$0000000	\$000000	\$000000
Water Fountains:	Replace fountains in lobby and hallway.	\$ 500	\$ 150	\$ 650
Counters:	Lower main counter and provide a 36" X 36" area.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sinks in the utility room, lounge and locker room.	\$0000000	\$ 600	\$ 600
Lavatories and Mirrors:	Lower mirrors in the lobby rest rooms and locker rooms.	\$0000000	\$ 150	\$ 150
	Relocate exposed water pipes under the sinks in the lobby rest room.	\$0000000	\$ 150	\$ 150
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and proper grab bars.	\$ 1180	\$ 200	\$ 1380
Shower Stalls:	Provide accessible stalls with proper seats grab bars and controls in the locker room.	\$0000000	\$000000	\$000000
Totals		\$ 1680	\$ 10475	\$ 12155

BUILDING NUMBER: 4650BUILDING LOCATION: Police Dept./Condon Gardens
2930 Sandlewood Drive

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Routes:	Widen walkway to main entrance.	\$0000000	\$000000	\$000000
Curb Ramps:	Provide ramps for the front and rear entrances.	\$0000000	\$000000	\$000000
Telephone:	Provide public phone that has volume control and is hearing aid compatible.	\$0000000	\$000000	\$000000
	Totals	\$0000000	\$000000	\$000000 (Not a City Facility)

BUILDING NUMBER: 4660

BUILDING LOCATION: Police Dept./East

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Totals		\$0000000	\$000000	\$000000
(Secure Area, Employees Only - No Public Access.)				

BUILDING NUMBER: 4665BUILDING LOCATION: Police Dept./K-9 Training
2851 McMullen Booth Road

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Ramp:	Replace ramp to main entrance.	\$0000000	\$ 375	\$ 375
Doors:	Lower threshold at the rest rooms and storage room.	\$0000000	\$ 250	\$ 250
Water Fountains:	Lower fountain and clear the space around the fountain.	\$ 500	\$ 150	\$ 650
Accessible Route:	Provide walkway to the bleachers.	\$0000000	\$ 1650	\$ 1650
Assembly Area:	Provide wheelchair area at the bleachers.	\$0000000	\$ 275	\$ 275
Sink:	Provide knee clearance under the rest room sink.	\$0000000	\$ 400	\$ 400
Water Closets:	Replace toilets in the rest rooms and install grab bars.	\$ 800	\$ 200	\$ 1000
Lavatories and Mirrors:	Lower mirrors in the rest rooms.	\$0000000	\$ 75	\$ 75
	Relocate exposed water pipes under the rest room sinks.	\$0000000	\$ 150	\$ 150
Shower Stalls:	Replace shower stalls to provide accessibility and proper seats, grab bars and controls.	\$0000000	\$000000	\$000000
	Totals	\$ 1300	\$ 3525	\$ 4825

BUILDING NUMBER: 4670 BUILDING LOCATION: Police Dept./Beach Station
700 Bayway

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Routes:	Provide a ramp to the rear dock.	\$0000000	\$000000	\$000000
	Provide elevator or ramps to floor above parking.	\$0000000	\$000000	\$000000
Stairs:	Replace handrails on stairs to rear entrance.	\$0000000	\$000000	\$000000
	Replace handrails on stairs for main entrance.	\$0000000	\$000000	\$000000
Doors:	Lower threshold to main entrance.	\$0000000	\$000000	\$000000
Counter:	Lower main counter and provide a 36" x 36" area.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide accessible stalls and grab bars in both rest rooms.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in both rest rooms.	\$0000000	\$000000	\$000000
Sinks:	Provide proper knee clearance under sinks in both rest rooms.	\$0000000	\$000000	\$000000
Mirrors:	Lower mirrors in both rest rooms.	\$0000000	\$000000	\$000000
Alarms:	Provide a visual alarm system.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace shower stall in men's rest room with proper clearance and controls.	\$0000000	\$000000	\$000000
Telephone:	Install phone at bottom of stairs.	\$0000000	\$ 400	\$ 400
	Totals	\$0000000	\$ 400	\$ 400

BUILDING NUMBER: 4675BUILDING LOCATION: Police Dept./Greenwood
1310 N. Greenwood Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 70	\$ 70
Counters:	Lower main counter and provide a 36" X 36" area.	\$0000000	\$000000	\$000000
Doors:	Provide 32" wide door openings for the main entrance, computer room, hallway door and rest rooms.	\$0000000	\$ 1000	\$ 1000
	Provide level firm area in front of rear doorway and the rest rooms.	\$0000000	\$ 600	\$ 600
Water Closets:	Replace toilets in the rest rooms and provide grab bars.	\$ 560	\$ 180	\$ 740
Lavatories and Mirrors:	Lower mirrors in the rest rooms.	\$0000000	\$ 75	\$ 75
	Relocate exposed water pipes under the rest room sinks.	\$0000000	\$ 50	\$ 50
Water Fountains:	Replace the fountain.	\$ 450	\$ 150	\$ 600
	Totals	\$ 1010	\$ 2125	\$ 3135

BUILDING NUMBER: 4800 BUILDING LOCATION: Public Service/Admin.
1650 Arcturas Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Curb Ramp:	Provide a ramp from the parking access aisle to the main walkway and for the rear entrance.	\$0000000	\$000000	\$000000
Doors:	Provide 32" wide door opening for the swinging door of the main counter.	\$0000000	\$000000	\$000000
Water Fountains:	Replace fountains in the lobby.	\$0000000	\$000000	\$000000
Counters:	Lower map room counter and provide 36" X 36" areas at map room and front counters.	\$0000000	\$000000	\$000000
Doors:	Adjust door opening force on rest room doors.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sinks in the rest rooms and kitchen.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under the rest room sinks.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and grab bars.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 4810BUILDING LOCATION: Public Service/Motor Shop
1650 Arcturas Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Curb Ramp:	Provide a ramp for the main entrance and level the area into main garage.	\$0000000	\$000000	\$000000
Doors:	Lower threshold at entrance to main garage.	\$0000000	\$000000	\$000000
Water Fountains:	Replace fountains in the shop.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sinks in the shop.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under the rest room sinks.	\$0000000	\$000000	\$000000
	Lower mirror over sink in the shop.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in the rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and grab bars.	\$0000000	\$000000	\$000000
Urinals:	Lower urinals in the rest rooms.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace stalls in each rest room to provide accessibility and proper seats, controls and grab bars.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 4820BUILDING LOCATION: Public Service/Super. Bld
1650 Arcturas Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Curb Ramp:	Provide a level area at main entrance curb ramp.	\$0000000	\$000000	\$000000
Doors:	Lower threshold at main and rear doors.	\$0000000	\$000000	\$000000
	Adjust opening force for main entrance and rest room doors.	\$0000000	\$000000	\$000000
Water Fountains:	Lower fountain near vending machines.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide 32" wide openings.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace stalls to provide accessibility and proper seats, grab bars and controls.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 4830BUILDING LOCATION: Public Service/Meter Shop
1650 Arcturus Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Doors:	Lower threshold at south exit, paint room and main entrance.	\$0000000	\$000000	\$000000
	Provide 32" wide door opening at main entrance.	\$0000000	\$000000	\$000000
Curb Ramp:	Provide a ramp for the main entrance and paint room walkways.	\$0000000	\$000000	\$000000
Water Fountains:	Replace fountains in the shop and kitchen.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sinks in the shop and kitchen.	\$0000000	\$000000	\$000000
Mirrors:	Lower mirrors in rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and grab bars.	\$0000000	\$000000	\$000000
Urinals:	Lower urinals in the rest rooms.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 4840

BUILDING LOCATION: Public Service/Machine
1650 Arcturas Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
		Totals \$0000000	\$000000	\$000000
		(Employees Only - No Public Access)		

BUILDING NUMBER: 4900BUILDING LOCATION: Purchasing Bldg.
711 Maple Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide ramp for main entrance and rear garage door. Lower threshold on door to graphics.	\$0000000	\$ 3000	\$ 3000
	Provide 32" wide doors for the lounge, rear of garage and rest rooms.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide a clear walkway to the main entrance.	\$0000000	\$ 6000	\$ 6000
Drinking Fountain:	Replace the fountain in the purchasing office.	\$0000000	\$ 650	\$ 650
Water Closets:	Replace toilets in all rest rooms and install grab bars.	\$0000000	\$ 6750	\$ 6750
Sinks:	Provide proper knee clearance under sinks in rest rooms.			
Dispensers:	Lower paper towel dispensers in all rest room.			
Lavatories & Mirrors:	Lower mirrors in all rest rooms.			
	Relocate exposed water pipes under sink in graphic communications rest room.			
Stairs:	Replaces stairs and handrails to second floor records storage area.	\$0000000	\$ 300	\$ 300
Counters & Desks:	Provide Counters, desks and tables throughout the building that provide proper knee clearance and heights.	\$0000000	\$ 500	\$ 500
Sinks:	Provide proper knee clearance under sink in garage.	\$0000000	\$000000	\$000000
Drinking Fountain:	Replace the fountain in the garage.	\$0000000	\$000000	\$000000
	Totals	\$0000000	\$ 17200	\$ 17200

BUILDING NUMBER: 4910BUILDING LOCATION: Purchasing/Storage
711 Maple Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Lower threshold for door inside storage building.	\$0000000	\$000000	\$000000
Stairs:	Raise handrails on stairs to dock.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide ramp to dock and storage area.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
		(Employees Only - No Public Access)		

BUILDING NUMBER: 5000BUILDING LOCATION: Ray Green Field
801 N. Greenwood Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs near complex and playground.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide walkways to street, rest rooms, bleachers, drinking fountains, playground and utility building.	\$0000000	\$ 6000	\$ 6000
Assembly Areas:	Provide wheelchair areas near bleachers.	\$0000000	\$ 300	\$ 300
Ground Surface:	Provide accessible surface.	\$0000000	\$000000	\$000000
Drinking Fountains:	Replace 1 fountain.	\$ 500	\$ 150	\$ 650
Doors:	Provide ramp to rest rooms.	\$0000000	\$ 5000	\$ 5000
Toilet Stalls:	Provide accessible stalls in both rest rooms and install grab bars.			
Water Closets:	Replace toilets in both rest rooms.			
Sinks:	Lower sinks in both rest rooms. Relocate exposed water pipes under sinks in both rest rooms.			
Totals		\$ 500	\$ 11450	\$ 11950

BUILDING NUMBER: 5005BUILDING LOCATION: Recreation Facilities Office
509 Pennsylvania Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible space and signs.	\$0000000	\$000000	\$000000
Stairs:	Provide stairs with handrails to dock.	\$0000000	\$000000	\$000000
Doors:	Lower threshold to supervisors office and mower storage area.	\$0000000	\$000000	\$000000
	Provide clear opening to rest room doors.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under kitchen and utility sinks.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide accessible stall in rest room.	\$0000000	\$000000	\$000000
Urinal:	Lower urinal.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace existing shower stall and provide seat and proper controls.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 5010BUILDING LOCATION: Ross Norton Pool
1440 S. Greenwood Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Raise existing signs.	\$0000000	\$ 70	\$ 70
Doors:	Lower thresholds for the entrance, office, locker room, filter room, and chlorine room doors.	\$ 100	\$ 163	\$ 263
Counters:	Lower door counters in the office.	\$ 300	\$ 260	\$ 560
Sinks:	Provide clear floor space and relocate exposed water pipes for office sink.	\$ 50	\$ 100	\$ 150
	Relocate exposed water pipes in both rest rooms.	\$ 100	\$ 460	\$ 560
Reach Limits:	Lower paper towel dispensers in both rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide 32" wide doors for stalls in both rest rooms.	\$0000000	\$000000	\$000000
	Provide grab bars in both rest rooms.	\$ 180	\$ 132	\$ 312
Shower Stalls:	Provide accessible shower stalls in both locker with proper controls.	\$ 300	\$ 336	\$ 636
	Provide shower unit with hose for outside showers.	\$ 300	\$ 136	\$ 436
	Totals	\$ 1330	\$ 1657	\$ 2987

BUILDING NUMBER: 5015BUILDING LOCATION: Ross Norton Park
1440 S. Greenwood Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkways to both ball fields, bleachers, scorer's tables, picnic tables, pool bldg., main bldg., playground and basketball courts.	\$0000000	\$ 12380	\$ 12380
Assembly Areas:	Provide wheelchair areas for bleachers.	\$0000000	\$ 495	\$ 495
Water Fountains:	Replace fountains at main bldg. and ball fields.	\$0000000	\$ 1000	\$ 1000
Ground Surface:	Replace surface in playground area.	Part of Accessible Route Cost		
Doors:	Provide ramps for the doors on the north, south, east and main entrances of the main bldg.		"	
	Provide 32" wide doors for main entrance and office.	\$0000000	\$ 286	\$ 286
Toilet Stalls:	Provide 32" wide doors leading into rest rooms.	\$0000000	\$ 5000	\$ 5000
	(Complete Remodel)			
	Provide accessible stalls and grab bars in both rest rooms.			
Lavatories and Mirrors:	Lower mirrors in both rest rooms.			
	Relocate exposed water pipes and provide proper knee clearance under sinks in both rest rooms.			
Sinks:	Provide knee clearance under utility and kitchen sinks.	\$0000000	\$ 1400	\$ 1400
Counters:	Lower counters in kitchen and activities room.	\$0000000	\$ 2300	\$ 2300
Totals		\$0000000	\$ 24083	\$ 24083

BUILDING NUMBER: 5017

BUILDING LOCATION: Ross Norton P.A.L.
1440 S. Greenwood Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Totals		\$000000	\$000000	\$000000
(Employees Only - No Public Access.)				

BUILDING NUMBER: 5020BUILDING LOCATION: Safety Village
1150 Lakeview

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible space and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide ramps from parking to stairs, from sidewalk to rest rooms and from streets to sidewalks within the safety village.	\$0000000	\$ 465	\$ 465
	Clear accessible routes along sidewalks.	\$0000000	\$ 200	\$ 200
	Provide walkway to the Safety S.V. House.	\$0000000	\$ 300	\$ 300
Drinking Fountains:	Replace 2 fountains and provide clear floor space.	\$0000000	\$ 650	\$ 650
Doors:	Lower threshold to rest room doors.	\$0000000	\$ 100	\$ 100
	Replace doors to rest rooms with wider doors.	\$0000000	\$ 300	\$ 300
Water Closet:	Install new toilets in both rest rooms.	\$0000000	\$ 200	\$ 200
Lavatories:	Provide knee clearance at rest room sinks.	\$0000000	\$ 68	\$ 68
	Relocate exposed water pipes under rest room sinks.	\$0000000	\$ 125	\$ 125
Totals		\$0000000	\$ 2548	\$ 2548

BUILDING NUMBER: 5025BUILDING LOCATION: Sailing Center
1001 Gulf Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs	\$0000000	\$000000	\$000000
	Provide Access aisle from parking to curb ramp.	\$0000000	\$000000	\$000000
Ramp:	Provide handrails for both sides of entrance ramp.	\$0000000	\$000000	\$000000
Telephone (1st Fl):	Lower existing phone and install hearing aid compatible device with volume control.	\$0000000	\$000000	\$000000
Stairs:	Adjust height of handrails of rear stairs.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Renovations Completed.)				

BUILDING NUMBER: 5030BUILDING LOCATION: Sand Key Bathroom Bldg
Clearwater Pass

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkway to rest rooms from sidewalk, parking, toll booth and bridge tender booth.	\$0000000	\$ 1000	\$ 1000
Toilet Stalls:	Provide accessible stalls in both rest rooms and install grab bars.	\$0000000	\$ 2500	\$ 2500
Lavatories and Mirrors:	Lower paper towel dispenser in both rest rooms.	\$0000000	\$ 20	\$ 20
	Relocate exposed water pipes under sinks in both rest rooms.	\$0000000	\$ 175	\$ 175
	Totals	\$0000000	\$ 3695	\$ 3695

BUILDING NUMBER: 5035BUILDING LOCATION: Sand Key Bridge Tender
Clearwater Pass

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide passage between walkway and doorway to booth.	\$0000000	\$000000	\$000000
	Provide wheelchair access to bottom floor.	\$0000000	\$000000	\$000000
Stairs:	Replace stairs.	\$0000000	\$000000	\$000000
	Adjust height of handrail to lower floor.	\$0000000	\$000000	\$000000
Toilet:	Provide proper floor space in front of toilet.	\$0000000	\$000000	\$000000
Sink:	Relocate exposed water pipes under sink on lower level.	\$0000000	\$000000	\$000000
	Provide clear floor space in front of sink.	\$0000000	\$000000	\$000000
Counters:	Provide knee clearance at bridge control counter.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000

NOT REQUIRED UNDER SECTION 4.1.1 (5) B

BUILDING NUMBER: 5040 BUILDING LOCATION: Sand Key Toll Booth
Clearwater Pass

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Routes:	Provide walkways from toll booth to rest rooms and employee parking.	\$0000000	\$ 2864	\$ 2864
Space Allowance:	Expand the size of the toll booth.	\$0000000	\$ 4000	\$ 4000
Doors:	lower thresholds to the toll booth door and the entrance of the 950 building.	\$ 20	\$ 130	\$ 150
	Provide 32" wide door to the toll booth.	\$0000000	\$000000	\$000000
Telephone:	Provide 32" wide door to phone booth and proper clear floor space.	\$0000000	\$000000	\$000000
	Provide volume control and hearing aid compatibility.	\$0000000	\$000000	\$000000
Drinking Fountains:	Lower fountain in the 950 building and provide proper floor space.	\$ 450	\$ 102	\$ 552
Water Closets:	Replace toilet and provide clear floor space in front of toilet in the 950 building.	\$0000000	\$ 3000	\$ 3000
Doors:	Provide 32" wide door to rest room.			
Lavatories and Mirrors:	Relocate exposed water pipes under sink in the rest room.			
	Totals	\$ 470	\$ 10096	\$ 10566

BUILDING NUMBER: 5045BUILDING LOCATION: Seminole Docks
End of Seminole Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 350	\$ 350
	Totals	\$0000000	\$ 350	\$ 350

BUILDING NUMBER: 5050BUILDING LOCATION: Seminole Boat Ramp
Seminole Street/W. End

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkways to picnic table and water fountain near boat ramp.	\$0000000	\$ 500	\$ 500
Drinking Fountains:	Replace fountain.	\$ 500	\$ 204	\$ 704
	Totals	\$ 500	\$ 704	\$ 1204

BUILDING NUMBER: 5055BUILDING LOCATION: Shuffleboard Club
1020 Calumet Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide 2 additional spaces and signs.	\$0000000	\$ 280	\$ 280
Accessible Route:	Provide ramp to scorers table in tournament room.	\$0000000	\$ 300	\$ 300
Doors:	Provide 32" wide door for tournament booth, main entrance, rest rooms, inside courts and west exit.	\$0000000	\$ 5900	\$ 5900
	Lower threshold to kitchen door and players equipment room.	\$0000000	\$ 450	\$ 450
Entrances:	Level areas in front of main entrance and west door.	\$0000000	\$ 1618	\$ 1618
Counters:	Lower counters in main room and kitchen.	\$0000000	\$ 1400	\$ 1400
Sinks:	Provide proper knee clearance under sinks in the kitchen and rest rooms.	\$0000000	\$ 800	\$ 800
Water Fountains:	Replace fountain near courts.	\$0000000	\$ 650	\$ 650
Toilet Stalls:	Provide accessible stall in both rest rooms.	\$0000000	\$ 1000	\$ 1000
Water Closets:	Lower existing grab bars and provide additional bars behind toilets.	\$0000000	\$ 100	\$ 100
Lavatories and Mirrors:	Lower mirrors and paper towel dispensers in both rest rooms.	\$0000000	\$ 68	\$ 68
	Relocate exposed water pipes located under rest room sinks.	\$0000000	\$ 130	\$ 130
Tournament Booth:	Provide 32" wide door to for tournament booth.	\$0000000	\$ 350	\$ 350
	Totals	\$0000000	\$ 13046	\$ 13046

BUILDING NUMBER: 5060BUILDING LOCATION: Sid Lickton Field
714 N. Saturn Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide walkways to all fields and bleachers.	\$0000000	\$ 30000	\$ 30000
	Provide walkway to picnic area near field #7.			
	Provide access to second floor of pressbox.			
Doors:	Lower threshold to equipment room at field #5 and pressbox at field #3.			
Stairs:	Raise handrail for stairs field #3 pressbox.	\$0000000	\$000000	\$000000
Assembly Area:	Provide wheelchair areas at all ballfields.	\$0000000	\$000000	\$000000
Drinking Fountain:	Replace 7 fountains.	\$0000000	\$ 4900	\$ 4900
	Totals	\$0000000	\$ 34900	\$ 34900

BUILDING NUMBER: 5065BUILDING LOCATION: Sign Shop/Traffic Eng.
410 N. Myrtle Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide a ramp for main entrance and door to the garage.	\$0000000	\$000000	\$000000
	Lower threshold for door between office and garage.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under the utility sink in the rest room.	\$0000000	\$000000	\$000000
Counters and Desks:	Provide desks and counters with proper knee clearance in the office.	\$0000000	\$000000	\$000000
Urinals:	Relocate sink or urinal.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace shower stall and controls in the employee rest room.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only - No Public Access)

BUILDING NUMBER: 5070BUILDING LOCATION: Solid Waste/Recycle
1180 Russell Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Routes:	Provide ramp into the recycle trailer.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds at door to recycle trailer.	\$0000000	\$000000	\$000000
Sink:	Provide knee clearance under sink in trailer.	\$0000000	\$000000	\$000000
Water Closet:	Install new toilets in the rest rooms.	\$0000000	\$000000	\$000000
Doors:	Provide 32" wide door openings for rest room.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide accessible stalls with proper clearance and grab bars in the rest room.	\$0000000	\$000000	\$000000
Lavatories and Mirrors:	Relocate exposed water pipes under sink in rest room.	\$0000000	\$000000	\$000000
	Lower mirror in rest room.	\$0000000	\$000000	\$000000
Dispensers:	Lower Paper towel dispenser in rest room.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 5075BUILDING LOCATION: Solid Waste Division
1180 Russell Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Accessible Route:	Provide a ramp to trailer.	\$0000000	\$000000	\$000000
Water Closet:	Provide grab bars in rest room of trailer.	\$0000000	\$000000	\$000000
Lavatories and Mirrors:	Relocate exposed water pipes under sink in trailer rest room.	\$0000000	\$000000	\$000000
	Lower mirror in trailer rest room.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispenser in trailer rest room.	\$0000000	\$000000	\$000000
Drinking Fountains:	Replace fountain in trailer.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds at doors to the operations building.	\$0000000	\$000000	\$000000
	Provide 32" wide door openings for entrance between operations and break rooms and entrance to the women's rest room in the operations area.	\$0000000	\$000000	\$000000
	Provide ramp at doorway to administration area.	\$0000000	\$000000	\$000000
Drinking Fountains:	Replace fountain in operations area.	\$0000000	\$000000	\$000000
Fixed Tables:	Replace tables in the operations break room.	\$0000000	\$000000	\$000000
Stairs:	Provide handrails on both sides of stairs to the trailer.	\$0000000	\$000000	\$000000
Water Closet:	Install new toilets in the operations rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide an accessible stall with proper clearance and grab bars in each of the operations rest rooms.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 5075 BUILDING LOCATION: Solid Waste Division
1180 Russell Street

Dispensers:	Lower paper towel dispenser in operations rest rooms.	\$0000000	\$000000	\$000000
Lavatories and Mirrors:	Relocate exposed water pipes under sink in operations rest rooms.	\$0000000	\$000000	\$000000
	Lower mirror in operations rest room.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under rest room sinks in the operations area.	\$0000000	\$000000	\$000000
Shower Stalls:	Provide accessible stall with proper clearances, controls and seats in each of the operations rest rooms.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Employees Only- No Public Access)

BUILDING NUMBER: 5090BUILDING LOCATION: Station Square Park
620 Cleveland Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Dining Areas:	Provide accessible seating at tables for wheelchairs and proper signage.	\$0000000	\$ 300	\$ 300
Drinking Fountains:	Replace fountain.	\$ 500	\$ 272	\$ 772
	Totals	\$ 500	\$ 572	\$ 1072

BUILDING NUMBER: 6005BUILDING LOCATION: Tennis Complex/Beach
Mandalay and Eldorado

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Route:	Provide curb ramp for access from parking lot.	\$ 44	\$ 409	\$ 453
Drinking Fountains:	Replace fountain near courts.	\$0000000	\$ 44	\$ 44
	Totals	\$ 44	\$ 453	\$ 497

BUILDING NUMBER: 7000BUILDING LOCATION: Transfer Station/Trailers
1005 Coachman Road

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Stairs:	Replace stairs and handrails for trailer.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide a ramp for the trailer entrance.	\$0000000	\$000000	\$000000
Drinking Fountain:	Replace the fountain.	\$0000000	\$000000	\$000000
Doors:	Replace threshold to shed in trailer area.	\$0000000	\$000000	\$000000
	Totals	\$0000000	\$000000	\$000000

(Employees Only - No Public Access)

BUILDING NUMBER: 7010BUILDING LOCATION: Transfer Station/Scale House
1005 Coachman Road

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide 32" wide door to the rest room.	\$0000000	\$000000	\$000000
	Provide a ramp for the front entrance.	\$0000000	\$000000	\$000000
	Lower the counter on the office door.	\$0000000	\$000000	\$000000
Drinking Fountain:	Replace the fountain.	\$0000000	\$000000	\$000000
Tables:	Provide proper knee clearance for desk in office and outside picnic table.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilet and install grab bars.	\$0000000	\$000000	\$000000
	Provide clear floor space around toilet.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispensers.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 7020BUILDING LOCATION: Transfer Station
1005 Coachman Road

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide a ramp to the entrance for the utility shed and to the operation room.	\$0000000	\$000000	\$000000
	Lower threshold to the rest room.	\$0000000	\$000000	\$000000
Reach Ranges:	Lower control panel in operation room.	\$0000000	\$000000	\$000000
Urinal:	Lower urinal.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispenser in rest room.	\$0000000	\$000000	\$000000
Toilet stalls:	Provide accessible stalls in the rest room.	\$0000000	\$000000	\$000000
Lavatories and Mirrors:	Lower mirrors in the rest room.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under the sink in the rest room.	\$0000000	\$000000	\$000000
Drinking Fountain:	Replace the fountain in the rest room.	\$0000000	\$000000	\$000000
Totals		\$0000000	\$000000	\$000000
(Employees Only - No Public Access)				

BUILDING NUMBER: 7200BUILDING LOCATION: Turner Street Dock
Turner Street/West End

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible space and signs.	\$0000000	\$ 70	\$ 70
Accessible Route:	Provide ramp to dock.	STRUCTURALLY IMPRACTICAL		
	Provide walkways to picnic bench and street.		"	
Stairs:	Adjust height of handrails.		"	
Totals		\$0000000	\$ 70	\$ 70

BUILDING NUMBER: 7210BUILDING LOCATION: U.S. 19 Soccer Field
Frontage Rd./60 & Drew

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide a walkway from the parking area.	\$0000000	\$ 3500	\$ 3500
	Totals	\$0000000	\$ 3640	\$ 3640

BUILDING NUMBER: 7220BUILDING LOCATION: Utilities Building
900 Chestnut Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide two more accessible spaces and proper signs.	\$0000000	\$ 200	\$ 200
Accessible Routes:	Provide access to second floor for a person in a wheel chair.	\$0000000	\$000000	\$000000
	Provide walkway to picnic table on east side.	\$0000000	\$ 135	\$ 135
	Provide 36" clear access areas in hallway between finance and customer service, hallway by drive-in cashier and second floor men's room.	\$0000000	\$000000	\$000000
	Relocate chairs in front of customer service windows.	\$0000000	\$ 150	\$ 150
Ramps:	Provide ramps to parking on the northeast side.	\$0000000	\$ 300	\$ 300
	Provide ramps for steps to entrance on Prospect Street and at entrance of south offices.	\$0000000	\$ 1200	\$ 1200
	Provide ramp at threshold to drive-in window doorway. Street and at entrance of south offices.	\$0000000	\$000000	\$000000
Alarms:	Provide a visual alarm system.	\$0000000	\$ 800	\$ 800
Doors:	Lower thresholds to entrance on Prospect, east entrance and employee entrance.	\$0000000	\$ 150	\$ 150
	Provide 32" wide door openings for customer service, rest rooms, finance storage room, second floor copy room, administration conference room, second floor switch room, second floor storage room and second floor women's room between the powder room and the stalls.	\$0000000	\$ 2500	\$ 2500

BUILDING NUMBER: 7220BUILDING LOCATION: Utilities Building
900 Chestnut Street

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Water Fountains:	Replace fountain near the first floor rest rooms.	\$ 500	\$ 150	\$ 650
Counters:	Provide 36" X 36" areas for the counter at customer service and at the counter of the first floor cashiers office.	\$0000000	\$ 1500	\$ 1500
	Provide knee clearance under the tables in the meter readers break room.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sinks in the second floor utility room and the kitchen.	\$0000000	\$000000	\$000000
	Provide clear floor space in front of the sink in the first floor rest room.	\$0000000	\$000000	\$000000
Stairs:	Provide handrails for the east side stairway that are continuous and of the proper height.	\$0000000	\$ 350	\$ 350
Water Closets:	Replace toilets in each rest room.	\$0000000	\$ 6000	\$ 6000
	Provide clear floor space in the second floor administration rest rooms and install grab bars.			
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and proper grab bars.			
Lavatories & Mirrors:	Lower mirrors in all rest rooms.			
	Relocate exposed water pipes under sinks in all rest rooms.			
Dispensers:	Lower paper towel dispensers in all rest rooms.			
Urinals:	Lower urinals in all men's rest rooms.			
	Totals	\$ 500	\$ 13435	\$ 13935

BUILDING NUMBER: 7230BUILDING LOCATION: Utilities Annex Bldg.
401 S. Prospect St.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Routes:	Widen walkway on north side of building.	\$0000000	\$ 550	\$ 550
Curb Ramps:	Provide ramp at intersection of walkways on north and west sides.	\$0000000	\$ 818	\$ 818
Doors:	Lower thresholds for main entrance and single entrance facing prospect street.	\$0000000	\$ 425	\$ 425
	Provide 32" wide door openings for doors on rear porch, rear single door, eight interior doors and three rest room doors.	\$0000000	\$ 6500	\$ 6500
Stairs:	Provide handrails on both sides of two sets of stairs.	\$0000000	\$ 600	\$ 600
Curb Ramp:	Provide curb ramp to parking area.	\$0000000	\$ 409	\$ 409
Ramp:	Replace ramp at rear single door.	\$0000000	\$ 700	\$ 700
Sinks:	Provide knee clearance under kitchen sink.	\$0000000	\$ 937	\$ 937
Water Closet:	Install new toilets in the rest rooms.	\$0000000	\$ 6000	\$ 6000
	Provide clear floor space in rest rooms.			
	Install grab bars in rest rooms.			
Lavatories and Mirrors:	Relocate exposed water pipes under sinks in each rest rooms.			
	Lower mirrors in each rest rooms.			
Bathtubs:	Provide accessible bathtubs in each rest room.			
	Totals	\$0000000	\$ 17079	\$ 17079

BUILDING NUMBER: 7240BUILDING LOCATION: Valencia Park
2100 N. Hercules Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide walkways to parking lot, basketball courts, tennis courts and playground.	\$0000000	\$ 11000	\$ 11000
	Totals	\$0000000	\$ 11140	\$ 11140

BUILDING NUMBER: 7500BUILDING LOCATION: Wood Valley Park
2816 Park Trail Lane

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Curb Ramps:	Provide ramps from street to entrance walkway, rear doors, poolroom exit to patio and to rear patio walkway.	\$0000000	\$ 450	\$ 450
Accessible Routes:	Provide walkway to tennis courts, basketball courts, playground and ball field.	\$0000000	\$ 3300	\$ 3300
	Widen walkway around building to 36".	\$0000000	\$ 2200	\$ 2200
Assembly Area:	Provide wheelchair area for bleachers.	\$0000000	\$ 275	\$ 275
Doors:	Lower threshold on the front entrance.	\$0000000	\$000000	\$000000
Ground Surfaces:	Replace wood chips in the playground with a firm surface.	\$0000000	\$000000	\$000000
Water Fountains:	Clear floor area around fountain.	\$0000000	\$ 100	\$ 100
Sinks:	Relocate sink in women's rest room.	\$0000000	\$ 150	\$ 150
Toilet Stalls:	Replace stalls to provide accessibility and proper grab bars.	\$ 800	\$ 200	\$ 1000
Urinals:	Lower urinals in the men's rest room.	\$0000000	\$ 250	\$ 250
Lavatories:	Provide knee clearance under the rest room sinks.	\$0000000	\$ 500	\$ 500
Totals		\$ 800	\$ 7425	\$ 8225

BUILDING NUMBER: 7510BUILDING LOCATION: Woodgate Park
2495 Countryside Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible space and signs.	\$0000000	\$ 140	\$ 140
Accessible Route:	Provide walkway to basketball courts.	\$0000000	\$ 1200	\$ 1200
	Provide curb ramp for walkway into parking lot.	\$0000000	\$ 409	\$ 409
Doors:	Lower threshold to rest rooms and drinking fountain.	\$0000000	\$ 350	\$ 350
Drinking Fountain:	Relocate water fountain.	\$ 450	\$ 168	\$ 618
Toilet Stalls:	Provide larger stalls in both rest rooms and install grab bars.	\$0000000	\$ 1000	\$ 1000
Water Closet:	Replace toilets in both rest rooms.	\$0000000	\$ 600	\$ 600
Sinks:	Provide knee clearance under sinks in both rest rooms.	\$0000000	\$ 1000	\$ 1000
	Relocate exposed water pipes under rest room sinks.	\$0000000	\$ 500	\$ 500
Totals		\$ 450	\$ 5367	\$ 5817

BUILDING NUMBER: 1st Floor BUILDING LOCATION: City Hall Annex
10 S. Missouri Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Raise existing signs.	\$0000000	\$ 700	\$ 700
Signage:	Relocate ramp sign on south side of building.	\$ 20	\$ 25	\$ 55
Curb Ramps:	Provide Ramp to the entrances in front of the credit union.	\$0000000	\$ 409	\$ 409
	Replace curb ramps to the auditorium and walkway on the southeast side of the building.	\$0000000	\$ 500	\$ 500
Telephone:	Replace phone at main entrance with one that is hearing aid compatible with volume control.	\$0000000	\$000000	\$000000
Ramps:	Replace ramps to parking lot, computer room in C.I.S., computer room in Traffic Engineering and the signal shop.	\$0000000	\$ 2000	\$ 2000
	Provide ramps to side entrance of C.I.S., generator room and door with two steps in C.I.S.	\$0000000	\$000000	\$000000
	Provide handrails for ramp to picnic tables on north side.	\$0000000	\$ 150	\$ 150
Curb Ramps:	Provide curb ramps for top and bottom of stairs at the rear of the building, C.I.S. training room and rear dock door.	\$0000000	\$ 1300	\$ 1300
Alarms:	Provide a visual alarm system.	\$0000000	\$ 4000	\$ 4000
Doors:	Adjust door opening force on main entrance doors.	\$0000000	\$ 150	\$ 150
	Lower thresholds to signal shop, C.I.S. offices, C.I.S. Training, Credit Union, door to picnic area and south side door to the auditorium.	\$0000000	\$ 1000	\$ 1000

BUILDING NUMBER: 1st Floor BUILDING LOCATION: City Hall Annex
10 S. Missouri Ave.

Doors:	Provide 32" wide door openings for C.I.S. Computer room, entrance to Parks And Recreation, rear exit to Public Works Engineering, C.I.S. Training room, offices off hallway, from Engineering Offices, inside doors to the auditorium, main entrance and woman's rest room in the auditorium.	\$0000000	\$ 7720	\$ 7720
Assembly Areas:	Provide Accessible route to stage.	\$0000000	\$ 850	\$ 850
Stairs:	Provide handrails for stairs to the dock, adjacent to the dock, at the rear of the building and second floor storage in Parks and Recreation. Replace stairs to storage areas in Traffic Engineering and Parks and Recreation.	\$0000000	\$ 1950	\$ 1950
Sinks:	Provide knee clearance under sinks in C.I.S. kitchen, Parks & Rec. break room, Public Works, Engineering, Traffic Eng. break room, Traffic Eng. coffee room, employee break room near auditorium and in nurse's office.	\$0000000	\$ 1250	\$ 1250
Counters:	Lower counter and provide a 36" X 36" area for Parks and Rec. entrance, Public Works reception, Credit Union, Payroll, Public Works offices, Engineering, Code Enforcement, Planning Directors Office, Planning Managers Office and Community Development. Provide knee clearance and/or lower counters for Public Works microfilm area, Atlas Area, Drafting, Credit Union Offices, Door to Payroll, door to Risk Management, door to Nurses Office, Men's room, Engineering plan review, Code Enforcement's Staff Assistant, Code Enf. kitchen and Planning mail room.	\$0000000	\$ 5650	\$ 5650

BUILDING NUMBER: 1st Floor BUILDING LOCATION: City Hall Annex
10 S. Missouri Ave.

Seating:	Replace desks and tables Throughout C.I.S., Credit Union, Picnic Area, Engineering, Building Permit Office and Plans Review.	\$0000000	\$ 1200	\$ 1200
Water Fountains:	Lower fountains and provide clear floor space in Parks & Rec. break room, Engineering, Traffic Eng. and the Signal Shop.	\$0000000	\$0000000	\$0000000
	Replace the fountain by the auditorium rest rooms.	\$0000000	\$ 650	\$ 650
Accessible Routes:	Provide proper clearance behind Parks & Rec. main counter, around desks in Parks & Rec., in rear hall of Public Works Engineering, by counters and desks in the Credit Union, near copy machine in payroll, inside men's rest room, inside women's rest rooms, Offices in Community Development and hallway between C.I.S. and the main hallway.	\$0000000	\$ 2000	\$ 2000
Reach Ranges:	Lower Applications and Forms Counter.	\$0000000	\$ 300	\$ 300
Water Closets:	Replace toilets in each rest room.	\$ 200	\$ 150	\$ 350
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and proper grab bars.	\$0000000	\$ 1864	\$ 1864
Urinals:	Lower urinals in all men's rest rooms.	\$0000000	\$ 300	\$ 300
Lavatories & Mirrors:	Lower mirrors in all rest rooms and the Parks and Recreation break room.	\$0000000	\$ 500	\$ 500
	Relocate exposed water pipes under sinks in the auditorium rest rooms.	\$0000000	\$ 300	\$ 300
Sinks:	Provide knee clearance under all rest room sinks.	\$0000000	\$ 1100	\$ 1100
Dispensers:	Lower paper towel dispensers in the nurses office and woman's rest room.	\$0000000	\$ 150	\$ 150
	Totals	\$ 200	\$ 36198	\$ 36398

BUILDING NUMBER: 2nd Floor BUILDING LOCATION: City Hall Annex
10 S. Missouri Ave.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Stairs:	Replace handrails to both sets of stairs to the second floor.	\$0000000	\$ 450	\$ 450
Doors:	Provide 32" wide door openings for Building and Maintenance counter door, both supervisors offices, to time clock area, both rest rooms, old Assistant Superintendents Office, Secretaries Office, Secretaries Lounge, File room, office next to the break room, locker room and to shower stall.	\$0000000	\$000000	\$000000
Counters/Desks:	Provide 36" X 36" area at main counter.	\$0000000	\$000000	\$000000
	Lower counter on door to Secretaries Office.	\$0000000	\$000000	\$000000
	Replace desks and tables Throughout Building and Maintenance.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under utility sink in men's rest room.	\$0000000	\$000000	\$000000
Shower Stalls:	Replace shower stalls in both rest rooms to provide proper accessibility, chairs and controls.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and proper grab bars.	\$0000000	\$000000	\$000000
Lavatories & Mirrors:	Lower mirrors in all rest rooms.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under sinks in both rest rooms.	\$0000000	\$000000	\$000000
Accessible Route:	Provide clear passage in front of stalls in men's rest rooms.	\$0000000	\$000000	\$000000
	Totals	\$0000000	\$ 450	\$ 450

BUILDING NUMBER: 1st Floor BUILDING LOCATION: City Hall
112 Osceola Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Accessible Routes:	Provide curb ramps to bus stop, street, sidewalk and fountain.	\$0000000	\$ 1800	\$ 1800
Ramps:	Replace rear handicap ramp and handrail.	\$0000000	\$ 1600	\$ 1600
Dining Areas:	Provide picnic table with proper knee clearance.	\$0000000	\$ 175	\$ 175
Reflecting Pools:	Provide rail around rear fountain.	\$0000000	\$ 250	\$ 250
Stairs:	Install handrails for stairs to front entrance.	\$0000000	\$ 500	\$ 500
Alarms:	Provide a visual alarm system.	\$0000000	\$ 800	\$ 800
Counters:	Lower Counter at human resources.	\$0000000	\$ 1300	\$ 1300
Drinking Fountains:	Replace fountains on first floor (6).	\$ 450	\$ 150	\$ 600
Space Allowance and Reach Range:	Provide 60" diameter clear floor space in room where applications are completed.	\$0000000	\$ 150	\$ 150
	Lower job bulletin board in human resources.	\$0000000	\$ 34	\$ 34
Sinks:	Provide knee clearance under sink in testing room.	\$0000000	\$000000	\$000000
Telephone:	Provide a hearing aid compatible public telephone.	\$0000000	\$000000	\$000000
Ramp (N. Outside):	Replace ramp.	\$0000000	\$000000	\$000000
Stairs:	Install handrails for stairs on the south side.	\$0000000	\$ 250	\$ 250
Toilet Stalls:	Replace stalls in both rest rooms.	\$0000000	\$000000	\$000000
Urinals:	Lower urinal in first floor men's room.	\$0000000	\$000000	\$000000

BUILDING NUMBER: 1st Floor BUILDING LOCATION: City Hall
112 S. Osceola Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Lavatories and Mirrors:	Lower mirrors in both rest rooms.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under rest room sinks.	\$0000000	\$000000	\$000000
Sinks:	Provide knee clearance under sink in both rest rooms.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispensers in both rest rooms.	\$0000000	\$000000	\$000000
Doors:	Level area around the rear handicap entrance.	\$0000000	\$000000	\$000000
	Adjust the opening force for the front and rear entrance doors.	\$0000000	\$ 150	\$ 150
	Provide 32" wide doors for rear entrance , front entrance, human resources, personnel, old affirmative action, intern's office, stairway,	\$0000000	\$ 12000	\$ 12000
	Lower thresholds to human resources and personnel.	\$0000000	\$000000	\$000000
Elevators:	Replace hall call buttons.	\$0000000	\$ 12000	\$ 12000
	Provide hall lanterns with visual and audible signals.			
	Provide raised and braille characters on hoistway entrance.			
	Lower car control panel.			
Counters:	Provide a 36" x 36" area on counter in personnel.	\$0000000	\$ 500	\$ 500
Totals		\$ 450	\$ 31659	\$ 32109

BUILDING NUMBER: 2nd Floor BUILDING LOCATION: City Hall
112 Osceola Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide 32" wide doors for legal dept. entrance, legal dept. room with sink, secretaries office, women's rest room, clerk's office, and asst. clerks office.	\$0000000	\$ 2500	\$ 2500
	Lower threshold to administrative support office.	\$0000000	\$000000	\$000000
	Level area around the rear handicap entrance.	\$0000000	\$000000	\$000000
	Adjust the opening force of door to administrative support office.	\$0000000	\$ 50	\$ 50
Drinking Fountains:	Replace fountains on second floor (2).	\$0000000	\$ 650	\$ 650
Counters:	Provide a 36" x 36" area at counter in the city clerks office.	\$0000000	\$ 1200	\$ 1200
Sinks:	Provide knee clearance under sink in legal department. Provide clear floor space in front of sink.	\$0000000	\$000000	\$000000
Tables:	Replace conference room table with one that provides proper knee clearance.	\$0000000	\$000000	\$000000
Toilet Stalls:	Replace stalls in both rest rooms.	\$0000000	\$ 3000	\$ 3000
Urinals:	Lower urinal in second floor men's room.			
Accessible Routes:	Provide curb ramps to bus stop, street, sidewalk and fountain.			
Water Closets:	Replace toilet in men's rest room.			
Lavatories and Mirrors:	Lower mirrors in both rest rooms.			
	Relocate exposed water pipes under rest room sinks.			

BUILDING NUMBER: 2nd Floor BUILDING LOCATION: City Hall
112 S. Osceola Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Sinks:	Provide knee clearance under sinks in men's rest room.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispensers in both rest rooms.	\$0000000	\$000000	\$000000
Space Allowance:	Provide clear passage to stalls in women's rest room.	\$0000000	\$000000	\$000000
	Totals	\$0000000	\$ 7400	\$ 7400

BUILDING NUMBER: 3rd Floor BUILDING LOCATION: City Hall
112 Osceola Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Doors:	Provide 32" wide doors for economic development office, lounge, door to commissioners seating in the commission chamber, administrative services, deputy city managers office, kitchen and the commissioners office.	\$0000000	\$ 25	\$ 25
Assembly Area:	Provide a designated wheelchair location in the commission chambers.	\$0000000	\$ 100	\$ 100
Fixed Seating:	Provide proper knee clearance under commissioners desk, computer desks in the city managers office, computer desks in the mayors office, secretaries desks in the city managers office, secretaries desk in the mayors office, conference table in the city managers office and the main counter in the city managers office.	\$ 300	\$ 1700	\$ 2000
Counters:	Lower counters in the city managers office. Provide 36" x 36" areas at the counters in the city managers office. Provide proper knee clearance under counters.	\$0000000	\$000000	\$000000
Speakers Lectern:	Lower lectern.	\$0000000	\$ 150	\$ 150
Accessible routes:	Provide ramps to the commissioners seating and conference room.	\$0000000	\$000000	\$000000
	Relocate refrigerator in the kitchen to provide clear passage.	\$0000000	\$000000	\$000000
	Relocate chairs in mayors conference room to provide clear passage.	\$ 150	\$ 850	\$ 1000
Sinks:	Provide knee clearance under sinks in lounge and city managers office.	\$0000000	\$ 600	\$ 600

BUILDING NUMBER: 3rd Floor BUILDING LOCATION: City Hall
112 S. Osceola Avenue

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Drinking Fountains:	Replace both fountains.	\$ 450	\$ 120	\$ 370
Toilet Stalls:	Replace stalls in both rest rooms.	\$000000	\$000000	\$000000
Space Allowance:	Provide clear passage to stalls in men's rest room.	\$000000	\$000000	\$000000
Urinals:	Lower urinal in third floor men's room.	\$000000	\$000000	\$000000
Water Closets:	Replace toilets in both rest room.	\$000000	\$000000	\$000000
Lavatories and Mirrors:	Lower mirrors in both rest rooms.	\$000000	\$000000	\$000000
Dispensers:	Lower paper towel dispensers in both rest rooms.	\$000000	\$000000	\$000000
Sinks:	Provide knee clearance under sinks in women's rest room	\$000000	\$000000	\$000000
	Totals	\$ 900	\$ 3545	\$ 4445

BUILDING NUMBER: _____ BUILDING LOCATION: Condon Gardens Rec. Center
2930 Sandalwood Drive

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$ 75	\$ 75
Accessible Route:	Provide walkways to the basketball courts, picnic table, playground and south side entrance.	\$0000000	\$ 8000	\$ 8000
	Provide stable surface for the playground.	\$0000000	\$000000	\$000000
Doors:	Lower threshold at the library entrance, main entrance, east library door, and meeting room exit.	\$0000000	\$ 700	\$ 700
	Provide 32" wide door openings for the office.	\$0000000	\$ 1000	\$ 1000
Curb Ramp:	Provide a ramp from parking to the library walkway and the outside door to the basketball courts.	\$0000000	\$ 800	\$ 800
Sink:	Provide knee clearance under the kitchen sink.	\$0000000	\$ 450	\$ 450
Water Fountains:	Lower fountain in pool room and clear the space around the fountain.	\$0000000	\$ 550	\$ 550
Doors:	Provide 32" wide door openings for the rest rooms.	\$0000000	\$ 1000	\$ 1000
Water Closets:	Replace toilets in the rest rooms.	\$ 200	\$ 250	\$ 450
Toilet Stalls:	Replace stalls in each rest room to provide accessibility and grab bars.	\$ 800	\$ 200	\$ 1000
Dispensers:	Lower paper towel dispensers in the rest rooms.	\$0000000	\$ 50	\$ 50
Lavatories:	Provide clear floor space and knee clearance under sinks in the rest rooms.	\$0000000	\$ 1000	\$ 1000
Totals		\$ 100	\$ 14075	\$ 15075

BUILDING NUMBER: no number BUILDING LOCATION: Island Estates Playground
Larboard Way

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs.	\$0000000	\$000000	\$000000
Accessible Route:	Provide walkway to the playground	\$0000000	\$000000	\$000000
	Totals	\$0000000	\$ 1500	\$ 1500

BUILDING NUMBER: _____ BUILDING LOCATION: Pier 60 Pavilion
10 Bay Esplanade

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Ramp:	Replace ramp at entrance to rest rooms.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide accessible stalls with proper clearance and grab bars in each rest room.	\$0000000	\$000000	\$000000
Water Closet:	Install new toilets in the rest rooms.	\$0000000	\$000000	\$000000
Lavatories:	Relocate exposed water pipes under sinks in each rest rooms.	\$0000000	\$000000	\$000000
	Provide clear floor space in each rest room.	\$0000000	\$000000	\$000000
Drinking Fountains:	replace fountain near woman's rest room.	\$0000000	\$000000	\$000000
Curb Ramp:	Provide curb ramp to dairy bar and for sidewalk in front of gift shop.	\$0000000	\$000000	\$000000
Doors:	Lower thresholds for north side door of dairy barn, door to gift shop, door between gift shop and concession stand, door from concession stand to pool, south door behind concession stand and doors to beach wear shop.	\$0000000	\$000000	\$000000
	Provide 32" wide door openings for single north side door, door to gift shop, door between gift shop and concession stand, door by time clock, doors to fitting room in beach wear shop, rest rooms in beach wear shop and office door in beach wear shop.	\$0000000	\$000000	\$000000
Fitting Rooms:	Provide proper clear floor space and benches in fitting rooms of beach wear shop.	\$0000000	\$000000	\$000000
Telephones:	Provide public phones which are hearing aid compatible and have volume control.	\$0000000	\$000000	\$000000

BUILDING NUMBER: _____ BUILDING LOCATION: Pier 60 Pavilion
10 Bay Esplanade

Counters:	Lower counters around dairy bar, at gift shop, at concession stand, behind concession stand and in beach wear shop.	\$0000000	\$000000	\$000000
	Provide 36" X 36" areas at counters in gift shop and beach wear shop.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide 36" wide aisle spaces throughout dairy bar, gift shop and concession stand.	\$0000000	\$000000	\$000000
Water Closet:	Install new toilets in beach wear employee rest room, install grab bars and clear floor space.	\$0000000	\$000000	\$000000
Sinks:	Relocate exposed water pipes under sinks in employee rest room of the beach wear shop.	\$0000000	\$000000	\$000000
	Provide clear floor space around sink in employee rest room of beach wear shop.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Rental Property - City Not Responsible For Costs)

BUILDING NUMBER: _____ BUILDING LOCATION: Clearwater Seafood Rest
37 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide accessible spaces and signs close to the restaurant.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide access to the second floor.	\$0000000	\$000000	\$000000
Doors:	Provide 32" wide doors for the rest rooms on both floors.	\$0000000	\$000000	\$000000
	Lower threshold of doorway to market.	\$0000000	\$000000	\$000000
	Level area in front of double door gate on south side.	\$0000000	\$000000	\$000000
Ramps:	Provide level landing at top of ramp leading to the market.	\$0000000	\$000000	\$000000
Stairs:	Provide handrails on both sides of stairs leading to the second floor.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide 36" wide access in aisles of second floor kitchen.	\$0000000	\$000000	\$000000
Stairs:	Provide handrails on both sides of stairs leading to bar.	\$0000000	\$000000	\$000000
Toilet Stalls:	Provide accessible stalls and grab bars for rest rooms on both floors.	\$0000000	\$000000	\$000000
Water Closets:	Replace toilets in both rest rooms on the second floor.	\$0000000	\$000000	\$000000
Urinals:	Lower urinal in men's rest room of second floor.	\$0000000	\$000000	\$000000
Lavatories and Mirrors:	Lower mirrors in rest rooms on both floors.	\$0000000	\$000000	\$000000
	Relocate exposed water pipes under the sinks in all rest rooms.	\$0000000	\$000000	\$000000
Dispensers:	Lower paper towel dispenser in each rest room.	\$0000000	\$000000	\$000000

BUILDING NUMBER: _____

BUILDING LOCATION: Clw. Seafood Rest.
37 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Sinks:	Provide knee clearance under sinks in each rest room.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Rental Property - City Not Responsible For Costs)

BUILDING NUMBER: _____ BUILDING LOCATION: Beach Diner
56 Causeway Blvd.

ELEMENT	DESCRIPTION OF WORK	MATERIAL COSTS	LABOR COSTS	TOTAL COSTS
Parking:	Provide proper signs for the existing accessible spaces.	\$0000000	\$000000	\$000000
Doors:	Provide 32" wide door openings for front door, rest rooms, Information Center, kitchen and kitchen office.	\$0000000	\$000000	\$000000
	Adjust door opening force on rest room doors.	\$0000000	\$000000	\$000000
	Provide ramp at rear door.	\$0000000	\$000000	\$000000
Curb Ramps:	Provide curb ramp from parking area.	\$0000000	\$000000	\$000000
Ramps:	Provide level landing at top of ramp leading to the rear door.	\$0000000	\$000000	\$000000
Counters:	Lower main counter and counters and tables in the kitchen and Information Office.	\$0000000	\$000000	\$000000
Built in Seating and Tables:	Provide knee clearance at booths.	\$0000000	\$000000	\$000000
Telephones:	Provide phone that is hearing aid compatible with volume control. Clear floor space around phone.	\$0000000	\$000000	\$000000
Accessible Routes:	Provide 36" wide access at passage to the rest rooms.	\$0000000	\$000000	\$000000
	Relocate pamphlet rack in the information center.	\$0000000	\$000000	\$000000
Toilet Stalls:	Relocate latches on stall doors in both rest room.	\$0000000	\$000000	\$000000
	Provide grab bars for stalls in both rest rooms.	\$0000000	\$000000	\$000000
Mirrors:	Lower mirrors in rest rooms.	\$0000000	\$000000	\$000000

Totals \$0000000 \$000000 \$000000
(Rental Property - City Not Responsible For Costs)

BUILDING NUMBER: 1042
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Beach Attendant/North
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

**NOTE: No Public Access;
Employees only.**

BUILDING NUMBER: 1043
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Beach Attendant/South
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

NOTE: No Public Access;
Employees only.

BUILDING NUMBER: 1560
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./East Plant
3141 Gulf-To-Bay Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Two accessible spaces exist, with signage too low.	NOTE: No Public access; employees only. (4.6.4).
Accessible Route	Does not exist to second floor offices for a person in a wheelchair; (ramp needed).	(4.3.2)(2).
Stairs	A. Outside stairway from Administration by Main Entrance, does not have handrails.	A. (4.9.4)(1).
	B. Stairs in Lobby (first floor) have handrails on only one side.	B. (4.9.4)(1).
	C. Handrails on stairway from East double doors are not continuous proper height.	C. (4.9.4)(5).
	D. Handrails on stairway from East double doors have handrails on only one side.	D. (4.9.4)(1).
Doors	A. Main front door has threshold exceeding 1/2", and does not provide 32" wide opening.	A. (4.13.8)&(4.13.5).
	B. Threshold at double doors in main hallway (East side), exceeds 1/2".	B. (4.13.8).
Sinks	A. Kitchen sink in Lounge does not provide proper knee clearance.	A. (4.24.3).
	B. Sinks in Laboratory do not provide proper knee clearance.	B. (4.24.3).

BUILDING NUMBER: 1560
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./East Plant
3141 Gulf-To-Bay Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountains	Fountain in hallway does not provide proper knee clearance, and has spout too high above floor.	(4.15.5)(1)&(4.15.2).
Tables	Computer tables in Labs and Offices do not allow proper knee clearance.	(4.32.4).
Water Closets	Toilets in Men's and Women's Rest Rooms are not the proper height.	(4.16.3).
Toilet Stalls	A. There is no stall in Men's or Women's Rest Rooms that is the proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	B. (4.17.5).
	C. Grab bars do not exist in stalls in Men's and Women's Rest Rooms.	C. (4.17.6).
Urinals	Urinals in Men's Rest Room have rims too high above floor.	(4.18.2).
Lavatories	Exposed pipes exist underneath sinks in Men's and Women's Rest Rooms.	(4.19.4).
Shower Stalls	A. Curbs exist at entrances to Men's and Women's stalls.	A. (4.21.7).
	B. Proper seat is not provided in any Men's and Women's stalls.	B. (4.21.3).

BUILDING NUMBER: 1560
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./East Plant
3141 Gulf-To-Bay Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	C. Proper shower spray unit is not provided in any stalls in Men's and Women's Rest Rooms.	C. (4.21.6).
	D. No stall in Men's or Women's Rest Rooms is the proper size with clear floor space; (stalls are 30"x31").	D. (4.21.2).

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	No accessible space with proper signage exists.	(4.6.2), (4.6.3), (4.6.4). Modify as required.
Curb Ramps	A. Does not exist where main South side door walkway and Department parking meet.	A. (4.7.1). Employees only.
	B. Does not exist at main South side door threshold.	B. (4.7.1). Also (4.13.6). Employees only.
	C. Does not exist where North side parking lot and walkway to Administration meet.	C. (4.7.1). Install curb ramp.
	D. Does not exist at Administration double door threshold.	D. (4.7.1). Also (4.13.6). Install curb ramp.
	E. Does not exist at West side door threshold off walkway to Administration (6" step).	E. (4.7.1). Also (4.13.6). Install ramp.
	F. Curb ramp at South sidewalk and driveway of Truck Bay has 1-1/2" level change.	F. (4.7.4). Also (4.5). Employees only.
	G. Does not exist where North sidewalk from Administration meets North driveway by Truck Bay doors.	G. (4.7.1). Employees only.
	H. Does not exist anywhere along Truck Bay where a curb exists all along Bay.	H. (4.7.1). Employees only.
	I. Does not exist at Northeast door by North Truck Bay side.	I. (4.7.1). Also (4.13.6). Employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramps	J. Does not exist at Southwest door by South Truck Bay side.	J. (4.7.1). Also (4.13.6). Employees only.
Accessible Route	A. Second floor is not accessible to persons in wheelchairs. Only a stairway exists to second floor.	A. (4.3.2)(2). Employees only.
	B. Does not exist to Picnic Table by West side Administration door.	B. (4.3.2)(2). Employees only.
	C. Northwest door to walkway by Truck Bay has a slope too great at door and does not provide minimum maneuvering clearance.	C. (4.3.7). Also (4.13.6). Employees only.
	D. Does not exist from East side outside stairs to street sidewalk or parking.	D. (4.3.2)(2). Employees only.
	E. Passage between sink area and stalls in Women's Administration Rest Room does not provide 36" minimum clear width.	E. (4.3.3). Modify as required.
Doors	A. Door at top of East side stairway has threshold exceeding 1/2".	A. (4.13.8). Employees only.
	B. Southwest door by Truck Bay does not provide 32" wide opening, and has threshold exceeding 1/2".	B. (4.13.5)&(4.13.8). Employees only.
	C. Lieutenant's Office door by Truck Bay does not provide 32" wide opening and has a threshold exceeding 1/2".	C. (4.13.5)&(4.13.8). Employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	D. Deputy Chief's door by Truck Bay does not provide 32" wide opening, and has threshold exceeding 1/2".	D. (4.13.5)&(4.13.8). Employees only.
	E. Deputy Chief's inside doorway to Dorm does not provide 32" wide opening.	F. (4.13.5). Employees only.
	F. Threshold at door from Truck Bay to Administration has threshold exceeding 1/2".	F. (4.13.8). Employees only.
	G. Men's and Women's Administration Rest Room doors do not provide 32" wide opening.	G. (4.13.5). Modify as required.
	H. Door off stairs (leading to roof) has threshold greater than 1/2"/	H. (4.13.8). Employees only.
	I. Door off stairs (leading to roof) has opening force that exceeds 5 LBF.	I. (4.13.11). Employees only.
	J. Doors at top of inside stairways have opening force exceeding 5 LBF.	J. (4.13.11). Employees only.
	K. Stairway door by Classrooms does not provide 32" wide opening.	K. (4.13.5). Employees only.
	L. Doorway to single bed Dorm does not provide 32" wide opening.	L. (4.13.5). Employees only.
	M. Door to single toilet Rest Room off hall by Dorms does not provide 32" wide opening.	M. (4.13.5). Employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	N. Door to toilet room in single toilet Rest Room off hall by Dorms does not provide 32" wide opening.	N. (4.13.5). Employees only.
	O. Door to Rest Room off second floor main hallway has opening force exceeding 5 LBF.	O. (4.13.11). Employees only.
	P. Three pantry doors off Kitchen do not provide 32" wide opening.	P. (4.13.5). Employees only.
	Q. Doors to Men's and Women's Truck Bay Rest Rooms do not provide 32" wide opening.	Q. (4.13.5). Employees only.
Stairs	East outside stairway has handrail on only one side.	(4.9.4). Employees only.
Drinking Fountains	A. Spouts on fountains in Truck Bay, Administration, and in second floor hallway, have spouts too high above floor.	A. (4.15.2). Install paper cup dispenser at Administration fountain only. Others, employees only.
	B. Clear floor space is not provided at Administration and second floor hallway Rest Rooms.	B. (4.15.5)(1). Modify Administration only. Other, employees only.
	C. Proper knee clearance is not provided at fountain in Truck Bay.	C. (4.15.5)(2). Employees only.
	D. Water flow is directed toward rear of fountain at Administration, Truck Bay, and second floor hallway fountains.	D. (4.15.3). See A. Administration only. Others, employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Counter/Tables	Computer Table/Counter in Lieutenant's Office does not provide proper knee clearance.	(4.32.4). Employees only.
Sinks	A. Sinks in Men's and Women's Truck Bay Rest Rooms, and in second floor hallway Rest Room, do not provide proper clear floor space, nor proper knee clearance.	A. (4.24.5)&(4.24.3). Employees only.
	B. Sinks in Men's and Women's Administration Rest Rooms, Cleaning Supply Storage Room at Truck Bay, Utility Room by second floor hallway Rest Room/Shower, and in the second floor kitchen (2 sinks), do not provide proper knee clearance.	B. (4.24.3). Modify Administration Rest Room only. Others, employees only.
	C. Exposed pipes exist underneath sinks in the Men's and Women's Truck Bay Rest Rooms.	C. (4.24.6). Employees only.
	D. Sink in single toilet Rest Room off hallway leading to Dorms does not provide proper knee clearance.	D. (4.24.3). Employees only.
Water Closets	Toilets in Men's and Women's Truck Bay Rest Rooms, Men's and Women's Administration Rest Rooms, second floor hallway Rest Room, and second floor single toilet Rest Room off hallway to Dorms, are not the proper height.	(4.16.3). Replace toilets in Administration only. Others, employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>A. Stall doors do not provide 32" wide opening in Men's and Women's Administration Rest Rooms, Men's and Women's Truck Bay Rest Rooms, and in second floor hallway Rest Room toilet stalls and shower stalls; also stall shower doors in single toilet Rest Room in hall to Dorms.</p> <p>B. There are no stalls in Men's and Women's Truck Bay Rest Rooms, Administration Men's and Women's Rest Rooms, and in second floor main hallway Rest Room, that are the proper size and arrangement.</p> <p>C. Grab bars do not exist in Men's and Women's Truck Bay Rest Rooms, Men's and Women's Administration Rest Rooms, main hallway second floor Rest Rooms, and in single toilet Rest Room off the hallway to Dorms.</p>	<p>A. (4.13.5)&(4.17.5). Modify Administration Rest Room only. Others, employees only.</p> <p>B. (4.17.3). See A.</p> <p>C. (4.17.6). See A.</p>
Mirrors	<p>Mirrors in Men's and Women's Truck Bay Rest Rooms are too high above the floor.</p>	(4.19.6). Employees only.
Urinals	<p>Urinals in Men's Truck Bay Rest Room, Administration Rest Room, and the four in the second floor main hallway Rest Room, have rims too high above floor.</p>	(4.18.2). Replace urinal in Administration Rest Room only. Others, employees only.

BUILDING NUMBER: 1700
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Main Station
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Dispensers	Dispensers in Men's and Women's Administration Rest Rooms are too high above ground.	(4.23.7). Lower dispensers.
Shower Stalls	A. There are no shower stalls with the proper size and clearances in the showers in the second floor main hallway Rest Room, or in the single toilet Rest Room off the hallway to Dorms.	A. (4.21.2). Employees only.
	B. Curbs exist in shower stalls in second floor main hallway Rest Room, and in single toilet Rest Room off hallway to Dorms.	B. (4.21.7). Employees only.
	C. A proper shower spray unit is not provided in any shower stalls in second floor hallway Rest Room, or in single toilet Rest Room off hallway to Dorms.	C. (4.21.6). Employees only.
	D. Proper seat is not provided in any stalls of second floor hallway Rest Room, or in the single toilet Rest Room off hallway to Dorms.	D. (4.21.3). Employees only.
	E. Grab bars do not exist in any stalls of second floor hallway Rest Room, or in single toilet Rest Room off hallway to Dorms.	E. (4.21.4). Employees only.

BUILDING NUMBER: 1705
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #45/Maint. Bldg.
610 Franklin Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramps	A. Does not exist at South side doorway at threshold.	NOTE: No Public access; employees only. A. (4.7.1).
	B. Does not exist at walkway to South side doorway.	B. (4.7.1).
	C. Does not exist where North side Department parking connects with East-West walkway to Main Entrance.	C. (4.7.1).
Accessible Route	Sidewalk at South side of Maintenance Building does not provide 36" minimum clear width.	(4.3.3).
Doors	A. Threshold exceeds 1/2" on North side Maintenance door by Garage doors.	A. (4.13.8).
	B. Three doors on West side of Maintenance Building (double door) have 6" step and need proper curb ramp.	B. (4.7.1).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Rear West side door does not provide 32" wide opening.	NOTE: No Public access; employees only. A. (4.13.5).
	B. North side door does not provide 32" wide opening.	B. (4.13.5).
	C. North side double doors have floor level changes (step), and threshold greater than 1/2".	C. (4.13.8).
	D. Front door (Mandalay Avenue) has floor level changes (step), and threshold greater than 1/2".	D. (4.13.8).
	E. Thirteen inside doors throughout building do not provide 32" wide opening.	E. (4.13.5).
	F. Doorway to Employee Rest Room does not provide 32" wide opening.	F. (4.13.5).
	G. Floor level change (step) exists at Men's and Women's Rest Rooms by Truck Bay.	G. (4.13.8).
	H. Doors to Men's and Women's Rest Rooms by Truck Bay do not provide 32" wide opening.	H. (4.13.5).
	I. Utility Room by Truck Bay has a floor level change (step) and needs curb ramp.	I. (4.13.8).
	J. East side door has level change (step) at threshold and needs curb ramp.	J. (4.13.8).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	K. Door off Kitchen has threshold greater than 1/2", and does not provide proper 32" wide opening.	K. (4.13.8). Also (4.13.5).
	L. Rear West side door has two level changes (steps) and needs proper curb ramp.	L. (4.13.8).
	M. North side door has level change (step) and needs proper curb ramp.	M. (4.13.8).
	N. At front door (Mandalay) where walkway and porch meet, there is a level change (step) that needs curb ramp.	N. (4.13.8).
	O. Thresholds at some inside doorways exceed 1/2".	O. (4.13.8).
Stairs	A. Outside South stairway has open risers.	A. (4.9.2).
	B. Handrails on inside stairway are not the proper height and are not on both sides of stairs.	B. (4.9.4)(1-7).
Curb Ramp	Curbs exist on both sides of Truck Bay, making offices, etc., unaccessible. Proper curb ramps are needed.	(4.7.1). Also (4.3.2)(2).
Sinks	A. Sink in Employee Rest Room does not provide proper clear floor space.	A. (4.24.5).
	B. Sink in Employee Shower does not provide proper clear floor space.	B. (4.24.5).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	C. Sink in Men's Rest Room by Truck Bay does not provide proper clear floor space.	C. (4.24.5).
	D. Sink in Kitchen does not provide proper knee clearance.	D. (4.24.3).
Counters	Counters throughout Kitchen are not between 28" and 34" above floor.	(4.32.4).
Ground Surfaces	Walkway on North side of building is uneven.	(4.5.1).
Drinking Fountains	A. Two drinking fountains exist in Truck Bay and both have spouts too high from floor.	A. (4.15.2).
	B. Fountains have water flow less than 4" high.	B. (4.15.3).
	C. Fountains do not provide proper knee clearance.	C. (4.15.5)(1).
Water Closets	A. Employee Rest Room does not provide proper clear floor space.	A. (4.16.2).
	B. Employee Rest Room does not provide proper grab bars; (also Shower Room).	B. (4.16.4).
	C. Toilets in Employee Rest Room and Shower Room are not the proper height.	C. (4.16.3).
	D. Toilets in Men's and Women's Rest Rooms by Truck Bay are not the proper height.	D. (4.16.3).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Men's and Women's Rest Rooms by Truck Bay are not the proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Men's and Women's Rest Rooms by Truck Bay do not provide 32" wide opening.	B. (4.17.5).
	C. Grab bars do not exist in stalls of Men's and Women's Rest Rooms by Truck Bay.	C. (4.17.6).
Lavatories and Mirrors	A. Mirrors in Men's and Women's Rest Rooms by Truck Bay, and in Employee Rest Room and Shower Room, are too high above floor.	A. (4.19.6).
	B. Exposed pipes exist underneath sinks in Men's and Women's Rest Rooms by Truck Bay, and in Employee Rest Room and Shower Room.	B. (4.19.4).
Urinal	Urinal in Men's Rest Room by Truck Bay has a rim too high above floor.	(4.18.2).
Dispensers	Towel dispensers in Men's and Women's Rest Rooms by Truck Bay are too high above floor.	(4.23.7).
Shower Stall	A. Stalls in Employee Shower Room are not the proper size with proper clearances.	A. (4.21.2).
	B. Curb exists at entrance to stalls.	B. (4.21.7).

BUILDING NUMBER: 1710
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #46
534 Mandalay Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stall	C. Proper shower spray unit is not provided in Employee Shower Room.	C. (4.21.6).
	D. Proper seat is not provided in Employee Shower Stalls.	D. (4.21.3).
Accessible Route	Does not exist in Women's Rest Room by Truck Bay, since passage to toilet does not provide proper minimum clear width.	(4.3.3).

BUILDING NUMBER: 1715
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #47
1460 Lakeview Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible space, with a sign showing the symbol of accessibility, does not exist near Entrance.	NOTE: No Public access; employees only. (4.6.3), (4.6.4), (4.6.2).
Curb Ramps	A. Does not exist on walkway leading to sidewalk.	A. (4.7.1).
	B. Does not exist at Main Front Door.	B. (4.7.1).
	C. Does not exist at curl between driveway and Patio.	C. (4.7.1).
	D. Does not exist at rear sliding glass doors leading to Patio.	D. (4.7.1).
	E. Does not exist anywhere along curb that runs the length of Truck Bay.	E. (4.7.1).
	F. Sidewalk by rear Truck Bay does not provide proper curb ramp.	F. (4.7.1).
Doors	A. Thresholds of two doors at Main Entrance exceed 1/2".	A. (4.13.8).
	B. Two doors of office by Main Entrance do not provide 32" wide opening.	B. (4.13.5).
	C. Door to Rest Room (blue tile) does not provide 32" wide opening.	C. (4.13.5).
	D. Two doors of Computer Room do not provide 32" wide opening.	D. (4.13.5).

BUILDING NUMBER: 1715
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #47
1460 Lakeview Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	E. Door of Lieutenant's Dorm does not provide 32" wide opening.	E. (4.13.5).
	F. Doorway to Shower/Rest Room does not provide 32" wide opening.	F. (4.13.5).
	G. Two inside doors leading to Truck Bay have thresholds exceeding 1/2".	G. (4.13.8).
	H. Rear door of Truck Bay has threshold exceeding 1/2".	H. (4.13.8).
Water Fountains	A. Fountains in hall and Truck Bay have spouts too high above floor.	A. (4.15.2).
	B. Fountain in hall does not provide proper clear floor space.	B. (4.15.5)(2).
	C. Fountain in Truck Bay does not provide proper knee clearance.	C. (4.15.5)(1).
	D. Fountain in Truck Bay has water flow not within 3" of the front edge.	D. (4.15.3).
Counter	Counter in Kitchen is too high above floor.	(4.32.4).
Sink	A. Sink in Kitchen does not provide proper knee clearance.	A. (4.24.3).
	B. Sinks in Blue Bathroom and Lieutenant's Bathroom, do not provide proper clear floor space.	B. (4.24.5).
	C. Sinks in Shower/Rest Room do not provide proper knee clearance.	C. (4.24.3).

BUILDING NUMBER: 1715
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #47
1460 Lakeview Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	With sink in present location, clear minimum width of 36" is not provided.	(4.3.3).
Water Closets	A. Toilets in Blue Rest Room, Lieutenant's Bathroom, and Shower/Rest Room, are not the proper height.	A. (4.16.3).
	B. Blue Rest Room does not provide proper clear floor space.	B. (4.16.2).
	C. Grab bars do not exist in Blue Rest Room.	C. (4.16.4).
Toilet Stalls	A. Stalls in Lieutenant's Bathroom and in Shower/Rest Room are not the proper size and arrangement.	A. (4.17.3).
	B. Grab bars do not exist in stalls of Lieutenant's Bathroom and in Shower/Rest Room.	B. (4.17.6).
	C. Stall doors in Lieutenant's Bathroom and in Shower/Rest Room do not provide 32" opening.	C. (4.17.5).
Urinals	Urinals in Lieutenant's Bathroom and in Shower/Rest Room have rims too high above floor.	(4.18.2).
Dispensers	Paper towel dispensers in Blue Rest Room, Shower/Rest Room, and Lieutenant's Bathroom, are too high above floor.	(4.23.7).

BUILDING NUMBER: 1715
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #47
1460 Lakeview Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Mirrors	Mirrors over sinks in Blue Rest Room, Shower/Rest Room, and Lieutenant's Bathroom, are too high above floor.	(4.19.6).
Shower Stalls	A. Grab bars in stalls do not exist in Shower/Rest Room or Lieutenant's Bathroom.	A. (4.21.4).
	B. Curb exists at entrance to stalls in Shower/Rest Room and Lieutenant's Bathroom.	B. (4.21.7).
	C. Proper seat is not provided in Lieutenant's Bathroom and Shower/Rest Room stalls.	C. (4.21.3).
	D. Proper shower spray unit is not provided in stall of Lieutenant's Bathroom.	D. (4.21.6).

BUILDING NUMBER: 1725
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48/Fire Tower
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

(No renovations needed;
no public access.)

BUILDING NUMBER: 1730
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist by walkway to transportation.	A. (4.3.2)(1). Install sidewalk.
	B. Does not exist from Patio to Training Center parking lot, and on to Training Center entrance.	B. (4.3.2)(2). Install sidewalk.
Curb Ramps	A. Does not exist where rear Truck Bay door meets porch.	A. (4.7.1). Employees only.
	B. Does not exist anywhere along curb which runs the length of Truck Bay.	B. (4.7.1). Employees only.
	C. Does not exist at doors from Lounge to Patio; (step exists).	C. (4.7.1). Employees only.
Doors	A. Rear door of Truck Bay has threshold greater than 1/2".	A. (4.13.8). Employees only.
	B. Two main front doors have thresholds greater than 1/2".	B. (4.13.8). Employees only.
	C. Two Radio Room doors do not provide 32" wide opening.	C. (4.13.5). Employees only.s
	D. Two doors of Lieutenant's Office do not provide 32" wide opening.	D. (4.13.5). Employees only.
	E. Rest Room by Lieutenant's Office does not provide 32" wide opening.	E. (4.13.5). Employees only.
	F. Threshold at door between Lounge and Truck Bay exceeds 1/2".	F. (4.13.8). Employees only.

BUILDING NUMBER: 1730
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	G. Lieutenant's bathroom has two doors that do not provide 32" wide opening.	G. (4.13.5). Employees only.
	H. D o o r i n t o Lieutenant's Dorm does not provide 32" wide opening.	H. (4.13.5). Employees only.
	I. Door to Showers/Rest Room does not provide 32" wide opening.	I. (4.13.5). Employees only.
	J. Door between hall and Shower/Rest Room and Truck Bay, has a threshold greater than 1/2".	J. (4.13.5). Employees only.
Water Fountains	A. Fountains in Truck Bay and inside hall do not provide proper knee clearance.	A. (4.15.5)(1). Employees only.
	B. Fountains in Truck Bay and inside hall have spouts too high above the floor.	B. (4.15.2). Employees only.
Counters	Counter in Kitchen is too high above floor.	(4.32.4). Employees only.
Sinks	Kitchen sink does not provide proper knee clearance.	(4.24.3). Employees only.
Water Closets	A. Toilets in Rest Room by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room, are not the proper height.	A. (4.16.3). Employees only.
	B. Proper grab bars do not exist in Rest Room by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room stalls.	B. (4.16.4). Also (4.17.6). Employees only.

BUILDING NUMBER: 1730
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Stalls in Shower/Rest Room are not the proper size and arrangement.	A. (4.17.3). Employees only.
	B. Stall doors in Shower/Rest Room do not provide 32" wide opening.	B. (4.17.5). Employees only.
Lavatories	A. Sinks in Rest Room by Lieutenant's Office, and Shower/Rest Room, do not provide proper knee clearance.	A. (4.24.3). Employees only.
	B. Sink in Rest Room by Lieutenant's Office does not have the proper clear floor space.	B. (4.24.5). Employees only.
Urinals	Urinals in Lieutenant's Bathroom and in Shower/Rest Room have rims too high above floor.	(4.18.2). Employees only.
Shower Stalls	A. There are no stalls in Lieutenant's Bathroom or Shower/Rest Room that are the proper size.	A. (4.21.2). Employees only.
	B. Proper grab bars do not exist in stalls of Lieutenant's Bathroom or Shower/Rest Room.	B. (4.21.4). Employees only.
	C. Proper shower spray unit does not exist in stalls of Lieutenant's Bathroom or Shower/Rest Room.	C. (4.21.6). Employees only.

BUILDING NUMBER: 1730
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #48
1700 Belcher Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	D. Curbs exist in shower stalls of Lieutenant's Bathroom and Shower/Rest Room.	D. (4.21.7). Employees only.
	E. Proper seat is not provided in Lieutenant's Bathroom, or Shower/Rest Room stalls.	E. (4.21.3). Employees only.

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	One accessible space exists, but signage is too low. Two should exist; (33 spaces).	(4.6.4). Modify as required.
Accessible Route	A. North walkway to Fire Education Building does not provide minimum clear width of 36".	A. (4.3.3). Widen sidewalk.
	B. Walkway by parking and walkway on East side of building do not provide minimum clear width of 36".	B. (4.3.3). Employee area only.
	C. Walkway to flagpole does not provide minimum clear width of 36".	C. (4.3.3). Employees only.
	D. Walkway from parking to Fire Education Building does not provide minimum clear width of 36".	D. (4.3.3). Widen sidewalk.
	E. Does not exist from building to transportation.	E. (4.3.2)(1). Install sidewalk.
Doors	A. Thresholds at three doors to Fire Education Building exceed 1/2".	A. (4.13.8). Modify as required.
	B. Doors to Men's and Women's Rest Rooms in Fire Education Building do not provide 32" wide opening.	B. (4.13.5). Modify as required.
	C. Doorway into Storage Room of Fire Education Building does not provide 32" wide opening.	C. (4.13.5). Employees only.

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD	
Doors	D. Threshold at Main Doorway exceeds 1/2"; (Station).	D. (4.13.8). Employees only.	
	E. Main Doorway (Station) does not provide 32" wide opening.	E. (4.13.5). Employees only.	
	F. Door between Lieutenant's Office and Rest Room does not provide 32" opening.	F. (4.13.5). Employees only.	
	G. Doorway from Lieutenant's Dorm to Sleeping Quarters does not provide 32" wide opening.	G. (4.13.5). Employees only.	
	H. Doorway to Lieutenant's Bathroom does not provide proper 32" wide opening.	H. (4.13.5). Employees only.	
	I. Door of Utility Closet off hallway does not provide 32" wide opening.	I. (4.13.5). Employees only.	
	Curb Ramps	A. Do not exist at two South outside doors at walkway.	A. (4.7.1). Employees only.
		B. Do not exist at Main Entrance where porch and walkway meet.	B. (4.7.1). Employees only.
		C. Does not exist at doorway between Radio Room and Truck Bay.	C. (4.7.1). Employees only.
Counters	Counters in Kitchen are too high above floor.	(4.32.4). Employees only.	
Sinks	Sink in Kitchen does not provide proper knee clearance.	(4.24.3). Employees only.	

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Fountain	<p>A. Fountains in Fire Education Building, Station Truck Bay, and Station hallway, have spouts too high above ground.</p> <p>B. Fountains in Fire Education Building, Station Truck Bay and Station hallway, have water flow toward rear.</p> <p>C. Fountain in Truck Bay does not provide proper knee clearance.</p> <p>D. Fountain in Fire Education Building does not provide proper clear floor space.</p>	<p>A. (4.15.2). Install paper cup dispenser.</p> <p>B. (4.15.3). See A.</p> <p>C. (4.15.5)(1). Employees only.</p> <p>D. (4.15.5)(2). See A.</p>
Water Closets	<p>A. Toilets in Men's and Women's Rest Rooms by Lieutenant's Office, Lieutenant's Bathroom, Shower/Rest Room, and Men's and Women's Rest Rooms in the Fire Education Building, are not the proper height.</p> <p>B. Proper clear floor space is not provided in Men's and Women's Rest Rooms by Lieutenant's Office.</p>	<p>A. (4.16.3). Employees only.</p> <p>B. (4.16.2). Employees only.</p>
Toilet Stalls	<p>A. There are no stalls in Men's and Women's Rest Rooms in the Fire Education Building, in Station Shower/Rest Room, or in Lieutenant's Bathroom, that are the proper size and arrangement.</p>	<p>A. (4.17.3). Modify bathrooms in Fire Education Bldg. only.</p>

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>B. Stall doors in Men's and Women's Fire Education Building Rest Rooms, Station Shower/Rest Room, and Lieutenant's Bathroom, do not provide 32" wide opening.</p> <p>C. Grab bars do not exist in stalls of Men's and Women's Fire Education Building Rest Rooms, Station Shower/Rest Room, or in Lieutenant's Bathroom.</p>	<p>B. (4.17.5). Designated two bathrooms in Fire Education Bldg. as Handicapped accessible, remodeling as required.</p> <p>C. (4.17.6). See B.</p>
Urinals	<p>Urinals in Station Shower/Rest Room and Lieutenant's Bathroom, have rims too high above floor.</p>	<p>(4.18.2). Employees only.</p>
Lavatories/Mirrors	<p>A. Mirrors in Men's and Women's Fire Education Building Rest Rooms, Rest Rooms by Lieutenant's Office, Lieutenant's Bathroom, and Station Shower/Rest Room, have mirrors too high above floor.</p> <p>B. Exposed pipes underneath sinks exist in Rest Rooms by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room.</p>	<p>A. (4.19.6). Lower mirrors in Fire Education Building.</p> <p>B. (4.19.4). Employees only.</p>
Dispensers	<p>Paper towel dispensers in Men's and Women's Fire Education Building Rest Rooms, Rest Room by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room, are too high above floor.</p>	<p>(4.23.7). Lower dispensers in Fire Education Bldg.</p>

BUILDING NUMBER: 1735
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #49
520 Sky Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	Men's and Women's Rest Rooms in Fire Education Building do not provide proper clear floor space at sinks.	(4.24.5). modify as required.
Shower Stalls	A. Shower stalls in Shower/Rest Room has curb at entrance.	A. (4.21.7). Employees only.
	B. Shower stalls in Shower/Rest Room do not provide proper seat.	B. (4.21.3). Employees only.
	C. Proper shower spray unit is not provided in either stall in Shower/Rest Room.	C. (4.21.6). Employees only.
	D. Grab bars are too high above floor in stalls of Shower/Rest Room.	D. (4.21.4). Employees only.

BUILDING NUMBER: 1740
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #50
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space, with a sign showing the symbol of accessibility, does not exist.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Curb Ramps	A. Does not exist on sidewalk to Main Entrance door.	A. (4.7.1).
	B. Curb exists all along Truck Bay without proper curb ramps.	B. (4.7.1).
	C. Does not exist at sliding glass doors leading to Patio.	C. (4.7.1).
Doors	A. Thresholds at two Main Entrance doors exceed 1/2".	A. (4.13.8).
	B. Threshold at rear door of Truck Bay exceeds 1/2".	B. (4.13.8)
	C. Door between Truck Bay and Lounge has threshold exceeding 1/2".	C. (4.13.8).
	D. Doorway between Lounge and Radio Room does not provide 32" wide opening.	D. (4.13.5).
	E. Two doors of Lieutenant's Office do not provide 32" wide opening.	E. (4.13.5).
	F. Rest Room door by Lieutenant's Office does not provide 32" wide opening.	F. (4.13.5).
	G. Doorway to Lieutenant's Dorm does not provide 32" wide opening.	G. (4.13.5).

BUILDING NUMBER: 1740
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #50
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	H. Doorway to Lieutenant's Bathroom does not provide 32" wide opening.	H. (4.13.5).
	I. Threshold at doorway between hallway and Truck Bay exceeds 1/2".	I. (4.13.8).
	J. Doorway to shower stall in Shower/Rest Room does not provide 32" wide opening.	J. (4.13.5).
Drinking Fountains	A. Drinking fountains in hallway and Truck Bay have spouts too high above floor.	A. (4.15.2).
	B. Drinking fountain in Truck Bay does not provide proper knee clearance.	B. (4.15.5)(1).
	C. Drinking fountain in hallway does not provide proper knee clearance.	C. (4.15.5)(1).
Counter	Kitchen counter is too high above floor.	(4.32.4).
Sinks	Kitchen sink does not provide proper knee clearance.	(4.24.3).
Water Closets	A. Toilets in Rest Room by Lieutenant's Office, Lieutenant's Bathroom, and Shower/Rest Room, are not the proper height.	A. (4.16.3).
	B. Proper Grab bars do not exist in Rest Rooms by Lieutenant's Office, Lieutenant's Bathroom, and in Shower/Rest Room.	B. (4.16.4). Also (4.17.6).

BUILDING NUMBER: 1740
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #50
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Stalls in Shower/Rest Room are not the proper size and arrangement.	A. (4.17.3).
	B. Stalls doors in Shower/Rest Room do not provide 32" wide opening.	B. (4.17.5).
Lavatories	A. Sinks in Rest Rooms by Lieutenant's Office and in Lieutenant's Bathroom, do not provide clear floor space.	A. (4.24.5).
Urinals	Urinals in Lieutenant's Bathroom and Shower/Rest Room have rims too high above floor.	(4.18.2).
Mirrors	Mirror in Rest Room by Lieutenant's Office is too high above floor.	(4.19.6).
Dispensers	Paper Towel Dispenser in Rest Room by Lieutenant's Office is too high above floor.	(4.23.7).
Shower Stalls	A. There are no stalls in Lieutenant's Bathroom or Shower/Rest Room that are the proper size.	A. (4.21.2).
	B. Proper grab bars do not exist in stalls of Lieutenant's Bathroom or Shower/Rest Room.	B. (4.21.4).
	C. Proper shower spray unit does not exist in stalls of Lieutenant's Bathroom or Shower/Rest Room.	C. (4.21.6).

BUILDING NUMBER: 1740
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Fire Station #50
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	D. Curbs exist in shower stalls of Lieutenant's Bathroom and in Shower/Rest Room.	D. (4.21.7).
	E. Proper seat is not provided in any stall in Lieutenant's Bathroom or in Shower/Rest Room.	D. (4.21.3).

BUILDING NUMBER: 1820
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Radio Transmitter Tower
Lakeview and Missouri

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Does not exist to Main E n t r a n c e f r o m t r a n s p o r t a t i o n (lacks c o n n e c t i n g w a l k w a y).	NOTE: No Public access; employees only. (4.3.2)(1).

BUILDING NUMBER: 1810
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Maintenance
1900 Grand Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	A. (64 Spaces) Two accessible spaces exist, with proper signage.	A. (4.1.2).
	B. Accessible parking spaces do not exist on the shortest route of travel from adjacent parking.	B. (4.6.2). Relocate Handicapped parking spaces.
Accessible Route	A. Accessible route does not exist to 2nd floor.	A. (4.3.2). Employees only.
	B. Threshold at Main Entrance is greater than 1/2".	B. (4.13.8). Install ramp.
	C. Threshold at entrance to Radio Shop is greater than 1/2".	C. (4.13.8). Employees only.
	D. Curb ramp does not exist from parking to Main Entrance.	D. (4.7.1). Install ramp.
	E. Does not exist from sidewalk to Picnic Table.	E. (4.3.2)(2). Employees only.
	F. Threshold on East side of building by Supervisors' Offices exceeds 1/2".	F. (4.13.8). Install ramp.
Counters	A. Counter in Waiting Area is 37" above the floor.	A. (4.15.2). Employees only.
	B. Counters in employee Break Room are 37" above the floor.	B. (4.15.2). Employees only.
Water Fountain	Fountain at employee's sink does not provide proper knee clearance.	(4.15.5)(1). Employees only.
Water Closets	Toilets in Men's and Women's Rest Rooms are not the proper height.	(4.16.3). Replace toilets.

BUILDING NUMBER: 1810
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Maintenance
1900 Grand Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	<p>A. There are no toilet stalls in Men's or Women's Rest Rooms that are the proper size and arrangement.</p> <p>B. Grab bars are not at proper height, and do not exist behind toilets.</p>	<p>A. (4.17.3). Modify as required.</p> <p>B. (4.17.6). Install grab bars.</p>
Urinals	<p>Urinals in Men's Rest Room have rims higher than 17" from floor.</p>	<p>(4.18.2). Replace urinal.</p>
Sinks	<p>A. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.</p> <p>B. Sink in Break Room does not provide proper knee clearance.</p>	<p>A. (4.24.3). Modify counter.</p> <p>B. (4.24.3). Employees only.</p>
Shower Stalls	<p>Showers in Men's Rest Room do not provide proper shower unit with hose at least 60" long.</p>	<p>(4.21.6). Employees only.</p>
Alarms	<p>Visual Alarm System is not an integrated part of building's Alarm System.</p>	<p>(4.28.1). Install as required.</p>

BUILDING NUMBER: 1830
TARGET DATE: 1993
COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Radio Transmitter Tower
S.R. 580 and McMullen

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Does not exist to Main Entrance from transportation (lacks connecting walkway).	(4.3.2)(1). Employees only.

BUILDING NUMBER: 1835
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Fuel Site/Fire #6
2681 Countryside Blvd.

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramp	Does not exist at gas pumps to allow an accessible route to hose or to screen and card operated fueling system.	NOTE: No Public access; employees only. (4.7.1).
Reach Ranges	<p>A. Screen and card operated fueling system is not within reach ranges.</p> <p>B. Emergency shut-off is not within proper reach ranges.</p>	<p>A. (4.2.5) or (4.2.6).</p> <p>B. (4.2.5) or (4.2.6).</p>

BUILDING NUMBER: 1840
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Fleet Fuel Site/Annex
10 S. Missouri Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramp	Does not exist at pump islands to allow an accessible route to hose or to screen and card operated fueling system.	NOTE: No Public access; employees only. (4.7.1).
Reach Ranges	A. Screen and card operated fueling system is not within proper reach ranges. B. Emergency shut-off is not within proper reach ranges.	A. (4.2.5) or (4.2.6). B. (4.2.5) or (4.2.6).

BUILDING NUMBER: 2000
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Gas Division/2nd Floor
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Aisle space throughout offices does not provide minimum clear width of 36".	NOTE: No Public Access. (4.3.3).
Counters	Desks and counters throughout offices do not provide proper knee clearance.	(4.32.3).
Curb Ramps	Ramp's current location (into a parking place) makes its obstruction by a parked vehicle likely.	(4.7.8) Could lead into access aisle next to an accessible parking space.
Drinking Fountain	A. Fountain in Garage has a spout too high from floor.	A. (4.15.2).
	B. Fountain in Garage does not provide proper clear floor space.	B. (4.15.5)(2).
Sinks	Kitchen sink counter does not provide proper knee clearance.	(4.24.3).
Doors	A. Threshold at rear door leading to stairway exceeds 1/2".	A. (4.13.8).
	B. Rear door leading to stairway does not provide 32" wide opening.	B. (4.13.5).
	C. Threshold at Main Entrance door exceeds 1/2".	C. (4.13.8).
	D. Door at Main Entrance does not provide 32" wide opening.	D. (4.13.5).
	E. Rear Garage door has threshold exceeding 1/2".	E. (4.13.8).
Stairs	A. Rear stairway has open risers.	A. (4.9.2).

BUILDING NUMBER: 2000
 TARGET DATE: 1993
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Gas Division/2nd Floor
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	B. Stairs in Garage have open risers.	B. (4.9.2).
	C. Handrails on rear stairway, handrails in Garage, and handrails at Main Entrance have handrails too high in spots.	C. (4.9.4)(1-7).
Water Closets	A. Toilets in Men's and Women's Rest Rooms are not the proper height.	A. (4.16.3).
	B. Grab bars do not exist in Men's or Women's Rest Rooms.	B. (4.16.4).
Lavatories and Mirrors	A. Mirrors are too high from ground in Men's and Women's Rest Rooms.	A. (4.19.6).
	B. Exposed water pipes exist underneath sinks in Men's and Women's Rest Rooms.	B. (4.19.4).

BUILDING NUMBER: 2010
TARGET DATE: 1993
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Gas Division/Welding Shop
400 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Rear Garage door has a threshold exceeding 1/2". B. 5" step exists at Main Entrance.	A. (4.13.8). Employees only. B. (4.13.8). Employees only.

BUILDING NUMBER: 2090
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Life Guard Building
Pier 60 Parking Lot

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Curb Ramps	Not present at entrance or at Rest Rooms.	NOTE: No public access; employees only. (4.71). Also (4.7.6).
Water Fountain	<p>A. Spout is 42" from floor.</p> <p>B. Clear floor space of 30" x 48" is not provided.</p> <p>C. Water flow trajectory is not parallel to the front of the unit.</p>	<p>A. (4.15.2).</p> <p>B. (4.15.5)(2).</p> <p>C. (4.15.3).</p>
Doors	<p>A. Doorways to both Rest Rooms do not provide a minimum clear opening of 32".</p> <p>B. Doorway to shower does not provide a minimum clear opening of 32".</p>	<p>A. (4.13.5).</p> <p>B. (4.13.5).</p>
Lavatories and Mirrors	<p>A. Mirror in Rest Room with shower has bottom edge 54" from floor.</p> <p>B. Both Rest Rooms have exposed water pipes underneath sinks.</p> <p>C. Proper knee clearance (depth) is not provided underneath sinks in either Rest Room.</p> <p>D. Clear floor space in front of sinks is not provided.</p>	<p>A. (4.19.6).</p> <p>B. (4.24.6).</p> <p>C. (4.24.3).</p> <p>D. (4.19.3).</p>

BUILDING NUMBER: 2090
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Life Guard Building
Pier 60 Parking Lot

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are accessible with proper clear floor space.	A. (4.17.3). Also (4.22.4).
	B. Opening to toilet stalls is 23" wide.	B. (4.17.5). Also (4.13.5).
Water Closets	A. No grab bars exist behind or on the side of toilets in either Rest Room.	A. (4.17.6).
	B. Height of toilets in both Rest Rooms is 15-3/4" high.	B. (4.16.3).
Urinal	A. Clear floor space in front of urinals to allow forward approach is not provided.	A. (4.18.3).
	B. Height of urinal is too high for proper accessibility.	B. (4.18.2).
Shower Stall	A. 6" curb exists at shower entrance.	A. (4.21.7).
	B. Seat is not provided.	B. (4.21.3).
	C. Grab bars do not exist.	C. (4.21.4).
	D. Proper shower unit and proper controls at proper height are not provided.	D. (4.21.6). Also (4.21.5).

BUILDING NUMBER: 4070
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Marina/Maintenance Building
25 Causeway Boulevard

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

Accessible Route	Does not exist into Maintenance area due to slope at doorway exceeding 1:50.	NOTE: No public access; employees only. (4.3.7). Also (4.13.6).
------------------	--	---

BUILDING NUMBER: 4200
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Marshall Street
1605 Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	<p>A. Main front door has threshold exceeding 1/2", and does not provide 32" wide opening.</p> <p>B. Door to outside stairway does not provide 32" wide opening.</p> <p>C. D o o r t o Superintendent's Rest Room does not provide 32" wide opening.</p>	<p>NOTE: No Public access; employees only. A. (4.13.8)&(4.13.5).</p> <p>B. (4.13.5).</p> <p>C. (4.13.5).</p>
Water Fountains	<p>Second floor fountain has spout too high above floor.</p>	(4.15.2).
Stairs	<p>A. Handrails on West and East outside stairways are not continuous proper height.</p> <p>B. Stairs on East outside stairway have open risers.</p>	<p>A. (4.9.4)(5).</p> <p>B. (4.9.2).</p>
Sinks	<p>A. Kitchen sink in Lounge does not provide proper knee clearance.</p> <p>B. S i n k i n Superintendent's Rest Room does not provide proper clear floor space (2nd floor).</p> <p>C. Sinks in Men's and Women's second floor Rest Rooms do not provide proper clear floor space.</p> <p>D. Exposed pipes exist underneath sinks in Men's and Women's 2nd floor Rest Rooms.</p>	<p>A. (4.24.3).</p> <p>B. (4.24.5).</p> <p>C. (4.24.5).</p> <p>D. (4.24.6).</p>

BUILDING NUMBER: 4200
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Marshall Street
1605 Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	A. Toilets in Men's, Women's, and Superintendent's Rest Rooms are not the proper height (2nd floor).	A. (4.16.3).
	B. Clear floor space is not provided in Women's or Superintendent's Rest Rooms (2nd floor).	B. (4.16.2).
	C. Grab bars do not exist in Men's, Women's, or Superintendent's Rest Rooms (2nd floor).	C. (4.16.4).
Toilet Stalls	A. Toilet stalls in Men's second floor Rest Room are not proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Men's second floor Rest Room do not provide 32" wide opening.	B. (4.17.5).
	C. Grab bars do not exist in stalls of Men's second floor Rest Room.	C. (4.17.6).
Mirrors	Mirrors over sinks in Men's, Women's, and Superintendent's second floor Rest Rooms are too high above floor.	(4.19.6).
Dispensers	Paper Towel Dispensers in Men's, Women's, and Superintendent's Rest Rooms are too high above floor.	(4.23.7).
Elevators	A. Hall Lantern with visual and audial signal is not provided.	A. (4.10.4).

BUILDING NUMBER: 4200
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Marshall Street
1605 Harbor Drive

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Elevators	B. Car Position Indicators are not provided.	B. (4.10.13).
	C. Call Button for Main Floor is not indicated by a Raised Star.	C. (4.10.12)(2).
	D. Proper floor plan is not provided in elevator car, and doorway does not provide 36" opening.	D. (4.10.9).
	E. Reopening device requires contact to reopen, and door does not remain open for at least twenty seconds.	E. (4.10.6).
	F. Braille characters on jambs of hoistway entrances are less than 2" high..	F. (4.10.5).
	Counters	A. Counters throughout Labs are too high above floor.
B. Control Room counters do not provide proper knee clearance.		B. (4.32.3).

BUILDING NUMBER: 4500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Two spaces exist, but both have signage too low. Access aisle between spaces should exist.	NOTE: No Public access; employees only. (4.6.3),(4.6.4).
Curb Ramp	<p>A. Does not exist where walkway to entrance and parking access aisle meet.</p> <p>B. Rear Exit Door of hallway by first floor Rest Rooms needs curb ramp where step exists at threshold.</p>	<p>A. (4.7.1).</p> <p>B. (4.7.1).</p>
Doors	<p>A. Main Entrance door (with bar) does not provide 32" wide opening, and threshold exceeds 1/2".</p> <p>B. First floor doorway leading to Rest Rooms does not provide 32" wide opening.</p> <p>C. Two doorways leading to first floor Women's Rest Room do not provide 32" wide opening.</p> <p>D. Two doorways leading to first floor Men's Rest Room do not provide 32" wide opening.</p> <p>E. Rear Exit Door of hallway by first floor Rest Rooms does not provide 32" wide opening.</p>	<p>A. (4.13.5)&(4.13.8).</p> <p>B. (4.13.5).</p> <p>C. (4.13.5).</p> <p>D. (4.13.5).</p> <p>E. (4.13.5).</p>

BUILDING NUMBER: 4500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	F. Doorways to Men's and Women's second floor Rest Rooms do not provide 32" wide opening.	F. (4.13.5).
	G. Two doorways of Bacteria Room do not provide 32" wide opening.	G. (4.13.5).
Sinks	A. Second floor Men's and Women's Rest Room sinks do not provide proper knee clearance.	A. (4.24.3).
	B. Sink in AAGC Room does not provide proper knee clearance.	B. (4.24.3).
Stairs	North and South stairway handrails are not continuous proper height.	(4.9.4)(5).
Doors	A. North and South stairway doors (top) do not provide 32" wide opening.	A. (4.13.5).
	B. Door opening force on North and South stairway (top) doors exceeds 5 LBF.	B. (4.13.11).
Drinking Fountains	A. Spout is too high above floor on first and second floor fountains.	A. (4.15.2).
	B. Proper knee clearance is not provided on first and second floor fountains.	B. (4.15.5)(1).
	C. First floor fountain does not provide clear floor space.	C. (4.15.5)(2).

BUILDING NUMBER: 4500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	Toilets in Men's and Women's first and second floor Rest Rooms are not the proper height.	(4.16.3).
Toilet Stalls	<p>A. There are no stalls in Men's and Women's first and second floor Rest Rooms that are the proper size and arrangement.</p> <p>B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.</p> <p>C. Grab bars do not exist in Men's and Women's second floor Rest Rooms, and are not behind toilets in Men's and Women's first floor Rest Rooms.</p>	<p>A. (4.17.3)&(4.16.2).</p> <p>B. (4.17.5).</p> <p>C. (4.17.6). Also (4.16.4).</p>
Urinals	Urinals in Men's first floor Rest Room have rims too high above floor.	(4.18.2).
Lavatories/Mirrors	<p>A. Exposed pipes exist underneath sinks in Men's and Women's first and second floor Rest Rooms.</p> <p>B. Mirrors in Men's and Women's first and second floor Rest Rooms are too high above floor.</p>	<p>A. (4.19.4).</p> <p>B. (4.19.6).</p>
Shower Stalls	<p>A. Grab bars do not exist in Men's and Women's first floor Rest Room shower.</p> <p>B. Curb exists at entrances to Men's and Women's first floor Rest Room showers.</p>	<p>A. (4.21.4).</p> <p>B. (4.21.7).</p>

BUILDING NUMBER: 4500
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: W.P.C./Northeast Plant
3290 S.R. 580

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	C. Proper seat is not provided in any stalls in Men's and Women's first floor Rest Room shower.	C. (4.21.3).
	D. Proper shower spray unit does not exist in any stall in Men's and Women's first floor Rest Room showers.	D. (4.21.6).
Accessible Route	Door to Women's shower stalls in first floor Shower Rest Room, does not provide minimum clear width of 36".	(3.3.3).
Elevators	A. Hall lantern is not provided. Visual and Audible Signal is not provided.	A. (4.10.4).
	B. Car position indicators are not provided.	B. (4.10.13).
	C. Call button for Main Floor is not indicated by a raised star.	C. (4.10.12)(2).
	D. Proper floor plan is not provided in elevator car.	D. (4.10.9).
	E. Reopening device requires contact to reopen, and device does not remain open for at least twenty seconds.	E. (4.10.6).
	F. Braille characters on jams of hoistway entrance are less than 2" high.	F. (4.10.5).

BUILDING NUMBER: 4600
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Nursery Building
901 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space, designated by a sign showing the symbol of accessibility, does not exist.	NOTE: No Public access; employees only. (4.6.2).
Doors	<p>A. Door to Men's Rest Room does not provide 32" opening.</p> <p>B. With refrigerator in present location, a clear width of 32" is not provided at Women's Rest Room door.</p>	<p>A. (4.13.5).</p> <p>B. (4.13.5).</p>
Accessible Route	Walkway leading from East office door is a rough surface where walkway and drive meet.	(4.5.1).
Water Fountains	<p>A. Spout on water fountain is 42-1/2" from ground.</p> <p>B. Water flow on fountain is toward rear.</p> <p>C. Fountain does not provide proper clear floor space (with counter in present location).</p>	<p>A. (4.15.2).</p> <p>B. (4.15.3).</p> <p>C. (4.15.5)(1).</p>
Toilet Stalls	<p>A. Both Men's and Women's Rest Rooms do not provide proper clear floor space.</p> <p>B. Toilets in both Men's and Women's Rest Rooms are not between 17" and 19" high.</p> <p>C. Grab bars do not exist in Men's or Women's Rest Rooms.</p>	<p>A. (4.17.3), (4.16.2).</p> <p>B. (4.16.3).</p> <p>C. (4.16.4).</p>
Urinal	Rim is 40" from floor.	(4.18.2).

BUILDING NUMBER: 4600
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Nursery Building
901 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Lavatories and Mirrors	A. Proper knee clearance is not provided at sinks in both Men's and Women's Rest Rooms. B. Sinks in Men's and Women's Rest Rooms have exposed water pipes underneath.	A. (4.19.2) (Figure 31). B. (4.19.4).
Sink	Utility sink has a rim 40" high and does not provide proper knee clearance.	(4.24.2). Also (4.24.3).
Reach Ranges	Towel dispenser next to utility sink exceeds forward or side reach maximums.	(4.2.6). Also (4.2.5).
Shower Stall	A. Curb into stall exceeds 1/2" height maximum. B. A shower spray unit with a hose 60" long, that can be used as a fixed head or hand-held shower, is not provided.	A. (4.21.7). B. (4.21.6).

BUILDING NUMBER: 4605
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Nursery/Chemical Storage
901 N. Saturn Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Does not exist via an accessible walkway. B. Does not exist from transportation (Bus Stop) to entrance.	NOTE: No Public access; employees only. A. (4.3.2)(2). B. (4.3.2)(1).

BUILDING NUMBER: 4620
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Parks Field Office
507 Vine Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking spaces, designated by a sign showing the symbol of accessibility, do not exist by Main Entrance or in Employee parking lot.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Doors	A. Minimum clear opening is not provided at opening from Sign Stock Room into hallway leading to Garage.	A. (4.13.5).
	B. Minimum clear opening is not provided at doorway leading to Men's Rest Room.	B. (4.13.5).
	C. Minimum clear opening is not provided at doorway to Men's Rest Room.	C. (4.13.5).
	D. Minimum clear opening is not provided at doorway leading to 2nd floor Records.	D. (4.13.5).
	E. Minimum clear opening is not provided at doorway from hall to Vending Machines.	E. (4.13.5).
	F. Minimum clear opening is not provided at doorway into McGill's office.	F. (4.13.5).
	G. Minimum clear opening is not provided at doorway to George's office.	G. (4.13.5).
	H. Minimum clear opening is not provided from George's office doorway into hall.	H. (4.13.5).
	I. Minimum clear opening is not provided at doorway leading to Storage Room (by front parking).	I. (4.13.5).
	J. Threshold at door to George's office, leading to parking, is greater than 1/2".	J. (4.13.8).

BUILDING NUMBER: 4620
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Parks Field Office
507 Vine Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	K. Threshold has 2" step on outside door with Mail Container.	K. (4.13.8).
	L. 7" curb exists at doorway to Storage Room (by parking).	L. (4.7.1).
	M. Thresholds on doorways (from parking) into building have 3" steps.	M. (4.13.8). Also (4.7.1).
Drinking Fountains	A. Fountain by Rest Rooms has spout 45" from floor.	A. (4.15.2).
	B. Fountain by George's office has spout 44" from floor.	B. (4.15.2).
	C. Fountain by Rest Rooms has water flow less than 4" high.	C. (4.15.3).
	D. Both drinking fountains do not provide clear knee space and/or clear floor space.	D. (4.15.5)(1). Also (4.15.5)(2).
Toilet Stalls	A. There are no stalls in Men's or Women's Rest Rooms that are accessible.	A. (4.17.3),(4.22.4).
	B. Stall doors in Men's Rest Room (22-1/2") and Women's Rest Room (22-3/4"), do not provide minimum clear opening.	B. (4.17.5). Also (4.13.5).
	C. Stall opening to urinal does not provide minimum clear opening.	C. (4.13.5).
	D. Doorway to Women's Rest Room does not provide a minimum clear opening.	D. (4.13.5).
	E. Opening to sink in Women's Rest Room does not provide a minimum clear opening.	E. (4.13.5).

BUILDING NUMBER: 4620
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Parks Field Office
507 Vine Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Water Closets	A. Grab bars do not exist in Men's or Women's Rest Rooms.	A. (4.16.4).
	B. Toilets in Men's and Women's Rest Rooms are 16-1/4" high.	B. (4.16.3).
Lavatories and Mirrors	A. Mirrors in Women's Rest Room (52") and Men's Rest Room (50"), are too high.	A. (4.19.6).
	B. Sinks in Men's and Women's Rest Rooms have exposed water pipes.	B. (4.24.6).

BUILDING NUMBER: 4645
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Pistol Range
2851 McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Ramps	Does not exist to Classroom (stairs exist), making Classroom not accessible to wheelchairs.	NOTE: No public access. (4.8.1)&(4.8.2).
Doors	A. Doorway to Rest Rooms in Classroom does not provide 32" wide opening.	A. (4.13.5).
	B. Threshold at Classroom double doors exceeds 1/2".	B. (4.13.8).
	C. Classroom double doors do not provide 32" wide opening.	C. (4.13.5).
	D. Threshold at door to outside Storage Shed exceeds 1/2"; (step exists).	D. (4.13.8).
Stairs	A. Stairway at rear of Classroom does not provide handrails, and has open risers.	A. (4.9.4). Also (4.9.2).
	B. Stairway at front entrance to Classroom does not provide handrails.	B. (4.9.4).
Sinks	Kitchen sink does not provide proper knee clearance.	(4.24.5).
Drinking Fountain	A. Fountain does not provide proper clear floor space.	A. (4.15.5)(2).
	B. Fountain has spout too high above floor.	B. (4.15.2).

BUILDING NUMBER: 4645
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Police Dept./Pistol Range
2851 McMullen Booth Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. Toilets in Men's and Women's Rest Rooms are not the proper height.	A. (4.16.3).
	B. There are no stalls in Men's and Women's Rest Rooms that are the proper size and arrangement.	B. (4.17.3).
	C. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	C. (4.17.5).
	D. Grab bars do not exist in stalls in Men's and Women's Rest Rooms.	D. (4.17.6).
Urinals	Urinal in Men's Rest Room has rim too high above floor.	(4.18.2).

BUILDING NUMBER: 4800
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Admin. Building
1650 N. Arcturas Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(15 Spaces) One accessible space exists but there are 134 employee spaces for all of Public Service, and none are accessible with proper signage.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Curb Ramp	A. Does not exist where walkway to Main Entrance meets parking access aisle. B. Rear exit door of hallway has step at threshold which needs proper curb ramp.	A. (4.7.1). B. (4.7.1).
Doors	A. Swing door at main counter has neither leaf that provides 32" wide opening.	A. (4.13.4).
Water Fountain	Proper knee clearance is not provided at fountain in Lobby.	(4.15.5)(1).
Counters	A. Front counter does not provide 36"x 36" area. B. Map Room counter is too high and should have a 36" x 36" area for persons in wheelchairs.	A. (7.2). B. (4.32.4)&(7.2).
Doors	Door opening force is too great on Men's and Women's Lobby Rest Room doors.	(4.13.11).
Sinks	A. Exposed pipes exist underneath sinks in Men's and Women's Rest Rooms. B. 19" depth of knee clearance is not provided underneath sinks in Men's and Women's Rest Rooms.	A. (4.24.6). B. (4.24.3).

BUILDING NUMBER: 4800
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Admin. Building
1650 N. Arcturas Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Sinks	C. Kitchen sink in Lounge does not provide proper knee clearance.	C. (4.24.3).
Toilet Stalls	A. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	A. (4.17.5).
	B. Grab bars do not exist behind toilets in Men's and Women's Rest Rooms.	B. (4.17.6).

BUILDING NUMBER: 4810
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Motor Shop&Stor.
1650 N. Arcturus Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	No accessible space exists by an entrance.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Curb Ramp	A. Does not exist at main front entrance door. B. Curb ramp at door into main Garage is not level in front of door and thus does not provide required maneuvering clearance.	A. (4.7.1). B. (4.13.6).
Doors	Doorway into main Garage has threshold exceeding 1/2".	(4.13.8).
Water Fountains	A. Fountain in Shop does not provide proper clear floor space. B. Fountain in Shop has spout too high above floor.	A. (4.15.5)(2). B. (4.15.2).
Sinks	A. Sink in Shop has mirror too high above floor. B. Sink in Shop does not provide proper knee clearance. C. Exposed pipes exist underneath sink in Rest Room.	A. (4.19.6). B. (4.24.3). C. (4.24.6).
Water Closets	Toilet in Rest Room is not the proper height.	(4.16.3).
Toilet Stalls	A. Stall doors in Rest Room do not provide 32" wide opening. B. There is no stall in Rest Room that is the proper size and arrangement.	A. (4.17.5). B. (4.17.3).

BUILDING NUMBER: 4810
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Motor Shop&Stor.
1650 N. Arcturas Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	C. Grab bars do not exist in any Rest Room stall.	C. (4.17.6).
Urinals	Urinals in Rest Room have rims too high above floor.	(4.18.2).
Shower Stalls	A. Curbs exist at Rest Room showers.	A. (4.21.7).
	B. Grab bars do not exist in Rest Room shower stalls.	B. (4.21.4).
	C. Proper seat is not provided in any stall.	C. (4.21.3).
	D. Proper shower spray unit is not provided in any stall.	D. (4.21.6).

BUILDING NUMBER: 4820
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Supervisors Bldg
1650 N. Arcturas Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	(12 Spaces) No accessible space exists by an entrance, with proper signage.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Curb Ramp	At curb ramp or beveled area in front of Main Entrance double door, ground area within the required maneuvering clearance in front of door is not level.	(4.13.6).
Doors	A. Double doors at Main Entrance have threshold exceeding 1/2".	A. (4.13.8).
	B. Threshold at rear double doors exceeds 1/2".	B. (4.13.8).
	C. Door opening force of Main Entrance door is too great.	C. (4.13.11).
	D. Rest Room door opening force at Men's and Women's Rest Rooms is too great.	D. (4.13.11).
Water Fountain	Water fountain by Vending Machines has spout too high.	(4.15.2).
Toilet Stalls	Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	(4.17.5).
Shower Stalls	A. Stall doorways do not provide 32" wide opening.	A. (4.13.5).

BUILDING NUMBER: 4820
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Supervisors Bldg
1650 N. Arcturas Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Shower Stalls	B. Proper seat is not provided in Rest Room shower stalls.	B. (4.21.3).
	C. Proper spray unit is not provided in Rest Room stalls.	C. (4.21.6).
	D. Curbs exist in Rest Room shower stalls at entrance to stalls.	D. (4.21.7).

BUILDING NUMBER: 4830
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Meter Shop
1650 N. Arcturas Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	No accessible space exists near entrance.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Doors	A. Threshold at South exit doors exceeds 1/2".	A. (4.13.8).
	B. Threshold at exit door of Paint Room exceeds 1/2".	B. (4.13.8).
	C. Main front door has threshold that exceeds 1/2" and does not provide 32" wide opening.	C. (4.13.8)&(4.13.5).
Curb Ramp	A. Does not exist where driveway and walkway to Main Entrance meet.	A. (4.7.1).
	B. Does not exist where walkway and driveway meet by Paint Room.	B. (4.7.1).
Water Fountains	A. Fountains in Shop and by Kitchen have spouts too high above ground.	A. (4.15.2).
	B. Fountains in Shop and by Kitchen do not provide proper knee clearance.	B. (4.15.5)(1).
	C. Fountain in Shop does not provide proper clear floor space.	C. (4.15.5)(2).
Sinks	A. Sink in Kitchen does not provide proper knee clearance.	A. (4.24.3).
	B. Sinks in Men's and Women's Rest Rooms do not provide proper knee clearance.	B. (4.24.3).

BUILDING NUMBER: 4830
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Public Service/Meter Shop
1650 N. Arcturas Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Mirrors	Mirrors in Men's and Women's Rest Rooms are too high above ground.	(4.19.6).
Toilet Stalls	A. There are no stalls in Men's and Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Men's and Women's Rest Rooms do not provide 32" wide opening.	B. (4.17.5).
	C. There are no grab bars in stalls of Men's and Women's Rest Rooms.	C. (4.17.6).
Urinals	Urinals in Men's Rest Room have rims too high above floor.	(4.18.2).

BUILDING NUMBER: 4910
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Purchasing/Storage
711 Maple Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	Threshold at double doors inside Storage exceed 1/2".	NOTE: No Public access; employees only. (4.13.8).
Stairs	Handrails on stairs to dock are not the proper height.	(4.9.4).
Accessible Route	Does not exist to dock or storage area, since no ramp exists; (only stairs).	(4.3.2)(2).

BUILDING NUMBER: 5005
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Recreation Facilities Office
509 Pennsylvania

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	An accessible parking space designated by a sign showing the symbol of accessibility, does not exist.	NOTE: No Public access; employees only. (4.6.2), (4.6.3), (4.6.4).
Stairs	Open risers exist on both stairways leading up to dock.	(4.9.2).
Water Fountains	A. Fountain on rear dock has 43" spout above floor.	A. (4.15.2).
	B. Water flow on inside and outside fountains has water flow directed toward back of fountain.	B. (4.15.3).
Stairs	Stairway leading into Stock Room (hoses, etc.), has handrail on one side.	(4.9.4).
Doors	A. Threshold of door (off Dock) to Supervisor's Office is greater than 1/2".	A. (4.13.8).
	B. Threshold of doorway (with gate) by Docks to Mower Storage is greater than 1/2".	B. (4.13.8).
	C. Minimum clear opening is not provided at doorway to Rest Rooms.	C. (4.13.5).
Sinks	A. Knee clearance is not provided underneath kitchen sink.	A. (4.24.3).
	B. Knee clearance is not provided underneath utility sink in "Dungeon".	B. (4.24.3).
Toilet Stalls	A. There is no stall in Rest Room that is accessible with proper floor space.	A. (4.17.3). Also (4.22.4).
	B. Stall doors (23" wide) do not provide a minimum clear opening.	B. (4.17.5). Also (4.13.5).

BUILDING NUMBER: 5005
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Recreation Facilities Office
509 Pennsylvania

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Urinal	Urinal is 20" from floor to rim.	(4.18.2).
Water Closets	A. Grab bars do not exist in Rest Room.	A. (4.16.4).
	B. Toilets are 15-1/2" from floor to top of seat.	B. (4.16.3).
Shower Stalls	A. Stall size (30" x 32") is too small to be accessible.	A. (4.21.2).
	B. 9" curb exists at stall entrance.	B. (4.21.7).
	C. Doorway to stall is 24" wide.	C. (4.13.5).
	D. Showerhead is at 73" from floor.	D. (4.21.6). Also (4.21.5).
	E. Seat is not provided in stall.	E. (4.21.3).

BUILDING NUMBER: 5017
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Ross Norton/PAL Building
1440 S. Greenwood Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

NOTE: No Public access;
employees only.

BUILDING NUMBER: 5035
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sand Key Bridge Tender
Clearwater Pass

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	A. Curb exists between walkway and doorway to Booth.	NOTE: No Public Access. (4.3.2)(1).
	B. Does not exist to bottom floor for a person in a wheelchair.	B. (4.3.2)(2).
Stairs	A. Stair treads are less than 11" wide. Open risers exist.	A. (4.9.2).
	B. Handrails on stairs leading to lower floor are not proper height.	B. (4.9.4)(5).
Toilet	A. Proper clear floor space in front of toilet does not exist.	A. (4.16.2).
	B. Grab bars do not exist.	B. (4.16.4). Also (4.26).
Sink	A. Exposed hot water and drain pipes exist underneath sink on lower level.	A. (4.24.6).
	B. Clear floor space in front of sink does not exist.	B. (4.24.5).
Counter (Controls)	Proper knee clearance is not provided at Bridge Control Counter.	(4.32.3).

BUILDING NUMBER: 5040
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sand Key Toll Booth
Clearwater Pass

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	<p>A. Does not exist from Employee Parking across island to Toll Booth.</p> <p>B. Does not exist from Rest Rooms across island to Toll Booth.</p>	<p>NOTE: No Public access; employees only. A. (4.3.2)(1)(2).</p> <p>B. (4.3.2)(2).</p>
Space Allowance	<p>Proper clear floor space is not provided inside Toll Booth.</p>	(4.2).
Doors	<p>A. Threshold of doorway to 950 Building exceeds 1/2".</p> <p>B. Doorway at entrance to Toll Booth does not provide 32" opening.</p> <p>C. Threshold at doorway to Toll Booth exceeds 1/2".</p>	<p>A. (4.13.8). Also (4.7.1).</p> <p>B. (4.13.5).</p> <p>C. (4.13.8). Also (4.7.1).</p>
Telephone	<p>Public Telephone Booth is not Hearing Aid compatible with proper volume control. Also, proper clear floor space is not provided inside Booth, nor is 32" opening provided at Booth doorway.</p>	<p>(4.31.5)(1)(2). Also (4.31.2) and (4.13.5). See Cover Sheet.</p>
Drinking Fountain	<p>A. Fountain inside 950 Building has a spout 42" from ground.</p> <p>B. Fountain inside 950 Building does not provide clear floor space or proper knee space.</p>	<p>A. (4.15.2).</p> <p>B. (4.15.5).</p>
Water Closets	<p>A. Toilet is not the proper height (950 Building).</p> <p>B. Clear floor space is not provided in front of toilet (950 Building).</p>	<p>A. (4.16.3).</p> <p>B. (4.16.2).</p>

BUILDING NUMBER: 5040
TARGET DATE: 1994
COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sand Key Toll Booth
Clearwater Pass

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	Doorway to Rest Room does not provide 32" opening (950 Building).	(4.13.5).
Lavatories Mirrors	and Exposed water pipes underneath sink exist (950 Building).	(4.19.4).

BUILDING NUMBER: 5065
 TARGET DATE: 1994
 COMPLETED DATE: 00/00/00

BUILDING LOCATION: Sign Shop/Traffic Engineering
410 N. Myrtle Avenue

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	<p>A. Main Entrance door has a 6" curb and does not provide a proper curb ramp.</p> <p>B. Door into Garage has a 2" step at threshold.</p> <p>C. Threshold at double doors between Office and Garage exceeds 1/2".</p>	<p>NOTE: No Public access; employees only. (4.13.8). Also (4.7).</p> <p>B. ((4.13.8). Also (4.5.2).</p> <p>C. (4.13.8).</p>
Sinks	<p>Utility sink in Rest Room does not provide proper knee clearance.</p>	(4.24.3).
Counters and Desks	<p>Desks and counters in Office do not provide proper knee clearance.</p>	(4.32.3).
Urinal	<p>Urinal in Rest Room is not accessible with sink in present location.</p>	(4.18.3).
Shower Stall	<p>A. Shower stall in Rest Room is not the proper size.</p> <p>B. Curb of stall exceeds 1/2" in height.</p> <p>C. A proper shower spray unit is not provided.</p>	<p>A. (4.21.2).</p> <p>B. (4.21.7).</p> <p>C. (4.21.6).</p>

BUILDING NUMBER: 5070
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste/Recycle
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Accessible Route	Does not exist into Recycle Trailer for persons in wheelchairs.	NOTE: No Public access; employees only. (4.3.2)(1)&(2).
Doors	Threshold at doorway to Recycle Trailer exceeds 1/2".	(4.13.8).
Sink	Sink in Recycle Trailer does not provide proper knee clearance.	(4.24.3).
Water Closets	Toilet in Recycle Rest Room is not the proper height.	(4.16.3).
Doors	Rest Room door in Recycle Trailer does not provide 32" wide opening.	(4.13.5).
Toilet Stalls	A. Rest Room in Recycle Trailer does not provide proper size and arrangement. B. Grab bars do not exist in Recycle Trailer Rest Room.	A. (4.17.3). (4.17.6).
Lavatories and Mirrors	A. Exposed pipes underneath sink exist in Recycle Rest Room. B. Mirror over sink in Recycle Rest Room is too high above floor.	A. (4.19.4). B. (4.19.6).
Dispensers	Paper towel dispenser in Recycle Rest Room is too high above floor.	(4.23.7).

BUILDING NUMBER: 5075
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste Division
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Parking	Accessible parking space, designated by a sign showing the symbol of accessibility, does not exist.	NOTE: No modifications at this time; UFAS, 4.1.6, (Exceptions). (4.6.4).
Accessible Route	Does not exist into Solid Waste Administration Trailer, for persons in wheelchairs.	(4.3.2)(1)&(2).
Water Closet	Grab bars do not exist behind toilet in Administration Trailer Rest Room.	(4.16.4).
Lavatories and Mirrors	A. Exposed pipes exist underneath sink in Administration Trailer Rest Room.	A. (4.19.4).
	B. Mirror over sink in Administration Trailer is too high from floor.	B. (4.19.6).
Dispensers	Paper towel dispenser in Administration Trailer is too high above floor.	(4.23.7).
Drinking Fountain	A. Spout on fountain in Administration Trailer is too high above floor.	A. (4.15.2).
	B. Water flow is directed toward rear on fountain in Administration Trailer.	B. (4.15.3).
	C. Clear floor space is not provided in front of fountain in Administration Trailer.	C. (4.15.5)(2).

BUILDING NUMBER: 5075
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste Division
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	A. Thresholds at doors to Operations Building are greater than 1/2".	A. (4.13.8).
	B. Thresholds at North doors of Operations Building are greater than 1/2".	B. (4.13.8).
	C. Doorway between Operations and Break Room does not provide 32" wide opening.	C. (4.13.5).
	D. Doorway of Operations Women's Rest Room does not provide 32" wide opening.	D. (4.13.5).
	E. Threshold at doorway to Administration exceeds 1/2"; (step).	E. (4.13.8).
Water Fountains	A. Fountain in Operations has spout too high above floor.	A. (4.15.2).
	B. Fountain in Operations has water directed toward rear.	B. (4.15.3).
	C. Fountain in Operations does not provide proper clear floor space.	C. (4.15.5)(2).
Fixed Tables	Tables in Operations Break Room do not provide proper knee clearance.	(4.32.3).
Stairs	Handrails on stairs to Administration Trailer are only on one side of stairs.	(4.9.4)(1).
Water Closets	Toilets in Operations Men's and Women's Rest Rooms are not the proper height.	(4.16.3).

BUILDING NUMBER: 5075
 TARGET DATE: 1993
 COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste Division
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Toilet Stalls	A. There are no stalls in Operations Men's or Women's Rest Rooms that are the proper size and arrangement.	A. (4.17.3).
	B. Stall doors in Operations Men's and Women's Rest Rooms do not provide 32" wide opening.	B. (4.17.5).
	C. Grab bars do not exist in any stalls in Operations Men's or Women's Rest Rooms.	C. (4.17.6).
Dispensers	Paper towel dispensers in Operations Men's and Women's Rest Rooms are too high above floor.	(4.23.7).
Lavatories and Mirrors	A. Mirrors above sinks in Operations Men's and Women's Rest Rooms are too high above floor.	A. (4.19.6).
	B. Exposed pipes underneath sinks exist in Operations Men's and Women's Rest Rooms.	B. (4.19.4).
Sinks	Sinks in Operations Men's and Women's Rest Rooms do not provide proper knee clearance.	(4.24.3).
Shower Stalls	A. Curbs exist at entrances to shower stalls in Operations Men's and Women's Rest Rooms.	A. (4.21.7).
	B. Doorways to shower stalls in Operations Men's and Women's Rest Rooms do not provide 32" wide opening.	B. (4.13.5).

BUILDING NUMBER: 5075
TARGET DATE: 1993
COMPLETED: 00/00/00

BUILDING LOCATION: Solid Waste Division
1180 Russell Street

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
	C. Proper spray unit is not provided in Operations Men's and Women's Rest Room shower stalls.	C. (4.21.6).
	D. Proper seat is not provided in shower stalls of Operations Men's and Women's Rest Rooms.	D. (4.21.3).
	E. There are no shower stalls with proper size and clearances in Operations Men's and Women's Rest Rooms.	E. (4.21.2).

BUILDING NUMBER: 5080
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: South Pavilion Garage
Clearwater Beach

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
---------	----------------	--------------

NOTE: No Public access;
employees only.

BUILDING NUMBER: 7000
TARGET DATE: 1994
COMPLETED: 00/00/00

BUILDING LOCATION: Transfer Station/Trailers
1005 Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Stairs	<p>A. Stairs into Trailer (Break Room) have open risers and non-uniform risers.</p> <p>B. Handrails on stairs are not proper height, or continuous on both sides.</p>	<p>NOTE: No Public access; employees only. A. (4.9.2).</p> <p>B. (4.9.4)(1-7).</p>
Accessible Route	Without ramp to Trailer, Break Room is not accessible.	(4.3.2)(2). Also (4.8).
Drinking Fountains	Fountain in Break Room has spout too high.	(4.15.2).
Doors	Threshold at doorway to shed in Trailer area has a slope exceeding 1:2.	(4.13.8). Also (4.5.2).

BUILDING NUMBER: 7010
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Transfer Station/Scalehouse
1005 Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	<p>A. Doorway to Rest Room does not provide 32" wide opening.</p> <p>B. Front entrance door has a 4" step.</p> <p>C. Counter on office door is too high off ground.</p>	<p>NOTE: No Public access; employees only. A. (4.13.5).</p> <p>B. (4.13.8).Also (4.5.2).</p> <p>C. (7.2).</p>
Drinking Fountains	<p>A. Fountain does not provide proper clear floor space with present position by doorway.</p> <p>B. Fountain has spout too high from ground.</p>	<p>A. (4.15.5)(2).</p> <p>B. (4.15.2).</p>
Tables	<p>Outside Picnic Table does not provide proper knee clearance. Also desk in office.</p>	<p>(4.32.3).</p>
Water Closets	<p>A. Clear floor space is not provided for wheelchair accessibility.</p> <p>B. Toilet is not the proper height.</p> <p>C. Grab bars do not exist in Rest Room.</p>	<p>A. (4.16.2).</p> <p>B. (4.16.3).</p> <p>C. (4.16.4).</p>
Dispensers	<p>Paper towel dispenser is too high.</p>	<p>(4.23.7).</p>

BUILDING NUMBER: 7020
 TARGET DATE: 1994
 COMPLETED: 00/00/00

BUILDING LOCATION: Transfer Station
1005 Coachman Road

-- INDIVIDUAL FEATURES OF THE FACILITY WHICH MUST BE RENOVATED --

ELEMENT	EXISTING STATE	ADA STANDARD
Doors	<p>A. Threshold at doorway to Utility Shed has a rough-finished slope exceeding 1:2.</p> <p>B. Threshold at Rest Room exceeds 1/2".</p> <p>C. Door to Operation Room has a 3" step.</p>	<p>NOTE: No Public access; employees only. A. (4.13.8). Also (4.5.2).</p> <p>B. (4.13.8).</p> <p>C. (4.13.8).</p>
Reach Ranges	Control Panel in Operation Room exceeds proper reach ranges.	(4.2.5).
Urinal	Urinal has rim higher than 17" above floor.	(4.18.2).
Dispensers	Paper towel dispenser in Rest Room is too high off the floor.	(4.23.7).
Toilet Stalls	<p>A. No stalls in Rest Room provide proper size and arrangement.</p> <p>B. Grab bars do not exist in any stall.</p> <p>C. Toilets are not the proper height.</p>	<p>A. (4.17.3).</p> <p>B. (4.17.6).</p> <p>C. (4.16.3).</p>
Lavatories and Mirrors	<p>A. Mirror is too high from the floor.</p> <p>B. Exposed water pipes exist underneath sinks.</p>	<p>A. (4.19.6).</p> <p>B. (4.19.4).</p>
Drinking Fountain	<p>A. Drinking fountain in Rest Room does not provide proper knee clearance or clear floor space.</p> <p>B. Drinking fountain in Rest Room has a spout too high from the floor.</p>	<p>A. (4.15.5)(1)&(2).</p> <p>B. (4.15.2).</p>

CITY OF CLEARWATER

Interdepartmental Correspondence Sheet

To: Honorable Mayor and Members of the City Commission
From: H. Michael Laursen, Human Resources Director
Via: Kathy Rice, Deputy City Manager
Subject: Americans with Disabilities Act (ADA) - Employment Process
Date: September 1, 1992

The ADA, often referred to as the most comprehensive civil rights measure since the Civil Rights Act of 1964, prohibits discrimination against the disabled in employment practices, as well as in public transportation, accommodations, and telecommunications relay services.

With respect to employment practices ADA prohibits discrimination against a qualified individual with a disability. A qualified individual is someone who can perform the essential functions of a job, with or without reasonable accommodations.

The Human Resources Department is directing efforts at insuring compliance with employment provisions of the ADA. Attached are documents which we have developed and are now refining which will enable the City to appropriately define essential job functions and to determine the working conditions, equipment utilized, and abilities related to fulfilling the essential functions of each position. The same information will be utilized in evaluation of what is reasonable accommodation.

Training is being developed and will be provided by the Human Resource Department staff to city management and supervisory personnel. This training will cover the basics of ADA as well as preparation and use of the specific Human Resource Department forms which are attached. The training and forms usage will commence within the next several weeks.

The information as to the essential functions will also be utilized by our medical examiners for the medical examination which occurs after a job offer is made and prior to the commencement of employment duties.


HML

**CITY OF CLEARWATER
HUMAN RESOURCES DEPARTMENT**

COMPLIANCE WITH THE AMERICANS WITH DISABILITIES ACT

The Americans with Disabilities Act (ADA) prohibits employers from discriminating against a qualified individual with a disability who can perform the "essential functions" of the job with or without reasonable accommodations. The ADA defines a person with a disability as a person with a physical or mental impairment that substantially limits that person in some major life activity, a person with a record of such a physical or mental impairment, or a person who is regarded as having an impairment.

ESSENTIAL FUNCTIONS

The determination of which job functions are essential is critical to the determination of whether or not an applicant with a disability is qualified. The essential functions of a job are those functions that the individual who holds the position must be able to perform unaided or with the assistance of a reasonable accommodation. A disabled applicant cannot be disqualified on the basis of needing a reasonable accommodation to perform the essential functions or on the basis of an inability to perform non-essential functions of the position.

Whether a particular job function is essential or not initially focuses on whether the employer actually requires employees in the position to perform the function. For example, an employer may state that taking dictation is an essential function of a position; however, if this task has never been performed by an employee in the position, this will be evidence that it is not actually an essential function of the position. If employees in the particular position have actually performed a function that the employer asserts is an essential function, then it must be determined whether removing the function would fundamentally alter the position.

Whether a particular function is essential is a factual determination that must be made by the employer on a case-by-case basis after considering one or more of the following factors listed in the ADA regulations:

- 1) whether the reason the position exists is to perform that function;
- 2) the number of other employees available to perform the function or among whom the performance of the function can be distributed;
- 3) the degree of expertise or skill required to perform the function;
- 4) the actual work experience of present or past employees in the job;
- 5) the time spent performing the function;
- 6) the consequences of not requiring that an employee perform a function; and
- 7) the terms of a collective bargaining agreement.

The first factor is whether the position exists to perform a particular function. For example, a proofreader position would include the ability to proofread documents as an essential function since this is the only reason the position exists.

The second factor in determining whether a function is essential concerns the number of other employees available to perform that job function or among whom the function could be distributed. This may be a factor either because the total number of available employees is low, requiring each employee to perform many different functions, or because the fluctuating demands of the business operation limit the feasibility of reassigning tasks or reorganizing the work. The workflow cycle may require employees to perform many functions during peak periods, limiting the employers flexibility in reorganizing operations.

Another factor is the degree of expertise or skill required to perform the function. In certain professional or highly-skilled positions, employees are hired for their expertise or ability to perform the particular function. In such cases, those specialized job tasks would be essential functions.

The fourth factor concerns the work experience of past employees in the job or of current employees in similar jobs. For example, if former employees in a position have used a cash register, this would be evidence that operating a cash register is an essential function. While past work experience is important, the essential functions of a particular position can change for valid business reasons.

The actual time spent performing various job functions is another important factor to consider in determining whether a function is essential. If the vast majority of work time is spent driving a particular type of equipment, this is evidence that operation of the equipment is an essential function.

A sixth factor referenced in the ADA regulations concerns the consequences of not requiring an employee to perform the function. For example, although a Firefighter is rarely required to carry an unconscious adult out of a burning building, the consequences of failing to require a Firefighter to be able to perform this function would be serious.

The seventh factor to consider in determining whether job functions are essential may be the negotiated terms of a collective bargaining agreement that restricts the employer's ability to reassign job tasks, restructure procedures, or reorganize operations.

REASONABLE ACCOMMODATIONS

The ADA prohibits employers from discriminating against a qualified applicant with a disability when a "reasonable accommodation" can be made to assist the individual in fulfilling the essential functions of the position. In general, an accommodation is any change in the work environment or in the way things are customarily done that enables a qualified individual with a disability to enjoy equal employment opportunities. An accommodation will be considered reasonable under provisions of the ADA if it does not cause an undue hardship by being exceptionally costly, extensive, or disruptive or fundamentally alter the nature of the program. In many instances, job restructuring, adjusted work schedules, revised work procedures, the acquisition or modification of equipment, and making work areas accessible can be accomplished without significant difficulty or expense.

A reasonable accommodation should be tailored to the needs of the individual and the requirements of the job. Persons with disabilities have vast experience in all aspects of their lives with the types of accommodations that are effective for them. Employers should not assume that accommodations are required to perform the essential functions of a position without consulting the applicant or employee with the disability. While many requested accommodations may be considered reasonable, the ADA does not require an employer to make any modification, adjustment, or change in a position description or policy that it can demonstrate would fundamentally alter the essential functions of the relevant job. The Human Resources Director and the director of the hiring department are responsible for determining the essential functions of each position and, if necessary, whether accommodations requested by applicants will be considered reasonable.

Since the specific working conditions and essential functions may vary from one position to another, the legal requirements of the ADA affect each position individually and cannot be broadly applied to the entire job classification. For example, two separate warehouse operations may require two Storeskeeper positions. While many essential functions could apply

to both positions, one warehouse may be located on a single level, while the other has an additional second floor storeroom which is only accessible by stairs. The different working conditions and physical demands of the two Storeskeeper positions may affect the capacity of some disabled applicants to fulfill certain essential functions of one Storeskeeper position but not the other. A proposed accommodation involving the installation of an elevator or wheelchair lift in the two-story warehouse may need to be evaluated to determine if it is reasonable. However, if the multi-story warehouse required two or more employees, it is possible that some tasks could be reassigned, eliminating an essential function for one of the warehouse positions that some disabled applicants could not perform. The requirements of each position must be determined independently based upon individual circumstances of the particular job.

POSITION ASSESSMENT FORM

To assist qualified applicants in determining whether they can perform a particular job, with or without accommodation, the hiring department must complete the Position Assessment Form. The incumbent, supervisor, or individual(s) most familiar with the position should complete the questionnaire, relating their responses exclusively to the performance of the essential functions of the position.

Sections A and B of the Position Assessment Form are used to gather position identification information and provide general information concerning ADA compliance and related employment provisions. A position control numbering system will be developed in the near future to better identify each budgeted City position.

The "List of Essential Functions" included in Section C requires the hiring department to list major job responsibilities assigned to the position and identify the essential functions or tasks necessary to fulfill each responsibility. The following example of a Library Clerk position, while incomplete, illustrates how this section is to be completed:

List of Essential Functions:

Identification

Number

Description of Responsibility

1. Prepares library books for inventory.

Essential functions to fulfill this responsibility:

- a. Affix labels to books.
- b. Put plastic covers on books.
- c. Separate books for proper distribution.

2. Updates automated inventory records system of library books.

Essential functions to fulfill this responsibility:

- a. Assign bar codes and book item information.
- b. Enter inventory data into computer system.

3. Restocks library books and materials.

Essential functions to fulfill this responsibility:

- a. Transport books and materials to proper area of library.
- b. Put books and materials in proper location on library shelves.

In this example, seven essential functions have been listed with the "Identification Numbers" 1a, 1b, 1c, 2a, 2b, 3a and 3b. These essential function (EF) identification numbers will be referenced in other sections of the Position Assessment Form.

Section D, "Working Conditions." of the Position Assessment Form gathers information concerning the typical amount of work place exposure to a variety of environmental conditions while performing all of the essential functions of the position. The performance of non-essential functions of the job should not be considered. The hiring department must indicate the relative frequency that the working condition is typically encountered (never, occasionally, moderately, or frequently). For those working conditions that an employee is subject to, the department must relate the working condition to each applicable essential function by specifying the essential function identification numbers (EF #'s) from Section C.

For example, of the first four working conditions listed in Section D, "Never" has been indicated for working conditions 1, 2, and 4. The fact that the air conditioning system at the library may occasionally malfunction is not typical and should not result in "Occasionally" as a response for working condition number 4 "Indoors/NOT air-conditioned." Working condition Number 3 "Indoors/air conditioned" has typically been experienced "Frequently" while performing the essential functions. Next to "Specify EF#," all seven essential function numbers have been listed since all of these tasks are completed inside an air-conditioned indoor environment.

Working Conditions:

		Never	Occa- sionally	Moder- ately	Fre- quently
1	Outdoors/exposed to the elements Specify EF#:	X			
2	Outdoors/shaded or sheltered Specify EF#:	X			
3	Indoors/air conditioned Specify EF#: 1a, 1b, 1c, 2a, 2b, 3a, 3b				X
4	Indoors/NOT air conditioned Specify EF#:	X			

Section E, "Licensing, Registration, or Certification." provides for a list of credentials required to perform the essential functions. For example, any commercial driver's licenses, police or firefighter certifications, professional engineer registrations, etc., that are absolutely required to perform an essential function should be listed. In some instances, the credential is required of new hires, while in others an employee must obtain it within a specified period of time. Do not list any credentials that are desirable but not mandatory. A Library Clerk with a driver's license occasionally may use an automobile to deliver books or materials to a branch facility; however, since this task was not identified as an essential function, a license to operate a motorized vehicle should not be listed in this section.

Section F, "Equipment." provides for a list of office equipment, tools, machinery, automotive equipment, and protective safety equipment that is used while performing the essential functions of the position. For example, to fulfill the essential functions, a Library Clerk may use a typewriter, computer terminal, optical reader machine, and some small non-powered hand tools used while repairing the binding of books. A Library Clerk also occasionally may use a microfilm reader/printer and some audio/visual equipment; however, this equipment is not used while performing the essential functions identified for this position and should not be listed in Section F.

Section G, "Abilities." provides for an assessment of whether and to what extent various abilities are typically required to perform all of the essential functions of the position over a lengthy period of time. For example, of the first four abilities listed, a Library Clerk position may require the following for the essential functions listed:

Abilities:

		Never	Occa- sionally	Moder- ately	Fre- quently
1	Sit (excludes driving) Specify EF#: 1a, 1b, 1c, 2a, 2b			X	
2	Stand Specify EF#: 3b		X		
3	Walk: Distance: Max <u>100</u> ft.; Avg <u>30</u> ft. Specify EF#: 3a		X		
4	Run: Distance: Max _____ ft.; Avg _____ ft. Specify EF#:	X			

Try to be consistent in accessing the relative frequency that abilities are used. For instance, a position cannot require an employee to both sit and stand frequently. The intent of this section is to provide an indication of the type and frequency that various abilities typically will be used while fulfilling all of the essential functions of this particular position.

Section H, "Comments and Signatures." provides for the signature of the person completing the form. If an employee in the position is capable of properly completing the Position Assessment Form, it generally is preferable to have the incumbent complete the questionnaire and have the supervisor review it for accuracy. If the position is vacant or the incumbent may have difficulty making the required assessments accurately, the supervisor or individual most familiar with the position should complete the form. The Division Manager and Department Director also should review all responses and make any clarifying comments prior to signing and forwarding the Position Assessment Form to the Human Resources Department.

INTERVIEW AND EMPLOYMENT PROCESS

Prior to filling any vacant position (permanent, temporary, emergency, full-time, part-time, seasonal, and exempt), the hiring department must submit an Employment Request Form and a completed Position Assessment Form to the Human Resources Department. The only exceptions are temporary hires from an employment agency. The Human Resources Department will review the contents of the Position Assessment Form to ensure compliance with provisions of the ADA. Upon approval, the completed Position Assessment Form will be provided to each qualified applicant certified for the vacant position. Prior to their interview, the applicants must review the list of essential functions and the other sections of the Position Assessment Form and check the appropriate box on the "Candidate Questionnaire" indicating their ability, inability, or need for accommodations in fulfilling all of the essential functions of the position.

If the interviewee is unable to read or understand the contents of the form, the department should provide some assistance. No discussion of physical disabilities or accommodations which may or may not be available should be conducted with the applicant at this time. Decisions concerning whether or not requested accommodations are "reasonable" will be made after review by the hiring department and the Human Resources Director.

Upon completion of the interview process, the hiring authority should select the applicant who is best suited for the position, regardless of any irrelevant disability or need for reasonable accommodations to fulfill the essential functions of the position. Hiring decisions affecting disabled applicants will be reviewed to ensure compliance with provisions of the ADA.

Selected applicants can be offered employment contingent upon passing a medical examination related to their ability to fulfill all essential functions of the position. The Doctor's Walk-In Clinic will be provided with a copy of the Position Assessment Form and any reasonable accommodations that are approved to assist the medical staff in making this important determination. An employee's job performance also should be evaluated during the probationary period. An employee's failure to satisfactorily fulfill the essential functions of a position should be discussed with the Human Resources Director.

Because of the comprehensive legal requirements and significant financial ramifications associated with failure to comply with the ADA, the Human Resources Department will provide guidance to hiring departments in the identification of essential functions for each vacant position. Please contact the Human Resources Director if you have any questions concerning compliance with the Americans with Disabilities Act.

CITY OF CLEARWATER
HUMAN RESOURCES DEPARTMENT
POSITION ASSESSMENT FORM

A. Identification Information:

Job Classification Title: _____ Date _____
Position Control Number: _____ Pay Grade _____
Previous Incumbent's Name: _____
Department: _____
Division: _____
Section: _____
Primary Work Site: _____
Normal Work Schedule: _____
Supervisor's Name: _____
Supervisor's Classification: _____
Division Manager's Name: _____

B. General Information:

The Americans with Disabilities Act (ADA) prohibits employers from discriminating against a qualified applicant with a physical or mental disability who can perform the "essential functions" of a particular position with or without reasonable accommodations. The essential functions of a job are those functions that the individual who holds the position must be able to perform unaided or with the assistance of reasonable accommodations. Factors to consider in determining if job functions are essential include: 1) whether the reason the position exists is to perform that function; 2) the number of other employees available to perform the function or among whom the performance of the function can be distributed; 3) the degree of expertise or skill required to perform the function; 4) the actual work experience of present or past employees in the job; 5) the time spent performing the function; 6) the consequences of not requiring that an employee perform a function; and 7) the terms of a collective bargaining agreement.

The ADA prohibits employers from discriminating against a qualified applicant with a disability when a "reasonable accommodation" can be made which would permit the individual to fulfill all essential functions of the position. A reasonable accommodation would be an action which does not create an undue hardship by being exceptionally costly, extensive, or disruptive or fundamentally alter the nature of the program. Requests for accommodations, such as work place modifications, acquiring or converting equipment, changing work schedules, job restructuring, or revising operations will be considered on a case by case basis.

To comply with provisions of the ADA, the incumbent, supervisor or individuals most familiar with this position will complete the Position Assessment Form identifying the essential functions of the job. Additional information is requested concerning the normal working conditions of the job; any licenses, registrations, and certifications required; the equipment operated; and the specific abilities exercised while performing all of the essential functions of the position. A completed Position Assessment Form and an Employment Request must be submitted to the Human Resources Department for review and approval for each position vacancy to be filled.

Applicants certified to interview for this position will review the information on the Position Assessment Form and complete the candidate questionnaire indicating their ability to perform the essential functions of the position, with or without specific requested accommodations. The Position Assessment Form also will be used to assist the medical staff in evaluating the selected applicant's ability to fulfill the essential functions of the position. Please contact the Human Resources Director if you have any questions concerning compliance with the Americans with Disabilities Act.

CITY OF CLEARWATER
POSITION ASSESSMENT FORM

C List of Essential Functions:

Classification Title: _____ Position Control Number: _____

Date: _____ Department: _____ Division: _____

Instructions: To assist in identifying all of the essential functions of this job, the Position Assessment Form organizes fundamental tasks by major responsibility groups. For each assigned job responsibility listed for Identification Numbers 1, 2, 3, etc., identify the essential functions or tasks next to a, b, c, etc., that are necessary to fulfill the responsibility. Use additional pages if necessary to identify all of the essential functions of this position.

Identification
Number

Description of Responsibility

1. _____

Essential functions to fulfill this responsibility:

a. _____

b. _____

c. _____

2. _____

Essential functions to fulfill this responsibility:

a. _____

b. _____

c. _____

**Identification
Number**

Description of Responsibility

3. _____

Essential functions to fulfill this responsibility:

- a. _____

- b. _____

- c. _____

4. _____

Essential functions to fulfill this responsibility:

- a. _____

- b. _____

- c. _____

5. _____

Essential functions to fulfill this responsibility:

- a. _____

- b. _____

- c. _____

C. List of Essential Functions (Cont.):

Position Control Number: _____

Identification
Number

Description of Responsibility

Essential functions to fulfill this responsibility:

- a. _____

- b. _____

- c. _____

Essential functions to fulfill this responsibility:

- a. _____

- b. _____

- c. _____

Essential functions to fulfill this responsibility:

- a. _____

- b. _____

- c. _____

D. WORK CONDITIONS

Place an "X" in the column that indicates the typical amount of workplace exposure while performing all of the essential functions of this position. For those working conditions that an employee is subject to, please specify the applicable essential function (EF) identification number(s) from the list of essential functions on the previous page.

		Never	Occasionally	Moderately	Frequently
1	Outdoors /exposed to the elements Specify EF#:				
2	Outdoors /shaded or sheltered Specify EF#:				
3	Indoors/air conditioned Specify EF#:				
4	Indoors/NOT air conditioned Specify EF#:				
5	Inside vehicle/NOT air conditioned Specify EF#:				
6	Inside vehicle/air conditioned Specify EF#:				
7	Wetness-contact with water (does not include rain) Specify EF#:				
8	Uneven terrain or surfaces Specify EF#:				
9	Slippery walking surface Specify EF#:				
10	Loud noise Specify EF#:				
11	Working alone Specify EF#:				
12	Close proximity to co-workers (less than 3 ft apart) Specify EF#:				
13	Poor ventilation Specify EF#:				
14	Confined spaces and/or cramped bodily conditions Specify EF#:				
15	Working underground, trenches, tunnels Specify EF#:				
16	Heights (ladders, platforms, etc, over 3 feet) Specify EF#:				
17	Vibrations (arms, legs, torso) Specify EF#:				
18	Poor lighting, dark environment Specify EF#:				
19	Risk of serious/life threatening bodily injury Example of injury _____ Specify EF#:				
20	Risk of slight bodily injury Example of injury _____ Specify EF#:				
21	Burn risk (due to fire or chemicals) Specify EF#:				