

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com

APPRAISAL SUMMARY - FILE # 3620194**COMPANY****Company:** Fleet Salvage Systems**Adjuster:** Michael Towers**INSPECTION****Recommendation:** Total_loss**Date Contacted:** April 30, 2025**Date Inspected:** April 30, 2025**Appraiser:** Thomas Carter**CLAIM INFO****Claim Number:** G4821**Policy Number:****Deductible:** .0**Insured Name:****Date of Loss:** January 1, 2025**Loss Type:****Claim For:****VEHICLE OWNER****Name:** City of Clearwater**Address:** 600 Cleveland St**Mobile Phone:** (727) 444-8024**Home Phone:****Email:****VEHICLE LOCATION****Location:** Repair Shop**Location Name:** Crash Champions**Address** 2084 Range Rd**City, ST, Zip:** Clearwater FL 33765**Phone** (727) 446-4051**REPAIR SHOP****Name:** Crash Champions**Address:** 2084 Range Rd**City, State, Zip:** Clearwater FL 33765**Phone:** (727) 446-4051**Email:****Fax:****TIN:****VEHICLE INFO****Year:** 2019**Make:** Chevrolet**Model:** Tahoe**VIN:** 1GNLCDE8KR357995**License Plate:****Color:****Mileage:****Driveable:****TIRE INFORMATION****Tread Depth****Left Front:****Right Front:****Left Rear:****Right Rear:****Size:****TOWING & SALVAGE****Towing Charges:**\$ 0.00**Lien Fee:** \$ 0.00**Admin Fee:** \$ 0.00**Other Charges:** \$ 0.00**Storage Fee (per day):** \$ 0.00**Storage Since:****TOTAL LOSS****Total Loss:** Yes**Driveable:****Total Loss Valuation:** **\$15,750.00****Request #:****Valuation Amount / TL %:** \$0.00 /**NADA Value / TL %:** \$0.00 /**ESTIMATE****Appraisal Amount:** \$ 0.00**UPD Amount:**\$ 0.00**Betterment Amount:**\$ 0.00**Deductible:** \$.0**SUPPLEMENTS****Supplement #1:** 0.00**Supplement #2:** 0.00**Supplement #3:** 0.00**Supplement #4:** 0.00

Net Total: \$ 0.00

Supplement #5: 0.00

Agreed Price:

Agreed By:

Days to Repair:

Estimate Released: No

SUMMARY COMMENTS

As per your request we inspected this vehicle at the body shop. During the inspection we found collision damage to the complete front, and air bags. This vehicle is a total loss and is not occurring storage at this time.

Tom Carter Appraisal


11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com

Image not found or type unknown

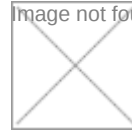

Salvage Bids

File # 3620194**Year:** 2019**Make:** Chevrolet**Model:** Tahoe**VIN #:** 1GNLCDE8KR357995**License plate #:****Color:**

Salvage Bids

#	Name	Contact	Phone	Amount(\$)
1	Fleet Salvage	Briana	(407-834-3400	\$1,325.25
2	Budget auto parts	bill	(407) 656-4707	\$1,000.00
3	Greenstar auto parts	sam	(407) 531-7827	\$1,100.00

Tom Carter Appraisal

11115 Monarch St
Spring Hill, FL 34609
Phone: (352) 606-2272

Workfile ID:

f8c8816d

Estimate of Record**Owner: Clearwater, City of****Job Number:**

Written By: Thomas Carter

Insured: Clearwater, City of
Type of Loss: Collision
Point of Impact:

Policy #:
Date of Loss: 1/1/2025 12:00 AM

Claim #: G4821
Days to Repair: 0

Owner:
Clearwater, City of

Inspection Location:
Crash Champions
2084 Range Rd
Clearwater, FL 33765
Repair Facility

Repair Facility:
Crash Champions
2084 Range Rd
Clearwater, FL 33765

VEHICLE

2019 CHEV Tahoe Commercial (Fleet) 4D UTV 8-5.3L Flex Fuel Direct Injection White

VIN: 1GNLCDEC8KR357995
License:
State:

Production Date:
Odometer: 79,176
Condition:

Interior Color:
Exterior Color: White

TRANSMISSION

Automatic Transmission
Overdrive

POWER

Power Steering
Power Brakes
Power Windows
Power Locks
Power Mirrors
Heated Mirrors
Power Driver Seat
Power Passenger Seat

DECOR

Dual Mirrors
Privacy Glass
Console/Storage

CONVENIENCE

Air Conditioning
Intermittent Wipers
Tilt Wheel
Cruise Control
Rear Defogger
Keyless Entry
Alarm
Message Center
Steering Wheel Touch Controls
Rear Window Wiper
Climate Control
Dual Air Condition
Backup Camera
Parking Sensors

RADIO

AM Radio

FM Radio

Stereo

Search/Seek

CD Player

Auxiliary Audio Connection

SAFETY

Drivers Side Air Bag

Passenger Air Bag

Anti-Lock Brakes (4)

4 Wheel Disc Brakes

Traction Control

Stability Control

Front Side Impact Air Bags

Head/Curtain Air Bags

Communications System

Hands Free Device

Positraction

SEATS

Cloth Seats

Reclining/Lounge Seats

3rd Row Seat

WHEELS

Styled Steel Wheels

PAINT

Clear Coat Paint

TRUCK

Trailer Hitch

Trailer Package

Running Boards/Side Steps

Estimate of Record

Owner: Clearwater, City of

Job Number:

2019 CHEV Tahoe Commercial (Fleet) 4D UTV 8-5.3L Flex Fuel Direct Injection White

Line	Oper	Description	Part Number	Qty	Extended Price \$	Labor	Paint
1	FRONT BUMPER						
2	Repl	Bumper cover bolt	11609489	1	6.11		
3	Repl	Bumper cover bracket	22936479	1	24.42		
4	Repl	RT Bumper cover brace	22829664	1	26.82		
5	Repl	LT Bumper cover brace	22829663	1	26.82		
6	Repl	RT Bumper cover guide	22806323	1	30.88	0.1	
7	Repl	LT Bumper cover guide	22806322	1	30.88	0.1	
8		O/H front bumper				2.5	
9	Repl	RT Filler panel	23258843	1	79.90	Incl.	
10	Repl	LT Filler panel	23258842	1	83.13	Incl.	
11	Repl	RT Filler panel nut	11515638	1	7.12		
12	Repl	LT Filler panel nut	11515638	1	7.12		
13	Repl	RT Filler panel bolt	11609489	1	6.11		
14	Repl	LT Filler panel bolt	11609489	1	6.11		
15	Repl	Lower molding	22992271	1	115.38	Incl.	
16	Repl	Lower molding retainer	11562364	1	8.93		
17	Repl	Skid plate	22992270	1	768.37	Incl.	
18	Repl	Skid plate bolt	11609489	1	6.11		
19	Repl	License bracket	23236459	1	44.23	0.2	
20	Repl	Impact bar	23195058	1	575.98	0.3	
21	Repl	Impact bar bolt	11589164	1	7.51		
22	Repl	Bumper cover	84408070	1	870.78	Incl.	2.8
23		Add for Clear Coat					1.1
24	GRILLE						
25	Repl	Grille assy standard w/gold emblem	84724083	1	806.97	Incl.	
26	FRONT LAMPS						
27	Repl	RT Headlamp assy w/o HID lamps w/o RST pkg	87842735	1	1,323.72	Incl.	
28		Aim headlamps				0.5	
29	Repl	LT Headlamp assy w/o HID lamps w/o RST pkg	87842734	1	1,323.72	Incl.	
30	RADIATOR SUPPORT						
31	Repl	Radiator support cushion	22825456	1	114.14		
32	Repl	Radiator support stopper	22806716	1	4.35		
33	Repl	Mount panel	23266739	1	737.43	Incl.	
34		Add for shutter				0.3 M	
35	Repl	Sight shield	84295007	1	99.52	0.2	
36	Repl	Sight shield retainer	11589293	1	7.23		
37	Repl	Temp sensor	13583411	1	15.76		
38	Repl	Shutter	84378163	1	324.75	0.7	
39	Repl	Shutter bolt	11569919	1	7.45		
40	Repl	Shutter U-nut	11517841	1	7.40		

Estimate of Record

Owner: Clearwater, City of

Job Number:

2019 CHEV Tahoe Commercial (Fleet) 4D UTV 8-5.3L Flex Fuel Direct Injection White

41	Repl	Radiator support	85545442	1	559.80	7.4	
42		Evacuate & recharge			m	1.4	M
43	COOLING						
44	Repl	Radiator 6-speed trans w/o max trailer pkg	84186718	1	579.16 m	Incl.	M
45	Repl	Baffle upper	23141866	1	73.02	0.1	
46	Repl	RT Baffle side	23435605	1	62.33	0.1	
47	Repl	LT Baffle side	23435604	1	62.33	0.1	
48	Repl	Baffle lower	23180712	1	46.75	0.1	
49	Repl	Seal	84241506	1	186.92		
50	Repl	Upper hose	84919468	1	37.96 m	0.7	M
51		Deduct for Overlap				-0.5	M
52	Repl	Upper hose clamp	90572597	1	14.61		
53	Repl	Lower hose	84919469	1	192.27 m	0.6	M
54		Deduct for Overlap				-0.3	M
55	Repl	Reservoir tank	84368362	1	93.58	Incl.	
56	Repl	Reservoir cap	13502354	1	13.45		
57	Repl	Inlet hose	84919470	1	110.58		
58	Repl	Outlet hose	84919463	1	60.01		
59	Repl	Fan shroud 6-speed trans	23123635	1	163.95 m	Incl.	M
60	Repl	Fan shroud bolt outer	11609982	1	11.32		
61	Repl	Fan shroud bolt inner	11611497	1	20.62		
62	Repl	RT Fan motor	85565557	1	657.21 m	0.2	M
63	Repl	LT Fan motor	85565556	1	584.54 m	0.2	M
64	AIR CONDITIONER & HEATER						
65	Repl	Condenser assy Delphi	84802253	1	208.37 m	Incl.	M
66		AC Service refrigerant recovery			m	0.4	M
67	HOOD						
68	Repl	Insulator	84110491	1	136.76	Incl.	
69	Repl	RT Hinge assy	22914277	1	132.53	Incl.	0.3
70		Add for Clear Coat					0.1
71	Repl	LT Hinge assy	22914276	1	132.53	Incl.	0.3
72		Add for Clear Coat					0.1
73	Repl	Bumper front inner	23494834	1	7.82		
74	Repl	Bumper front outer	22951585	1	10.07		
75	Repl	Bumper side	22756674	1	7.61		
76	Repl	Latch assy	85574828	1	85.00	Incl.	
77	Repl	Release cable	84279471	1	72.17	0.9	
78	Repl	Release cable clip	10150076	1	7.38		
79	Repl	RT Assist spring	23258270	1	36.90		
80	Repl	LT Assist spring	23258269	1	36.90		
81	Repl	Hood (ALU)	84348410	1	1,602.65	1.1	3.3
82		Add for Clear Coat					1.3
83		Add for Underside(Complete)					1.6
84		Add for Clear Coat					0.3

Estimate of Record

Owner: Clearwater, City of

Job Number:

2019 CHEV Tahoe Commercial (Fleet) 4D UTV 8-5.3L Flex Fuel Direct Injection White

85	FENDER						
86	Repl	LT Fender Tahoe	84602083	1	1,315.00	3.6	2.2
87		Overlap Major Adj. Panel					-0.4
88		Add for Clear Coat					0.4
89		Add for dual battery				0.3	
90		Add for Edging					0.5
91		Add for Clear Coat					0.1
92		Add for Inside					1.0
93		Add for Clear Coat					0.2
94	Repl	RT Fender upper bracket	23488050	1	58.87	0.1	
95	Repl	LT Fender upper bracket	23488049	1	58.87	0.1	
96	Repl	RT Fender lower bracket	22992039	1	61.50		
97	Repl	LT Fender lower bracket	22992039	1	61.50		
98	Repl	RT Fender reinforcement	22814873	1	15.55	0.1	
99	Repl	LT Fender reinforcement	22814873	1	15.55	0.1	
100	Repl	RT Fender brace	23115310	1	42.72		
101	Repl	LT Fender brace	22805755	1	38.30		
102	Repl	Fender insulation	23431218	1	18.66		
103	Repl	RT Fender protector	23463925	1	32.95	Incl.	
104	Repl	LT Fender protector	23463924	1	32.95	Incl.	
105	Repl	RT Rear insulator	84342551	1	50.65	0.1	
106	Repl	LT Rear insulator	84342552	1	24.30	0.1	
107	Repl	RT Fender liner Tahoe w/o Z71 pkg	22806317	1	136.85	Incl.	
108	Repl	LT Fender liner Tahoe w/o Z71 pkg	22806316	1	136.85	Incl.	
109	Repl	RT Fender liner Tahoe w/Z71 pkg	22969208	1	125.48	Incl.	
110	Repl	LT Fender liner Tahoe w/Z71 pkg	22969207	1	127.63	Incl.	
111	Repl	RT Fender liner retainer	1605396	1	9.10		
112	Repl	LT Fender liner retainer	1605396	1	9.10		
113	Repl	RT Fender liner nut	11609952	1	7.38		
114	Repl	LT Fender liner nut	11609952	1	7.38		
115	Repl	RT Fender liner bolt torx head	11570637	1	7.38		
116	Repl	LT Fender liner bolt torx head	11570637	1	7.38		
117	Repl	RT Fender liner bolt hex head, 4.2 mm	11609489	1	6.11		
118	Repl	LT Fender liner bolt hex head, 4.2 mm	11609489	1	6.11		
119	Repl	RT Fender liner bolt hex head, 6 mm	11609982	1	11.32		
120	Repl	LT Fender liner bolt hex head, 6 mm	11609982	1	11.32		
121	Repl	RT Fender Tahoe	84602084	1	1,315.00	3.4	2.2
122		Overlap Major Adj. Panel					-0.4
123		Add for Clear Coat					0.4
124		Add for Edging					0.5

Estimate of Record

Owner: Clearwater, City of

Job Number:

2019 CHEV Tahoe Commercial (Fleet) 4D UTV 8-5.3L Flex Fuel Direct Injection White

125		Add for Clear Coat					0.1
126		Add for Inside					1.0
127		Add for Clear Coat					0.2
128	RESTRAINT SYSTEMS						
129	Repl	Driver air bag Tahoe black	84057084	1	944.42 m	Incl. M	
130		Air bag system diagnosis			m	0.5 M	
131	Repl	Psng air bag Tahoe & Yukon	84637845	1	965.59 m	0.6 M	
132	Repl	Clockspring w/o strng whl heat	23381963	1	183.25 m	1.0 M	
133	Repl	Air bag switch	NOT LISTED	1			
134	Repl	Diagnostic unit all	13524237	1	406.04 m	0.4 M	
135	Repl	Occupant sensor w/o leather	84381564	1	883.67		
136	Repl	RT Ft impact sensor	13519421	1	233.34 m	0.3 M	
137	Repl	LT Ft impact sensor	13519421	1	233.34 m	0.3 M	
138	Repl	RT Adjuster	13519683	1	71.13		
139	Repl	LT Adjuster	13519683	1	71.13		
140	Repl	LT Tensioner cover black	84324904	1	7.02		
141	Repl	RT Tensioner cover black	84324904	1	7.02		
142	Repl	LT Tensioner black	19356262	1	145.60 m	0.5 M	
143	Repl	RT Tensioner black	19356268	1	192.02 m	0.5 M	
144	Repl	Center belt assy dune	84599979	1	18.27	0.3	
145	Repl	Center belt assy black	84599976	1	122.04	0.3	
146	Repl	LT Outer buckle black	84531738	1	185.12	0.3	
147	Repl	RT Outer buckle black	84531738	1	185.12	0.3	
148	Repl	LT Outer belt assy w/o auto tightening black	84494008	1	185.12 m	0.4 M	
149	Repl	RT Outer belt assy w/o auto tightening black	84494053	1	237.93 m	0.4 M	
150	#	Subl Hazardous waste removal		1	3.50 X		
151	#	Repl Cover Car		1	5.00 T	0.3	
152	#	Color tint / color match		1			0.5
153	#	Rpr Color sand and buff					2.0
154	#	Repl Corrosion protection primer		1	10.00 T		
155	#	Repl Flex additive		1	8.00 T		
156	#	Rpr Setup & measure				2.0 F	
157	#	Rpr Unibody structural repair				F	
158	#	Rpr Damage from unibody clamps				2.0	1.0
159	#	Subl Four wheel alignment		1	229.99 T		
160	**	Repl A/M Coolant		1	50.00 T		
161	#	Repl Refridgerant R-134a		1	10.00 T		
162	#	Rpr Safety Check				1.0 M	
163	#	Rpr Send To Dealer To Diag SRS system				2.0 M	
164	#	Covid Cleaning Pre & Post		1		1.0	
165	#	Rpr Reset Electronics				1.0	
166	#	Rpr Zero Point Caliberation				2.0 M	
167	#	Rpr Calibrate Radar & Cruise				2.0 M	

Estimate of Record

Owner: Clearwater, City of

Job Number:

2019 CHEV Tahoe Commercial (Fleet) 4D UTV 8-5.3L Flex Fuel Direct Injection White

168	#	Rpr	Test & Calibrate GPS Antenna In Mirror			1.0	
169	#	Rpr	Clear Codes			1.0	
170	#	Rpr	Recalibrate Auto Integrated Circuit			2.5	
171	#		Prep Unprimed Bumper	1			1.0
172	#		Recalibrate Camera System After Alignment	1	450.00		
173	#		Calibrate Steering Angle Sensor	1		2.0	M
174	#		Clean Vehicle of excessive dirt before applying car cover	1		1.0	
175	#		D & R Battery	1		0.5	M
176	#		Deliver Vehicle to dealer for electronics & return	1		2.0	
177	#		D & R Air Bags	1		1.0	M
178	#		Recalibrate Blind Spot Sensors	1		2.0	E
SUBTOTALS					23,307.67	57.7	23.7

ESTIMATE TOTALS

Category	Basis			Rate	Cost \$
Parts					22,991.18
Body Labor	35.3 hrs	@		\$ 65.00 /hr	2,294.50
Paint Labor	23.7 hrs	@		\$ 65.00 /hr	1,540.50
Mechanical Labor	18.4 hrs	@		\$ 269.95 /hr	4,967.08
Frame Labor	2.0 hrs	@		\$ 65.00 /hr	130.00
Electrical Labor	2.0 hrs	@		\$ 269.95 /hr	539.90
Paint Supplies	23.7 hrs	@		\$ 45.00 /hr	1,066.50
Miscellaneous					316.49
Subtotal					33,846.15
Sales Tax	Tier 1	\$ 5,000.01	@	7.0000 %	350.00
Sales Tax	Tier 2	\$ 28,842.64	@	6.0000 %	1,730.56
Total Cost of Repairs					35,926.71
Deductible					0.00
Total Adjustments					0.00
Net Cost of Repairs					35,926.71

MyPriceLink Estimate ID / Quote ID:

1346896686852612096 / 144923550

Owner: Clearwater, City of

Job Number:

2019 CHEV Tahoe Commercial (Fleet) 4D UTV 8-5.3L Flex Fuel Direct Injection White

ANY PERSON WHO KNOWINGLY AND WITH INTENT TO INJURE, DEFRAUD, OR DECEIVE ANY INSURER FILES A STATEMENT OF CLAIM OR AN APPLICATION CONTAINING ANY FALSE, INCOMPLETE, OR MISLEADING INFORMATION IS GUILTY OF A FELONY OF THE THIRD DEGREE (FLORIDA STATUTES TITLE XLVI, CHAPTER 817.234). FAILURE TO USE THE INSURANCE PROCEEDS IN ACCORDANCE WITH THE SECURITY AGREEMENT, IF ANY, COULD BE A VIOLATION OF S. 812.014, FLORIDA STATUTES. IF YOU HAVE ANY QUESTIONS, CONTACT YOUR LENDING INSTITUTION. IF A CHARGE FOR SHOP SUPPLIES OR HAZARDOUS OR OTHER WASTE REMOVAL IS INCLUDED ON THIS ESTIMATE, PLEASE NOTE THE FOLLOWING: "THIS CHARGE REPRESENTS COSTS AND PROFITS TO THE MOTOR VEHICLE REPAIR FACILITY FOR MISCELLANEOUS SHOP SUPPLIES OR WASTE DISPOSAL." IF A CHARGE FOR NEW TIRES OR A NEW OR REMANUFACTURED LEAD-ACID BATTERY IS INCLUDED ON THIS ESTIMATE, PLEASE NOTE THE FOLLOWING: A \$1.00 FEE FOR EACH NEW MOTOR VEHICLE TIRE SOLD AT RETAIL IS IMPOSED ON ANY PERSON ENGAGING IN THE BUSINESS OF MAKING RETAIL SALES OF NEW MOTOR VEHICLE TIRES WITHIN THE STATE OF FLORIDA. FLORIDA STATUTES TITLE XXIX CHAPTER 403.718. A \$1.50 FEE FOR EACH NEW OR REMANUFACTURED LEAD-ACID BATTERY SOLD AT RETAIL IS IMPOSED ON ANY PERSON ENGAGING IN THE BUSINESS OF MAKING RETAIL SALES OF NEW OR REMANUFACTURED LEAD-ACID BATTERIES WITHIN THE STATE OF FLORIDA. FLORIDA STATUTES TITLE XXIX 403.7185.

THIS ESTIMATE HAS BEEN PREPARED BASED ON THE USE OF CRASH PARTS SUPPLIED BY A SOURCE OTHER THAN THE MANUFACTURER OF YOUR MOTOR VEHICLE. THE AFTERMARKET CRASH PARTS USED IN THE PREPARATION OF THIS ESTIMATE ARE WARRANTED BY THE MANUFACTURER OR DISTRIBUTOR OF SUCH PARTS RATHER THAN THE MANUFACTURER OF YOUR VEHICLE.

Owner: Clearwater, City of**Job Number:**

2019 CHEV Tahoe Commercial (Fleet) 4D UTV 8-5.3L Flex Fuel Direct Injection White

Estimate based on MOTOR CRASH ESTIMATING GUIDE and potentially other third party sources of data. Unless otherwise noted, (a) all items are derived from the Guide DR1GC15, CCC Data Date 04/16/2025, and potentially other third party sources of data; and (b) the parts presented are OEM-parts. OEM parts are manufactured by or for the vehicle's Original Equipment Manufacturer (OEM) according to OEM's specifications for U.S. distribution. OEM parts are available at OE/Vehicle dealerships or the specified supplier. OPT OEM (Optional OEM) or ALT OEM (Alternative OEM) parts are OEM parts that may be provided by or through alternate sources other than the OEM vehicle dealerships with discounted pricing. Asterisk (*) or Double Asterisk (**) indicates that the parts and/or labor data provided by third party sources of data may have been modified or may have come from an alternate data source. Tilde sign (~) items indicate MOTOR Not-Included Labor operations. The symbol (<>) indicates the refinish operation WILL NOT be performed as a separate procedure from the other panels in the estimate. Non-Original Equipment Manufacturer aftermarket parts are described as Non OEM, A/M or NAGS. Used parts are described as LKQ, RCY, or USED. Reconditioned parts are described as Recond. Recored parts are described as Recore. NAGS Part Numbers and Benchmark Prices are provided by National Auto Glass Specifications. Labor operation times listed on the line with the NAGS information are MOTOR suggested labor operation times. NAGS labor operation times are not included. Pound sign (#) items indicate manual entries.

Some 2024 vehicles contain minor changes from the previous year. For those vehicles, prior to receiving updated data from the vehicle manufacturer, labor and parts data from the previous year may be used. The CCC ONE estimator has a list of applicable vehicles. Parts numbers and prices should be confirmed with the local dealership.

The following is a list of additional abbreviations or symbols that may be used to describe work to be done or parts to be repaired or replaced:

SYMBOLS FOLLOWING PART PRICE:

m=MOTOR Mechanical component. s=MOTOR Structural component. T=Miscellaneous Taxed charge category. X=Miscellaneous Non-Taxed charge category.

SYMBOLS FOLLOWING LABOR:

D=Diagnostic labor category. E=Electrical labor category. F=Frame labor category. G=Glass labor category. M=Mechanical labor category. S=Structural labor category. (numbers) 1 through 4=User Defined Labor Categories.

OTHER SYMBOLS AND ABBREVIATIONS:

Adj.=Adjacent. Algn.=Align. ALU=Aluminum. A/M=Aftermarket part. Bld=Blend. BOR=Boron steel. CAPA=Certified Automotive Parts Association. CFC=Carbon Fiber. D&R=Disconnect and Reconnect. HSS=High Strength Steel. HYD=Hydroformed Steel. Incl.=Included. LKQ=Like Kind and Quality. LT=Left. MAG=Magnesium. Non-Adj.=Non Adjacent. NSF=NSF International Certified Part. O/H=Overhaul. Qty=Quantity. Refn=Refinish. Repl=Replace. R&I=Remove and Install. R&R=Remove and Replace. Rpr=Repair. RT=Right. SAS=Sandwiched Steel. Sect=Section. STS=Stainless Steel. Subl=Sublet. UHS=Ultra High Strength Steel. N=Note(s) associated with the estimate line.

CCC ONE Estimating - A product of CCC Intelligent Solutions Inc.

The following is a list of abbreviations that may be used in CCC ONE Estimating that are not part of the MOTOR CRASH ESTIMATING GUIDE:

BAR=Bureau of Automotive Repair. EPA=Environmental Protection Agency. NHTSA= National Highway Transportation and Safety Administration. PDR=Paintless Dent Repair. VIN=Vehicle Identification Number.

Assignment Info

File # : 3620194

Claim # : G4821

Date : 04/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609


Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

TRIM_PANEL

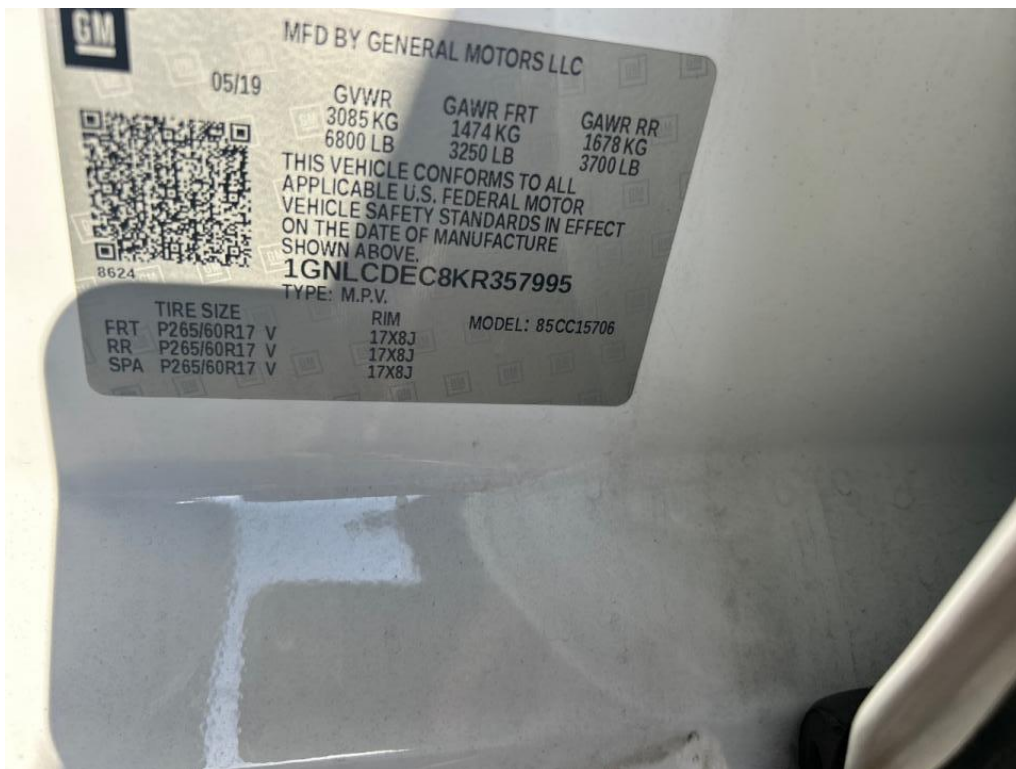

File Name / Description:

VIN

Assignment Info

File # : 3620194

Claim # : G4821

Date : 04/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:
LEFT_REAR_CORNER



File Name / Description:
TAG

Assignment Info

File # : 3620194

Claim # : G4821

Date : 04/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:
RIGHT_REAR_CORNER



File Name / Description:
DRIVERS_AIR_BAG

Assignment Info

File # : 3620194

Claim # : G4821

Date : 04/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:
INTERIOR



File Name / Description:
DRIVERS_AIR_BAG_1

Assignment Info

File # : 3620194

Claim # : G4821

Date : 04/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609


Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

AIR_FILTER

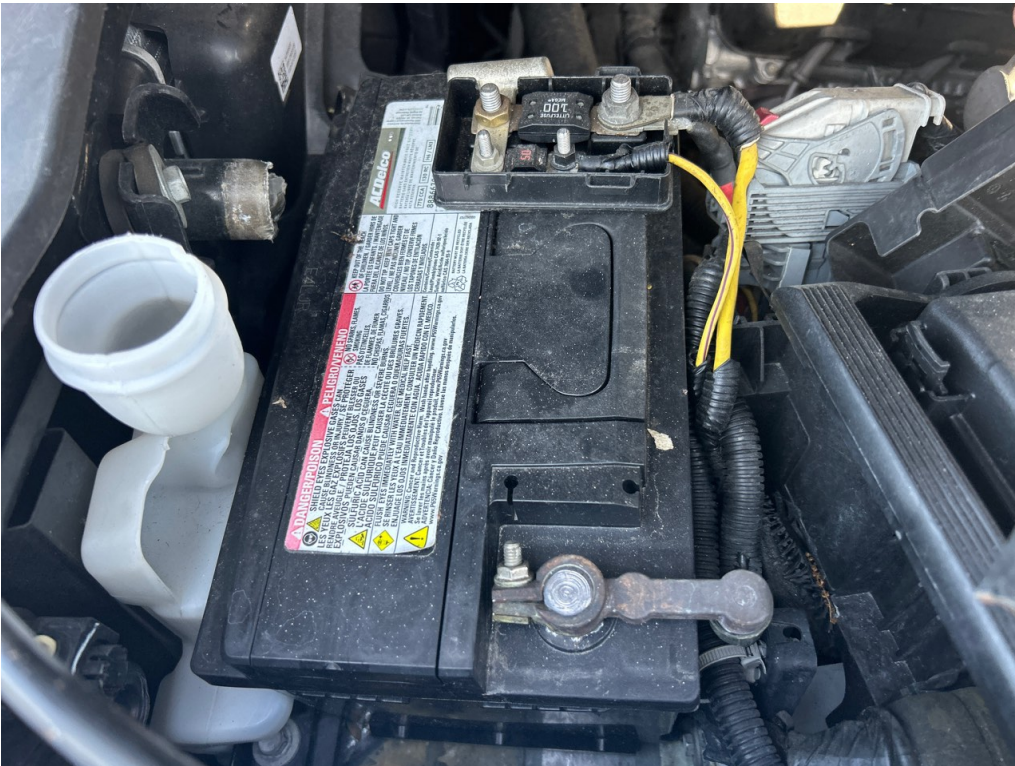

File Name / Description:

BATTERY

Assignment Info

File # : 3620194

Claim # : G4821

Date : 04/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

LEFT_FENDER



File Name / Description:

LEFT_FRONT_DOOR

Assignment Info

File # : 3620194

Claim # : G4821

Date : 04/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:
LEFT_FRONT_CORNER



File Name / Description:
HOOD

Assignment Info

File # : 3620194

Claim # : G4821

Date : 04/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:
FRONT_BUMPER_AND_GRILL



File Name / Description:
RIGHT_FENDER

Assignment Info

File # : 3620194

Claim # : G4821

Date : 04/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

RIGHT_FRONT_CORNER