Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080

Email thomascarter352@yahoo.com

APPRAISAL SUMMARY - FILE # 3703547

COMPANY INSPECTION

Company: Fleet Salvage Systems Recommendation: Repairable
Adjuster: Michael Towers Date Contacted: July 29, 2025

Date Inspected: July 29, 2025 **Appraiser:** Thomas Carter

CLAIM INFO VEHICLE OWNER

Claim Number: G4935

Name: City of Clearwater

Address: 1900 Grand Ave

Deductible: 0.00 Mobile Phone: Insured Name: City of Clearwater Home Phone:

Insured Name: City of Clearwater Home Phone **Date of Loss:** July 26, 2025 **Email:**

Loss Type: Collision Claim For: Insured

VEHICLE LOCATION REPAIR SHOP

Location: With Owner Name:
Location Name: Clearwater, City of Address:

Address 1900 Grand Ave City, State, Zip:

City, ST, Zip: Clearwater FL 33765

Phone:
Email:
Fax:

TIN:

VEHICLE INFO TIRE INFORMATION

Year: 2020
Tread Depth
Make: Ford
Left Front:
Model: Police Interceptor Ut...
VIN: 1FM5K8AB6LGC35489
Left Rear:
License Plate:
Right Rear:
Color: White
Size:

Mileage: 45838 Driveable:

TOWING & SALVAGE TOTAL LOSS

Towing Charges: \$ 0.00

Lien Fee: \$ 0.00

Driveable:

Admin Fee: \$ 0.00 Total Loss Valuation: \$18,750

Other Charges: \$ 0.00 Request #:

Storage Fee (per day): \$ 0.00 Valuation Amount / TL %:100%+

Storage Since: NADA Value / TL %: \$0.00 /

ESTIMATE SUPPLEMENTS

Appraisal Amount: \$ 42001.95

UPD Amount\$ 0.00

Betterment Amount: \$ 0.00

Supplement #2: 0.00

Supplement #3: 0.00

Deductible: \$ 0.00 Supplement #4: 0.00

Net Total: \$ 42,001.95 **Supplement #5:** 0.00

Agreed Price: Agreed By: Days to Repair:

Estimate Released: No

SUMMARY COMMENTS

As per your request we inspected this vehicle at the owners lot. During the inspection we found collision damage to the right rear corner, right side, right front corner and air bags. This vehicle is a total loss.

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



Salvage Bids

File # 3703547

Year: 2020 Make: Ford Model: Explorer

VIN #: License plate #: Color:

Salvage Bids

#	Name	Contact	Phone	Amount(\$)
1	Fleet Financial FKA Fleet Salvage	Briana	(407) 834-3400	\$1,150.00
2	Budget Auto Parts	Bill	(407) 656-4707	\$1,000.00
3	Greenstar Auto Parts	Sam	(407) 531-7827	\$1,100.50

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone: (352) 606-2272 Workfile ID: 2892bc0f

Estimate of Record

Owner: Clearwater, City of Job Number:

Written By: Thomas Carter

Insured: Clearwater, City of

Type of Loss: Collision

Point of Impact: 01 Right Front

1FM5K8AB6LGC35489

Policy #: Date of Loss: Claim #:

Repair Facility:

Interior Color:

Days to Repair: 0

G4935

Owner: **Inspection Location:**

Clearwater, City of 1900 Grand Ave Clearwater, FL 33765

VIN:

Clearwater, City of 1900 Grand Ave Clearwater, FL 33765

Home

Air Conditioning

Tilt Wheel

VEHICLE

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

Production Date: License: Odometer: 45,838 **Exterior Color:** White

State: Condition: Good

TRANSMISSION

Automatic Transmission Intermittent Wipers

4 Wheel Drive

POWER Cruise Control **Power Steering** Rear Defogger

Power Brakes Message Center

Power Windows Steering Wheel Touch Controls

Power Locks Rear Window Wiper Telescopic Wheel **Power Mirrors**

Power Driver Seat Climate Control **DECOR** Backup Camera

Dual Mirrors RADIO Privacy Glass AM Radio

Overhead Console FM Radio **CONVENIENCE** Stereo

Search/Seek

Auxiliary Audio Connection

SAFETY

Drivers Side Air Bag Passenger Air Bag

Anti-Lock Brakes (4) 4 Wheel Disc Brakes

Traction Control Stability Control

Front Side Impact Air Bags

Head/Curtain Air Bags Hands Free Device

Xenon or L.E.D. Headlamps

SEATS Cloth Seats **Bucket Seats**

Reclining/Lounge Seats

WHEELS

Styled Steel Wheels

PAINT

Clear Coat Paint

OTHER Rear Spoiler

California Emissions

TRUCK

Trailer Hitch

Trailering Package

Owner: Clearwater, City of

Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

Line	Oper	Description	Part Number	Qty	Extended Price \$	Labor	Paint
1	FRONT BUMPER						
2	Repl	Add for fog lamps		1		0.4	
3		O/H bumper assy				4.5	
4	Repl	Bumper cover w/o auto park	LB5Z17D957SCPTM	1	594.25	Incl.	2.4
5		Add for Clear Coat					1.0
6	Repl	Lower cover INTERCEPTOR	LB5Z17D957AB	1	293.78	Incl.	
7	Repl	RT Side trim w/o fog lamps	LB5Z15A246AA	1	90.55	Incl.	
8	Repl	LT Side trim w/o fog lamps	LB5Z15A245AA	1	81.15	Incl.	
9	Repl	Impact bar (ALU)	R1MZ17757A	1	626.22	0.6	
10	FRONT LAMPS						
11	Repl	RT Headlamp assy w/o adaptive headlamps level 2 headlamps	MB5Z13008AY	1	2,404.60	Incl.	
12		Aim headlamps				0.5	
13	Repl	RT Lamp assy red	LB5Z15A101J	1	1,761.82	0.3	
14	Repl	LT Lamp assy red	LB5Z15A101H	1	830.15	0.3	
15	HOOD						
16	Repl	Hood (ALU)	LB5Z16612A	1	1,144.80	1.1	3.0
17		Add for Clear Coat					1.2
18		Add for Underside(Complete)					1.5
19		Add for Clear Coat					0.3
20	FENDER						
21	Repl	RT Fender w/o HEV	RB5Z16005B	1	404.17	2.7	2.0
22		Overlap Major Adj. Panel					-0.4
23		Add for Clear Coat					0.3
24		Add for Edging					0.5
25		Add for Clear Coat					0.1
26	Repl	RT Fender liner	LB5Z16102D	1	134.43	Incl.	
27	Repl	RT Wheel flare w/o auto park	LB5Z16038AC	1	295.30	0.3	
28	R&I	LT Wheel flare w/o auto park				0.3	
29	WHEELS						
30	Repl	RT/Front Wheel, steel	LB5Z1015B	1	728.20 m	0.3	
31	FRONT SUSPENSION	N					
32		O/H frt susp rt			m	3.5	
33	Repl	RT Hub assy	LB5Z1104E	1	325.45 m	Incl.	
34	Repl	RT Knuckle w/INTERCEPTOR	LB5Z3K185A	1	348.00 m	Incl.	
35	Repl	RT Rr lwr cntl arm w/INTERCEPTOR	LB5Z3078B	1	252.00 m	Incl.	
36		Deduct for Overlap				Incl.	
37	Repl	RT Ft lwr cntl arm w/INTERCEPTOR	LB5Z3082B	1	372.30 m	Incl.	
38		Deduct for Overlap				Incl.	
39	Repl	Stabilizer bar w/INTERCEPTOR	LB5Z5482C	1	322.67 m	1.6	
40	Repl	RT Stabilizer link	LB5Z5K484A	1	72.69 m	Incl.	

Own	er: Clearwater,	Cit	y of				Job Number
2020 F	ORD Police Interceptor	r Uti	ility Vehicle AWD (Fleet) 4D UTV 6-3.3	L Flex Fuel White			
41	Re	epl	RT Strut w/INTERCEPTOR 3.3 liter GAS	LB5Z18124H	1	182.00 m	Incl.
42			Deduct for Overlap				Incl.
43			Deduct for Overlap				Incl.
44	WINDSHIELD						
45	Re	epl	Windshield FORD, w/INTERCEPTOR w/o collision mitigation	LB5Z7803100K	1	466.02	3.3
46	RESTRAINT SYST	EM:	s				
47	Re	epl	LT Ft seat air bag nut	W520101S442	1	4.25	
48	Re	epl	RT Ft seat air bag nut	W520101S442	1	4.25	
49	Re	epl	LT Ft seat air bag	MB5Z78611D11C	1	222.75 m	0.7
50			Air bag system diagnosis ck system operation			m	0.5
51			Air bag system diagnosis pinpoint test			m	2.1
52	Re	epl	RT Ft seat air bag	MB5Z78611D10C	1	223.20 m	0.7
53	Re	epl	LT Knee air bag nut	W520101S442	1	4.25	
54	Re	epl	LT Head air bag nut	W702751S442	1	3.25	
55	Re	epl	RT Head air bag nut	W702751S442	1	3.25	
56	Re	epl	LT Head air bag	LB5Z78042D95C	1	914.63 m	0.6
57	Re	epl	RT Head air bag	LB5Z78042D94C	1	914.63 m	0.6
58	Re	epl	LT Knee air bag	LB5Z78045J77AA	1	394.37 m	0.5
59	Re	epl	Driver air bag ST, INTERCEPTOR	LB5Z78043B13AC	1	475.33 m	Incl.
60	Re	epl	Clockspring w/o heated strng whl	GN1Z14A664D	1	255.40 m	1.2
61	Re	epl	Control module	LB5Z14B321A	1	476.68 m	0.3
62	Re	epl	LT Ft impact sensor	L1TZ14B004A	1	63.20 m	0.3
63	Re	epl	RT Ft impact sensor	L1TZ14B004A	1	63.20 m	0.3
64	Re	epl	LT Ft impact sensor bolt	W500215S442	1	3.25	
65	Re	epl	RT Side impact sens front	ML3Z14B345A	1	74.15 m	0.3
66	Re	epl	LT Side impact sens front	ML3Z14B345A	1	74.15 m	0.3
67	Re	epl	RT Side impact sens rear	L1TZ14B004A	1	63.20 m	0.3
68	Re	epl	LT Side impact sens rear	L1TZ14B004A	1	63.20 m	0.3
69	Re	epl	RT Position sensor	FL3Z14B416B	1	31.20 m	0.3
70	Re	epl	LT Position sensor	FL3Z14B416A	1	32.10 m	0.3
71	Re	epl	RT Ft impact sensor bolt	W500215S442	1	3.25	
72	Re	epl	RT Lower bracket	LB5Z78611C34B	1	23.42	
73	Re	epl	LT Lower bracket	LB5Z78611C35A	1	15.77	
74	Re	epl	RT Buckle end w/INTERCEPTOR	LB5Z7861202AA	1	210.92	0.2
75	Re	epl	LT Buckle end w/INTERCEPTOR	KS7Z5461203CA	1	152.70	0.2
76	Re	epl	LT Height adjuster	LB5Z78602B82A	1	49.43	0.1
77	Re	epl	RT Height adjuster	LB5Z78602B82A	1	49.43	0.1
78	Re	epl	LT Seat belt assy ebony	LB5Z78611B09AA	1	389.63 m	0.3
79	Re	epl	RT Seat belt assy ebony	LB5Z78611B08AA	1	436.15 m	0.3
80	ROOF						
81	Re	epl	Headliner ebony	LB5Z7851916PL	1	1,548.00	4.7

Owner: Clearwater, City of Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

82	PILLARS, ROCKE	R & FLOOR					
83	Re	pl RT Wndshld plr trim INTERCEPTOR	ebony LB5Z7803598AD	1	128.27	Incl.	
84	Re	pl LT Wndshld plr trim (INTERCEPTOR	bony LB5Z7803599AD	1	128.27	Incl.	
85	Re	pl RT Upr ctr plr trim el	ony LB5Z7824346AF	1	99.53	Incl.	
86	Re			1	99.53	Incl.	
87	Re	pl RT Lwr ctr plr trim el w/INTERCEPTOR	ony LB5Z7824346PA	1	232.77	Incl.	
88	Re	pl LT Lwr ctr plr trim eb w/INTERCEPTOR	ony LB5Z7824347PA	1	229.62	0.3	
89	Re	pl RT Aperture panel	NB5Z78211A10A	1	537.57	20.0	4.0
90		Overlap Major Adj. P	nel				-0.4
91		Add for Clear Coat					0.7
92	Re	pl RT Rocker panel	NB5Z7810128A	1	488.33	9.0	2.0
93		Overlap Major Adj. P	nel				-0.4
94		Add for Clear Coat					0.3
95	Re	pl RT Rocker molding	LB5Z7810176AC	1	306.20	0.5	
96	FRONT DOOR						
97	* R	or RT Door shell				<u>5.0</u>	2.4
98		Overlap Major Adj. P	nel				-0.4
99	*	Add for Clear Coat					0.4
100	REAR DOOR						
101	* R	or RT Door assy				<u>5.0</u>	2.5
102		Overlap Major Adj. P	nel				-0.4
103	*	Add for Clear Coat					0.4
104	QUARTER PANEL						
105	Re	pl RT Quarter pnl assy	NB5Z78278A92A	1	1,356.35	18.5	3.5
106		Overlap Major Adj. P	nel				-0.4
107	*	Add for Clear Coat					0.6
108		Deduct for Overlap				-2.0	
109	LIFT GATE						
110	* R	or Lift gate				<u>4.0</u>	2.3
111		Overlap Major Adj. P	inel				-0.4
112	*	Add for Clear Coat					0.4
113	Re	pl Rear molding INTER	EPTOR LB5Z7842512BA	1	755.97	0.3	
114	Re	pl Nameplate "INTERCE	PTOR" LB5Z7842528A	1	28.08	0.1	
115	REAR LAMPS						
116	Re	pl RT Tail lamp assy lev	el 1, 2 LB5Z13404F	1	794.65	Incl.	
117	REAR BUMPER						
118		O/H rear bumper				2.2	
119	Re	pl Upper cover	LB5Z17810BCPTM	1	356.70	Incl.	2.4
120		Add for Clear Coat					1.0
121		Deduct for Rear Bum				-1.2	
122	Re	•	LB5Z17K835EE		358.93	Incl.	
123	Re	pl Isolator	LB5Z17E855D	1	123.42	0.2	

Owner: Clearwater, City of								Job Number:		
2020 F0	ORD Polic	ce Interceptor Ut	cility Vehicle AWD (Fleet) 4D UTV 6-3	3.3L Flex Fuel White						
124		Repl	RT Side support	LB5Z17D942C	1	41.17	0.1			
125		Repl	RT Reflector	LB5Z13A565A	1	36.25	Incl.			
126		Repl	Support	LB5Z17E855B	1	149.27	0.2			
127	#	Subl	Hazardous waste removal		1	3.50 X				
128	#	Repl	Cover Car		1	5.00 T	0.3			
129	#		Color tint / color match		1			0.5		
130	#	Rpr	Color sand and buff					2.0		
131	#	Repl	Corrosion protection primer		1	10.00 T				
132	#	Repl	Flex additive		1	8.00 T				
133	#	Rpr	Setup & measure				2.0 F			
134	#	Rpr	Unibody structural repair				4.0 F			
135	#	Rpr	Damage from unibody clamps				2.0	1.0		
136	#	Subl	Four wheel alignment		1	229.99 T				
137	#	Subl	Tire mount & wheel balance		1	65.00 T				
138	#	Rpr	Safety Check				1.0 M			
139	#	Repl	Urethane kit		1	50.00				
140	#		Covid Cleaning Pre & Post		1		1.0			
141	#	Rpr	Send To Dealer To Diag SRS system				2.0 M			
142	#	Rpr	Clear Codes				1.0			
143	#		Prep Unprimed Bumper		1			1.0		
144	#	Rpr	Recalibrate Auto Integrated Circuit				2.5			
145	#		Calibrate Steering Angle Sensor		1		2.0 M			
146	#		Recalibrate Camera System After Alignment		1	450.00				
147	#		Clean Vehicle of excessive dirt before applying car cover		1		1.0			
148	#		D & R Battery		1		0.5 M			
149	#		Clean & Prep Area From Old Adhesives		1		2.0			
150	#		Remove Decals/stickers/labels		1		4.0			
151	#		Decals		1	1,250.00				
				SUBTOTALS		27,295.51	122.7	36.9		

Owner: Clearwater, City of

Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

ESTIMATE TOTALS

Category		Basis		Rate	Cost \$
Parts					26,974.02
Body Labor		111.2 hrs	@	\$ 65.00 /hr	7,228.00
Paint Labor		36.9 hrs	@	\$ 65.00 /hr	2,398.50
Mechanical Labor		5.5 hrs	@	\$ 110.00 /hr	605.00
Frame Labor		6.0 hrs	@	\$ 65.00 /hr	390.00
Paint Supplies		36.9 hrs	@	\$ 45.00 /hr	1,660.50
Miscellaneous					321.49
Subtotal					39,577.51
Sales Tax	Tier 1	\$ 5,000.01	@	7.0000 %	350.00
Sales Tax	Tier 2	\$ 34,574.00	@	6.0000 %	2,074.44
Total Cost of Repairs					42,001.95
Deductible					0.00
Total Adjustments					0.00
Net Cost of Repairs					42,001.95

ANY PERSON WHO KNOWINGLY AND WITH INTENT TO INJURE, DEFRAUD, OR DECEIVE ANY INSURER FILES A STATEMENT OF CLAIM OR AN APPLICATION CONTAINING ANY FALSE, INCOMPLETE, OR MISLEADING INFORMATION IS GUILTY OF A FELONY OF THE THIRD DEGREE(FLORIDA STATUTES TITLE XLVI, CHAPTER 817.234). FAILURE TO USE THE INSURANCE PROCEEDS IN ACCORDANCE WITH THE SECURITY AGREEMENT, IF ANY, COULD BE A VIOLATION OF S. 812.014, FLORIDA STATUTES. IF YOU HAVE ANY QUESTIONS, CONTACT YOUR LENDING INSTITUTION. IF A CHARGE FOR SHOP SUPPLIES OR HAZARDOUS OR OTHER WASTE REMOVAL IS INCLUDED ON THIS ESTIMATE, PLEASE NOTE THE FOLLOWING: "THIS CHARGE REPRESENTS COSTS AND PROFITS TO THE MOTOR VEHICLE REPAIR FACILITY FOR MISCELLANEOUS SHOP SUPPLIES OR WASTE DISPOSAL." IF A CHARGE FOR NEW TIRES OR A NEW OR REMANUFACTURED LEAD-ACID BATTERY IS INCLUDED ON THIS ESTIMATE, PLEASE NOTE THE FOLLOWING: A \$1.00 FEE FOR EACH NEW MOTOR VEHICLE TIRE SOLD AT RETAIL IS IMPOSED ON ANY PERSON ENGAGING IN THE BUSINESS OF MAKING RETAIL SALES OF NEW MOTOR VEHICLE TIRES WITHIN THE STATE OF FLORIDA. FLORIDA STATUTES TITLE XXIX CHAPTER 403.718. A \$1.50 FEE FOR EACH NEW OR REMANUFACTURED LEAD-ACID BATTERYS OLD AT RETAIL IS IMPOSED ON ANY PERSON ENGAGING IN THE BUSINESS OF MAKING RETAIL SALES OF NEW OR REMANUFACTURED LEAD-ACID BATTERIES WITHIN THE STATE OF FLORIDA. FLORIDA STATUTES TITLE XXIX 403.7185.

Owner: Clearwater, City of

Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

Estimate based on MOTOR CRASH ESTIMATING GUIDE and potentially other third party sources of data. Unless otherwise noted, (a) all items are derived from the Guide DR2MF20, CCC Data Date 07/17/2025, and potentially other third party sources of data; and (b) the parts presented are OEM-parts. OEM parts are manufactured by or for the vehicle's Original Equipment Manufacturer (OEM) according to OEM's specifications for U.S. distribution. OEM parts are available at OE/Vehicle dealerships or the specified supplier. OPT OEM (Optional OEM) or ALT OEM (Alternative OEM) parts are OEM parts that may be provided by or through alternate sources other than the OEM vehicle dealerships with discounted pricing. Asterisk (*) or Double Asterisk (**) indicates that the parts and/or labor data provided by third party sources of data may have been modified or may have come from an alternate data source. Tilde sign (~) items indicate MOTOR Not-Included Labor operations. The symbol (<>) indicates the refinish operation WILL NOT be performed as a separate procedure from the other panels in the estimate. Non-Original Equipment Manufacturer aftermarket parts are described as Non OEM, A/M or NAGS. Used parts are described as LKQ, RCY, or USED. Reconditioned parts are described as Recond. Recored parts are described as Recore. NAGS Part Numbers and Benchmark Prices are provided by National Auto Glass Specifications. Labor operation times listed on the line with the NAGS information are MOTOR suggested labor operation times. NAGS labor operation times are not included. Pound sign (#) items indicate manual entries.

Some 2024 vehicles contain minor changes from the previous year. For those vehicles, prior to receiving updated data from the vehicle manufacturer, labor and parts data from the previous year may be used. The CCC ONE estimator has a list of applicable vehicles. Parts numbers and prices should be confirmed with the local dealership.

The following is a list of additional abbreviations or symbols that may be used to describe work to be done or parts to be repaired or replaced:

SYMBOLS FOLLOWING PART PRICE:

m=MOTOR Mechanical component. s=MOTOR Structural component. T=Miscellaneous Taxed charge category. X=Miscellaneous Non-Taxed charge category.

SYMBOLS FOLLOWING LABOR:

D=Diagnostic labor category. E=Electrical labor category. F=Frame labor category. G=Glass labor category. M=Mechanical labor category. S=Structural labor category. (numbers) 1 through 4=User Defined Labor Categories.

OTHER SYMBOLS AND ABBREVIATIONS:

Adj.=Adjacent. Algn.=Align. ALU=Aluminum. A/M=Aftermarket part. Blnd=Blend. BOR=Boron steel. CAPA=Certified Automotive Parts Association. CFC=Carbon Fiber.

D&R=Disconnect and Reconnect. HSS=High Strength Steel. HYD=Hydroformed Steel. Incl.=Included. LKQ=Like Kind and Quality. LT=Left. MAG=Magnesium. Non-Adj.=Non Adjacent. NSF=NSF International Certified Part. O/H=Overhaul. Qty=Quantity. Refn=Refinish. Repl=Replace. R&I=Remove and Install. R&R=Remove and Replace. Rpr=Repair. RT=Right. SAS=Sandwiched Steel. Sect=Section. STS=Stainless Steel. Subl=Sublet. UHS=Ultra High Strength Steel. N=Note(s) associated with the estimate line.

CCC ONE Estimating - A product of CCC Intelligent Solutions Inc.

The following is a list of abbreviations that may be used in CCC ONE Estimating that are not part of the MOTOR CRASH ESTIMATING GUIDE:

BAR=Bureau of Automotive Repair. EPA=Environmental Protection Agency. NHTSA= National Highway Transportation and Safety Administration. PDR=Paintless Dent Repair. VIN=Vehicle Identification Number.

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: REAR_BUMPER



File Name / Description: RIGHT_REAR_CORENR

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: LEFT_REAR_CORENR



File Name / Description: REAR_BUMPER _1

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: RIGHT_TAILLIGHT



File Name / Description: LIFTGATE

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: RIGHT_QTR_PANEL



File Name / Description: LEFT_KNEE_AIR_BAG

File #: 3703547 Claim # : G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: LEFT_SEAT_AIR_BAG



File Name / Description: LEFT_CURTAIN_AIR_BAG

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: RIGHT_CURTAIN_AIR_BAG



File Name / Description: DRIVERS_AIR_BAG

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: LEFT_FRONT_CORNER



File Name / Description: VIN

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: FRONT_BUMPER



File Name / Description: HOOD

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: FRONT_BUMPER _1



File Name / Description: RIGHT_FRONT_CORNER

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: FRONT_BUMPER _1 _1



File Name / Description: RIGHT_HEADLIGHT

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: RIGHT_FOG_LIGHT




File Name / Description: RIGHT_FENDER

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080

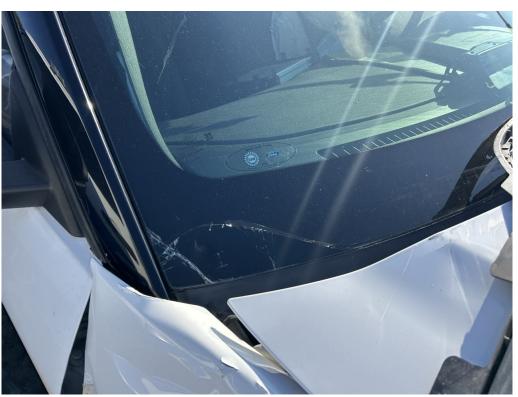

File Name / Description: WINDSHIELD



File Name / Description: RIGHT_FRONT_DOOR

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description:
RIGHT_FRONT_SUSPENSION



File Name / Description: RIGHT_FRONT_WHEEL

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: RIGHT_FENDER _1



File Name / Description: RIGHT_ROCKER_PANEL

File #: 3703547 Claim #: G4935 Date: 07/30/2025

Tom Carter Appraisal

11115 Monarch St Spring Hill, FL 34609 Phone (352) 653-5080



File Name / Description: RIGHT_REAR_DOOR