

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com

APPRAISAL SUMMARY - FILE # 3703547**COMPANY****Company:** Fleet Salvage Systems**Adjuster:** Michael Towers**INSPECTION****Recommendation:** Repairable**Date Contacted:** July 29, 2025**Date Inspected:** July 29, 2025**Appraiser:** Thomas Carter**CLAIM INFO****Claim Number:** G4935**Policy Number:****Deductible:** 0.00**Insured Name:** City of Clearwater**Date of Loss:** July 26, 2025**Loss Type:** Collision**Claim For:** Insured**VEHICLE OWNER****Name:** City of Clearwater**Address:** 1900 Grand Ave**Mobile Phone:****Home Phone:****Email:****VEHICLE LOCATION****Location:** With Owner**Location Name:** Clearwater, City of**Address** 1900 Grand Ave**City, ST, Zip:** Clearwater FL 33765**Phone****REPAIR SHOP****Name:****Address:****City, State, Zip:****Phone:****Email:****Fax:****TIN:****VEHICLE INFO****Year:** 2020**Make:** Ford**Model:** Police Interceptor Ut...**VIN:** 1FM5K8AB6LGC35489**License Plate:****Color:** White**Mileage:** 45838**Driveable:****TIRE INFORMATION****Tread Depth****Left Front:****Right Front:****Left Rear:****Right Rear:****Size:****TOWING & SALVAGE****Towing Charges:**\$ 0.00**Lien Fee:** \$ 0.00**Admin Fee:** \$ 0.00**Other Charges:** \$ 0.00**Storage Fee (per day):** \$ 0.00**Storage Since:****TOTAL LOSS****Total Loss:** Yes**Driveable:****Total Loss Valuation:**\$18,750**Request #:****Valuation Amount / TL %:**100%+**NADA Value / TL %:** \$0.00 /**ESTIMATE****Appraisal Amount:** \$ 42001.95**UPD Amount:**\$ 0.00**Betterment Amount:**\$ 0.00**Deductible:** \$ 0.00**SUPPLEMENTS****Supplement #1:** 0.00**Supplement #2:** 0.00**Supplement #3:** 0.00**Supplement #4:** 0.00

Net Total: \$ 42,001.95

Supplement #5: 0.00

Agreed Price:

Agreed By:

Days to Repair:

Estimate Released: No

SUMMARY COMMENTS

As per your request we inspected this vehicle at the owners lot. During the inspection we found collision damage to the right rear corner, right side, right front corner and air bags. This vehicle is a total loss.

Tom Carter Appraisal


11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com

Image not found or type unknown

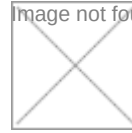

Salvage Bids

File # 3703547**Year:** 2020**Make:** Ford**Model:** Explorer**VIN #:****License plate #:****Color:**

Salvage Bids

#	Name	Contact	Phone	Amount(\$)
1	Fleet Financial FKA Fleet Salvage	Briana	(407) 834-3400	\$1,150.00
2	Budget Auto Parts	Bill	(407) 656-4707	\$1,000.00
3	Greenstar Auto Parts	Sam	(407) 531-7827	\$1,100.50

Tom Carter Appraisal

11115 Monarch St
Spring Hill, FL 34609
Phone: (352) 606-2272

Workfile ID:

2892bc0f

Estimate of Record**Owner: Clearwater, City of****Job Number:**

Written By: Thomas Carter

Insured: Clearwater, City of
Type of Loss: Collision
Point of Impact: 01 Right Front

Policy #:
Date of Loss:

Claim #: G4935
Days to Repair: 0

Owner:
Clearwater, City of
1900 Grand Ave
Clearwater, FL 33765

Inspection Location:
Clearwater, City of
1900 Grand Ave
Clearwater, FL 33765
Home

Repair Facility:**VEHICLE**

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

VIN: 1FM5K8AB6LGC35489
License:
State:

Production Date:
Odometer: 45,838
Condition: Good

Interior Color:
Exterior Color: White

TRANSMISSION

Automatic Transmission
4 Wheel Drive

POWER

Power Steering
Power Brakes
Power Windows
Power Locks
Power Mirrors
Power Driver Seat

DECOR

Dual Mirrors
Privacy Glass
Overhead Console

CONVENIENCE

Air Conditioning
Intermittent Wipers
Tilt Wheel
Cruise Control
Rear Defogger
Message Center
Steering Wheel Touch Controls
Rear Window Wiper
Telescopic Wheel
Climate Control
Backup Camera

RADIO

AM Radio
FM Radio
Stereo

Search/Seek
Auxiliary Audio Connection

SAFETY

Drivers Side Air Bag
Passenger Air Bag
Anti-Lock Brakes (4)
4 Wheel Disc Brakes
Traction Control
Stability Control
Front Side Impact Air Bags
Head/Curtain Air Bags
Hands Free Device
Xenon or L.E.D. Headlamps

SEATS

Cloth Seats

Bucket Seats
Reclining/Lounge Seats

WHEELS

Styled Steel Wheels

PAINT

Clear Coat Paint

OTHER

Rear Spoiler
California Emissions

TRUCK

Trailer Hitch
Trailer Package

Estimate of Record

Owner: Clearwater, City of

Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

Line	Oper	Description	Part Number	Qty	Extended Price \$	Labor	Paint
1	FRONT BUMPER						
2	Repl	Add for fog lamps		1		0.4	
3		O/H bumper assy				4.5	
4	Repl	Bumper cover w/o auto park	LB5Z17D957SCPTM	1	594.25	Incl.	2.4
5		Add for Clear Coat					1.0
6	Repl	Lower cover INTERCEPTOR	LB5Z17D957AB	1	293.78	Incl.	
7	Repl	RT Side trim w/o fog lamps	LB5Z15A246AA	1	90.55	Incl.	
8	Repl	LT Side trim w/o fog lamps	LB5Z15A245AA	1	81.15	Incl.	
9	Repl	Impact bar (ALU)	R1MZ17757A	1	626.22	0.6	
10	FRONT LAMPS						
11	Repl	RT Headlamp assy w/o adaptive headlamps level 2 headlamps	MB5Z13008AY	1	2,404.60	Incl.	
12		Aim headlamps				0.5	
13	Repl	RT Lamp assy red	LB5Z15A101J	1	1,761.82	0.3	
14	Repl	LT Lamp assy red	LB5Z15A101H	1	830.15	0.3	
15	HOOD						
16	Repl	Hood (ALU)	LB5Z16612A	1	1,144.80	1.1	3.0
17		Add for Clear Coat					1.2
18		Add for Underside(Complete)					1.5
19		Add for Clear Coat					0.3
20	FENDER						
21	Repl	RT Fender w/o HEV	RB5Z16005B	1	404.17	2.7	2.0
22		Overlap Major Adj. Panel					-0.4
23		Add for Clear Coat					0.3
24		Add for Edging					0.5
25		Add for Clear Coat					0.1
26	Repl	RT Fender liner	LB5Z16102D	1	134.43	Incl.	
27	Repl	RT Wheel flare w/o auto park	LB5Z16038AC	1	295.30	0.3	
28	R&I	LT Wheel flare w/o auto park				0.3	
29	WHEELS						
30	Repl	RT/Front Wheel, steel	LB5Z1015B	1	728.20 m	0.3	
31	FRONT SUSPENSION						
32		O/H frt susp rt			m	3.5	
33	Repl	RT Hub assy	LB5Z1104E	1	325.45 m	Incl.	
34	Repl	RT Knuckle w/INTERCEPTOR	LB5Z3K185A	1	348.00 m	Incl.	
35	Repl	RT Rr lwr cntl arm w/INTERCEPTOR	LB5Z3078B	1	252.00 m	Incl.	
36		Deduct for Overlap				Incl.	
37	Repl	RT Ft lwr cntl arm w/INTERCEPTOR	LB5Z3082B	1	372.30 m	Incl.	
38		Deduct for Overlap				Incl.	
39	Repl	Stabilizer bar w/INTERCEPTOR	LB5Z5482C	1	322.67 m	1.6	
40	Repl	RT Stabilizer link	LB5Z5K484A	1	72.69 m	Incl.	

Estimate of Record

Owner: Clearwater, City of

Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

41	Repl	RT Strut w/INTERCEPTOR 3.3 liter GAS	LB5Z18124H	1	182.00	m	Incl.
42		Deduct for Overlap					Incl.
43		Deduct for Overlap					Incl.
44	WINDSHIELD						
45	Repl	Windshield FORD, w/INTERCEPTOR w/o collision mitigation	LB5Z7803100K	1	466.02		3.3
46	RESTRAINT SYSTEMS						
47	Repl	LT Ft seat air bag nut	W520101S442	1	4.25		
48	Repl	RT Ft seat air bag nut	W520101S442	1	4.25		
49	Repl	LT Ft seat air bag	MB5Z78611D11C	1	222.75	m	0.7
50		Air bag system diagnosis ck system operation				m	0.5
51		Air bag system diagnosis pinpoint test				m	2.1
52	Repl	RT Ft seat air bag	MB5Z78611D10C	1	223.20	m	0.7
53	Repl	LT Knee air bag nut	W520101S442	1	4.25		
54	Repl	LT Head air bag nut	W702751S442	1	3.25		
55	Repl	RT Head air bag nut	W702751S442	1	3.25		
56	Repl	LT Head air bag	LB5Z78042D95C	1	914.63	m	0.6
57	Repl	RT Head air bag	LB5Z78042D94C	1	914.63	m	0.6
58	Repl	LT Knee air bag	LB5Z78045J77AA	1	394.37	m	0.5
59	Repl	Driver air bag ST, INTERCEPTOR	LB5Z78043B13AC	1	475.33	m	Incl.
60	Repl	Clockspring w/o heated strng whl	GN1Z14A664D	1	255.40	m	1.2
61	Repl	Control module	LB5Z14B321A	1	476.68	m	0.3
62	Repl	LT Ft impact sensor	L1TZ14B004A	1	63.20	m	0.3
63	Repl	RT Ft impact sensor	L1TZ14B004A	1	63.20	m	0.3
64	Repl	LT Ft impact sensor bolt	W500215S442	1	3.25		
65	Repl	RT Side impact sens front	ML3Z14B345A	1	74.15	m	0.3
66	Repl	LT Side impact sens front	ML3Z14B345A	1	74.15	m	0.3
67	Repl	RT Side impact sens rear	L1TZ14B004A	1	63.20	m	0.3
68	Repl	LT Side impact sens rear	L1TZ14B004A	1	63.20	m	0.3
69	Repl	RT Position sensor	FL3Z14B416B	1	31.20	m	0.3
70	Repl	LT Position sensor	FL3Z14B416A	1	32.10	m	0.3
71	Repl	RT Ft impact sensor bolt	W500215S442	1	3.25		
72	Repl	RT Lower bracket	LB5Z78611C34B	1	23.42		
73	Repl	LT Lower bracket	LB5Z78611C35A	1	15.77		
74	Repl	RT Buckle end w/INTERCEPTOR	LB5Z7861202AA	1	210.92		0.2
75	Repl	LT Buckle end w/INTERCEPTOR	KS7Z5461203CA	1	152.70		0.2
76	Repl	LT Height adjuster	LB5Z78602B82A	1	49.43		0.1
77	Repl	RT Height adjuster	LB5Z78602B82A	1	49.43		0.1
78	Repl	LT Seat belt assy ebony	LB5Z78611B09AA	1	389.63	m	0.3
79	Repl	RT Seat belt assy ebony	LB5Z78611B08AA	1	436.15	m	0.3
80	ROOF						
81	Repl	Headliner ebony	LB5Z7851916PL	1	1,548.00		4.7

Estimate of Record

Owner: Clearwater, City of

Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

82	PILLARS, ROCKER & FLOOR						
83	Repl	RT Wndshld plr trim ebony INTERCEPTOR	LB5Z7803598AD	1	128.27	Incl.	
84	Repl	LT Wndshld plr trim ebony INTERCEPTOR	LB5Z7803599AD	1	128.27	Incl.	
85	Repl	RT Upr ctr plr trim ebony	LB5Z7824346AF	1	99.53	Incl.	
86	Repl	LT Upr ctr plr trim ebony	LB5Z7824347AF	1	99.53	Incl.	
87	Repl	RT Lwr ctr plr trim ebony w/INTERCEPTOR	LB5Z7824346PA	1	232.77	Incl.	
88	Repl	LT Lwr ctr plr trim ebony w/INTERCEPTOR	LB5Z7824347PA	1	229.62	0.3	
89	Repl	RT Aperture panel	NB5Z78211A10A	1	537.57	20.0	4.0
90		Overlap Major Adj. Panel					-0.4
91		Add for Clear Coat					0.7
92	Repl	RT Rocker panel	NB5Z7810128A	1	488.33	9.0	2.0
93		Overlap Major Adj. Panel					-0.4
94		Add for Clear Coat					0.3
95	Repl	RT Rocker molding	LB5Z7810176AC	1	306.20	0.5	
96	FRONT DOOR						
97	*	Rpr RT Door shell				5.0	2.4
98		Overlap Major Adj. Panel					-0.4
99	*	Add for Clear Coat					0.4
100	REAR DOOR						
101	*	Rpr RT Door assy				5.0	2.5
102		Overlap Major Adj. Panel					-0.4
103	*	Add for Clear Coat					0.4
104	QUARTER PANEL						
105	Repl	RT Quarter pnl assy	NB5Z78278A92A	1	1,356.35	18.5	3.5
106		Overlap Major Adj. Panel					-0.4
107	*	Add for Clear Coat					0.6
108		Deduct for Overlap				-2.0	
109	LIFT GATE						
110	*	Rpr Lift gate				4.0	2.3
111		Overlap Major Adj. Panel					-0.4
112	*	Add for Clear Coat					0.4
113	Repl	Rear molding INTERCEPTOR	LB5Z7842512BA	1	755.97	0.3	
114	Repl	Nameplate "INTERCEPTOR"	LB5Z7842528A	1	28.08	0.1	
115	REAR LAMPS						
116	Repl	RT Tail lamp assy level 1, 2	LB5Z13404F	1	794.65	Incl.	
117	REAR BUMPER						
118		O/H rear bumper				2.2	
119	Repl	Upper cover	LB5Z17810BCPTM	1	356.70	Incl.	2.4
120		Add for Clear Coat					1.0
121		Deduct for Rear Bumper R&I				-1.2	
122	Repl	Lower cover	LB5Z17K835EE	1	358.93	Incl.	
123	Repl	Isolator	LB5Z17E855D	1	123.42	0.2	

Estimate of Record

Owner: Clearwater, City of

Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

124		Repl	RT Side support	LB5Z17D942C	1	41.17		0.1	
125		Repl	RT Reflector	LB5Z13A565A	1	36.25		Incl.	
126		Repl	Support	LB5Z17E855B	1	149.27		0.2	
127	#	Subl	Hazardous waste removal		1	3.50	X		
128	#	Repl	Cover Car		1	5.00	T	0.3	
129	#		Color tint / color match		1				0.5
130	#	Rpr	Color sand and buff						2.0
131	#	Repl	Corrosion protection primer		1	10.00	T		
132	#	Repl	Flex additive		1	8.00	T		
133	#	Rpr	Setup & measure					2.0	F
134	#	Rpr	Unibody structural repair					4.0	F
135	#	Rpr	Damage from unibody clamps					2.0	1.0
136	#	Subl	Four wheel alignment		1	229.99	T		
137	#	Subl	Tire mount & wheel balance		1	65.00	T		
138	#	Rpr	Safety Check					1.0	M
139	#	Repl	Urethane kit		1	50.00			
140	#		Covid Cleaning Pre & Post		1			1.0	
141	#	Rpr	Send To Dealer To Diag SRS system					2.0	M
142	#	Rpr	Clear Codes					1.0	
143	#		Prep Unprimed Bumper		1				1.0
144	#	Rpr	Recalibrate Auto Integrated Circuit					2.5	
145	#		Calibrate Steering Angle Sensor		1			2.0	M
146	#		Recalibrate Camera System After Alignment		1	450.00			
147	#		Clean Vehicle of excessive dirt before applying car cover		1			1.0	
148	#		D & R Battery		1			0.5	M
149	#		Clean & Prep Area From Old Adhesives		1			2.0	
150	#		Remove Decals/stickers/labels		1			4.0	
151	#		Decals		1	1,250.00			
SUBTOTALS						27,295.51		122.7	36.9

Estimate of Record

Owner: Clearwater, City of

Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

ESTIMATE TOTALS

Category	Basis			Rate	Cost \$
Parts					26,974.02
Body Labor	111.2 hrs	@		\$ 65.00 /hr	7,228.00
Paint Labor	36.9 hrs	@		\$ 65.00 /hr	2,398.50
Mechanical Labor	5.5 hrs	@		\$ 110.00 /hr	605.00
Frame Labor	6.0 hrs	@		\$ 65.00 /hr	390.00
Paint Supplies	36.9 hrs	@		\$ 45.00 /hr	1,660.50
Miscellaneous					321.49
Subtotal					39,577.51
Sales Tax	Tier 1	\$ 5,000.01	@	7.0000 %	350.00
Sales Tax	Tier 2	\$ 34,574.00	@	6.0000 %	2,074.44
Total Cost of Repairs					42,001.95
Deductible					0.00
Total Adjustments					0.00
Net Cost of Repairs					42,001.95

ANY PERSON WHO KNOWINGLY AND WITH INTENT TO INJURE, DEFRAUD, OR DECEIVE ANY INSURER FILES A STATEMENT OF CLAIM OR AN APPLICATION CONTAINING ANY FALSE, INCOMPLETE, OR MISLEADING INFORMATION IS GUILTY OF A FELONY OF THE THIRD DEGREE (FLORIDA STATUTES TITLE XLVI, CHAPTER 817.234). FAILURE TO USE THE INSURANCE PROCEEDS IN ACCORDANCE WITH THE SECURITY AGREEMENT, IF ANY, COULD BE A VIOLATION OF S. 812.014, FLORIDA STATUTES. IF YOU HAVE ANY QUESTIONS, CONTACT YOUR LENDING INSTITUTION. IF A CHARGE FOR SHOP SUPPLIES OR HAZARDOUS OR OTHER WASTE REMOVAL IS INCLUDED ON THIS ESTIMATE, PLEASE NOTE THE FOLLOWING: "THIS CHARGE REPRESENTS COSTS AND PROFITS TO THE MOTOR VEHICLE REPAIR FACILITY FOR MISCELLANEOUS SHOP SUPPLIES OR WASTE DISPOSAL." IF A CHARGE FOR NEW TIRES OR A NEW OR REMANUFACTURED LEAD-ACID BATTERY IS INCLUDED ON THIS ESTIMATE, PLEASE NOTE THE FOLLOWING: A \$1.00 FEE FOR EACH NEW MOTOR VEHICLE TIRE SOLD AT RETAIL IS IMPOSED ON ANY PERSON ENGAGING IN THE BUSINESS OF MAKING RETAIL SALES OF NEW MOTOR VEHICLE TIRES WITHIN THE STATE OF FLORIDA. FLORIDA STATUTES TITLE XXIX CHAPTER 403.718. A \$1.50 FEE FOR EACH NEW OR REMANUFACTURED LEAD-ACID BATTERY SOLD AT RETAIL IS IMPOSED ON ANY PERSON ENGAGING IN THE BUSINESS OF MAKING RETAIL SALES OF NEW OR REMANUFACTURED LEAD-ACID BATTERIES WITHIN THE STATE OF FLORIDA. FLORIDA STATUTES TITLE XXIX 403.7185.

Owner: Clearwater, City of

Job Number:

2020 FORD Police Interceptor Utility Vehicle AWD (Fleet) 4D UTV 6-3.3L Flex Fuel White

Estimate based on MOTOR CRASH ESTIMATING GUIDE and potentially other third party sources of data. Unless otherwise noted, (a) all items are derived from the Guide DR2MF20, CCC Data Date 07/17/2025, and potentially other third party sources of data; and (b) the parts presented are OEM-parts. OEM parts are manufactured by or for the vehicle's Original Equipment Manufacturer (OEM) according to OEM's specifications for U.S. distribution. OEM parts are available at OE/Vehicle dealerships or the specified supplier. OPT OEM (Optional OEM) or ALT OEM (Alternative OEM) parts are OEM parts that may be provided by or through alternate sources other than the OEM vehicle dealerships with discounted pricing. Asterisk (*) or Double Asterisk (**) indicates that the parts and/or labor data provided by third party sources of data may have been modified or may have come from an alternate data source. Tilde sign (~) items indicate MOTOR Not-Included Labor operations. The symbol (<>) indicates the refinish operation WILL NOT be performed as a separate procedure from the other panels in the estimate. Non-Original Equipment Manufacturer aftermarket parts are described as Non OEM, A/M or NAGS. Used parts are described as LKQ, RCY, or USED. Reconditioned parts are described as Recond. Recored parts are described as Recore. NAGS Part Numbers and Benchmark Prices are provided by National Auto Glass Specifications. Labor operation times listed on the line with the NAGS information are MOTOR suggested labor operation times. NAGS labor operation times are not included. Pound sign (#) items indicate manual entries.

Some 2024 vehicles contain minor changes from the previous year. For those vehicles, prior to receiving updated data from the vehicle manufacturer, labor and parts data from the previous year may be used. The CCC ONE estimator has a list of applicable vehicles. Parts numbers and prices should be confirmed with the local dealership.

The following is a list of additional abbreviations or symbols that may be used to describe work to be done or parts to be repaired or replaced:

SYMBOLS FOLLOWING PART PRICE:

m=MOTOR Mechanical component. s=MOTOR Structural component. T=Miscellaneous Taxed charge category. X=Miscellaneous Non-Taxed charge category.

SYMBOLS FOLLOWING LABOR:

D=Diagnostic labor category. E=Electrical labor category. F=Frame labor category. G=Glass labor category. M=Mechanical labor category. S=Structural labor category. (numbers) 1 through 4=User Defined Labor Categories.

OTHER SYMBOLS AND ABBREVIATIONS:

Adj.=Adjacent. Algn.=Align. ALU=Aluminum. A/M=Aftermarket part. Blnd=Blend. BOR=Boron steel. CAPA=Certified Automotive Parts Association. CFC=Carbon Fiber. D&R=Disconnect and Reconnect. HSS=High Strength Steel. HYD=Hydroformed Steel. Incl.=Included. LKQ=Like Kind and Quality. LT=Left. MAG=Magnesium. Non-Adj.=Non Adjacent. NSF=NSF International Certified Part. O/H=Overhaul. Qty=Quantity. Refn=Refinish. Repl=Replace. R&I=Remove and Install. R&R=Remove and Replace. Rpr=Repair. RT=Right. SAS=Sandwiched Steel. Sect=Section. STS=Stainless Steel. Subl=Sublet. UHS=Ultra High Strength Steel. N=Note(s) associated with the estimate line.

CCC ONE Estimating - A product of CCC Intelligent Solutions Inc.

The following is a list of abbreviations that may be used in CCC ONE Estimating that are not part of the MOTOR CRASH ESTIMATING GUIDE:

BAR=Bureau of Automotive Repair. EPA=Environmental Protection Agency. NHTSA= National Highway Transportation and Safety Administration. PDR=Paintless Dent Repair. VIN=Vehicle Identification Number.

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

REAR_BUMPER



File Name / Description:

RIGHT_REAR_CORENR

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

LEFT_REAR_CORENR



File Name / Description:

REAR BUMPER_1

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:
RIGHT_TAILLIGHT



File Name / Description:
LIFTGATE

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:
RIGHT_QTR_PANEL



File Name / Description:
LEFT_KNEE_AIR_BAG

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

LEFT_SEAT_AIR_BAG



File Name / Description:

LEFT_CURTAIN_AIR_BAG

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:
RIGHT_CURTAIN_AIR_BAG



File Name / Description:
DRIVERS_AIR_BAG

Assignment Info

File # : 3703547
Claim # : G4935
Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St
Spring Hill, FL 34609
Phone (352) 653-5080
Email thomascarter352@yahoo.com



File Name / Description:
LEFT_FRONT_CORNER



File Name / Description:
VIN

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

FRONT_BUMPER



File Name / Description:

HOOD

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

FRONT_BUMPER_1



File Name / Description:

RIGHT_FRONT_CORNER

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

FRONT_BUMPER_1_1



File Name / Description:

RIGHT_HEADLIGHT

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

RIGHT_FOG_LIGHT



File Name / Description:

RIGHT_FENDER

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:
WINDSHIELD



File Name / Description:
RIGHT_FRONT_DOOR

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

RIGHT_FRONT_SUSPENSION



File Name / Description:

RIGHT_FRONT_WHEEL

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

RIGHT_FENDER_1



File Name / Description:

RIGHT_ROCKER_PANEL

Assignment Info

File # : 3703547

Claim # : G4935

Date : 07/30/2025

Tom Carter Appraisal

11115 Monarch St

Spring Hill, FL 34609

Phone (352) 653-5080

Email thomascarter352@yahoo.com



File Name / Description:

RIGHT_REAR_DOOR